

LKB-ADDs, Plus Schematic

REV : A02


@	:	Depop Component for All
1@	:	Pop Component for Lindbergh Series
2@	:	Pop Component for Kapalua series
3@	:	Depop Component for Lindbergh Plus series
4@	:	Pop Component for Lindbergh Plus series

DDQ12/LA1901 Schematic with Capture CIS and Function field
uFCPGA Banias
01-02-2004
REV: 3.0

DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.

Title		
Cover Sheet		
Size	Document Number	Rev
	DDQ12/12/01 with LA-1901	3.0
Date:	Wednesday, January 07, 2004	Sheet 1 of 59

Block Diagram

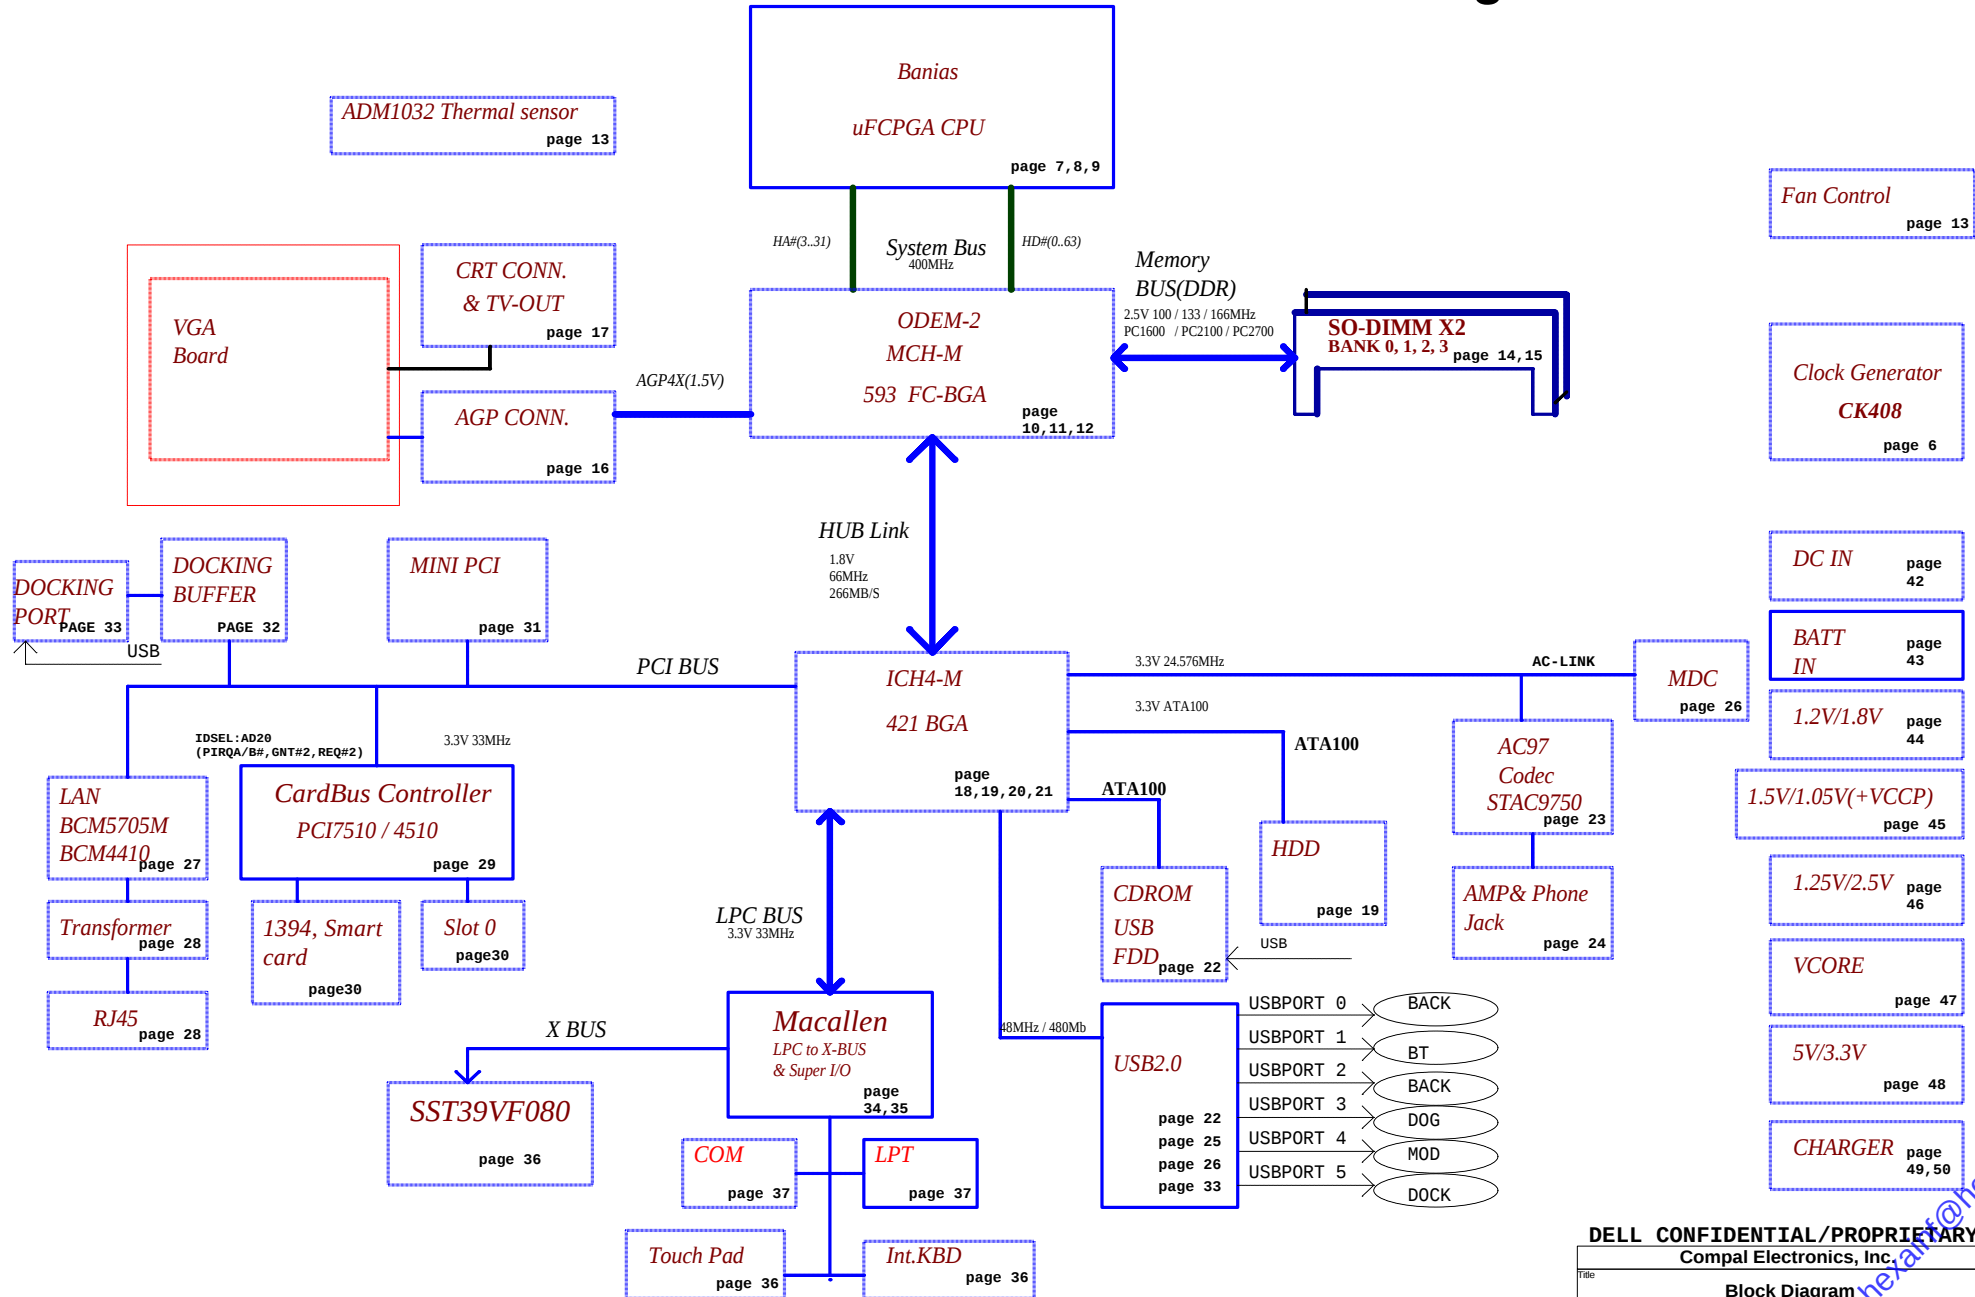

PM TABLE

State \ power plane	+3VALW +5VALW	+3VSUS +5VSUS +2.5V_MEM +1.5VSUS	+5VRUN +3VRUN +1.8VRUN +1.5VRUN +1.2VRUN +VCC_CORE +VCCP +12V
S0	ON	ON	ON
S1	ON	ON	ON
S3	ON	ON	OFF
S5 S4/AC	ON	OFF	OFF
S5 S4/AC don't exist	OFF	OFF	OFF

PCI TABLE


PCI DEVICE	IDSEL	REQ#/GNT#	PIRQ
CARD BUS	AD17	1	D, C
LAN	AD16	4	C
DOCK	AD24	0	B
MINI PCI	AD19	3	D, B(NP)
VGA			A, B(NP)


USB TABLE


USB PORT#	DESTINATION
0	BACK
1	BLUETOOTH
2	BACK
3	DOG
4	MOD
5	DOCK


DELL CONFIDENTIAL/PROPRIETARY







Compal Electronics, Inc.			
Title			
Index and Config			
Size	Document Number	DDQ12/11/01 with LA-1901	Rev 3.0
Date:	Wednesday, January 07, 2004	Sheet 3	of 59

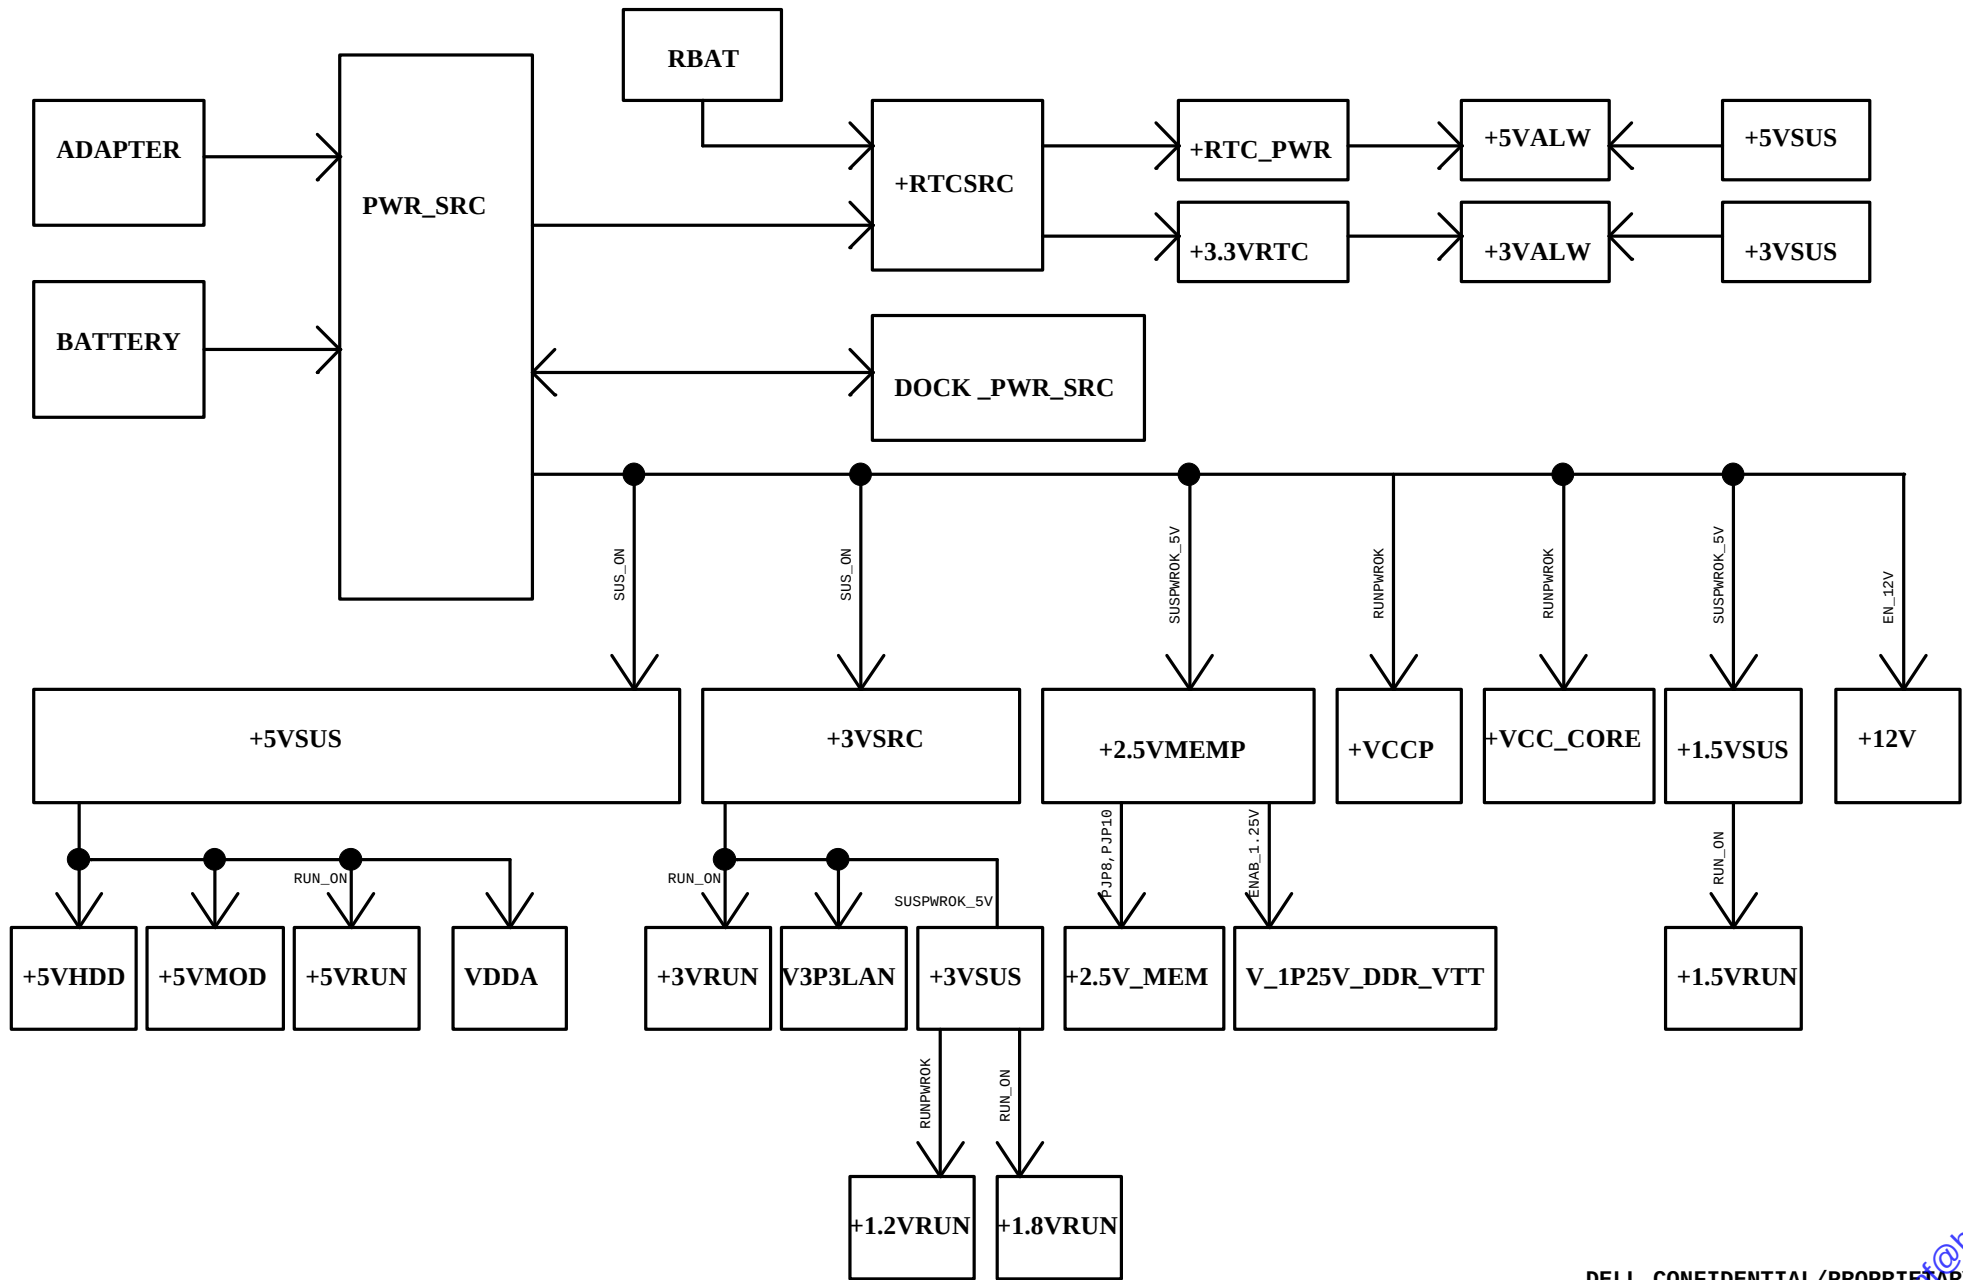

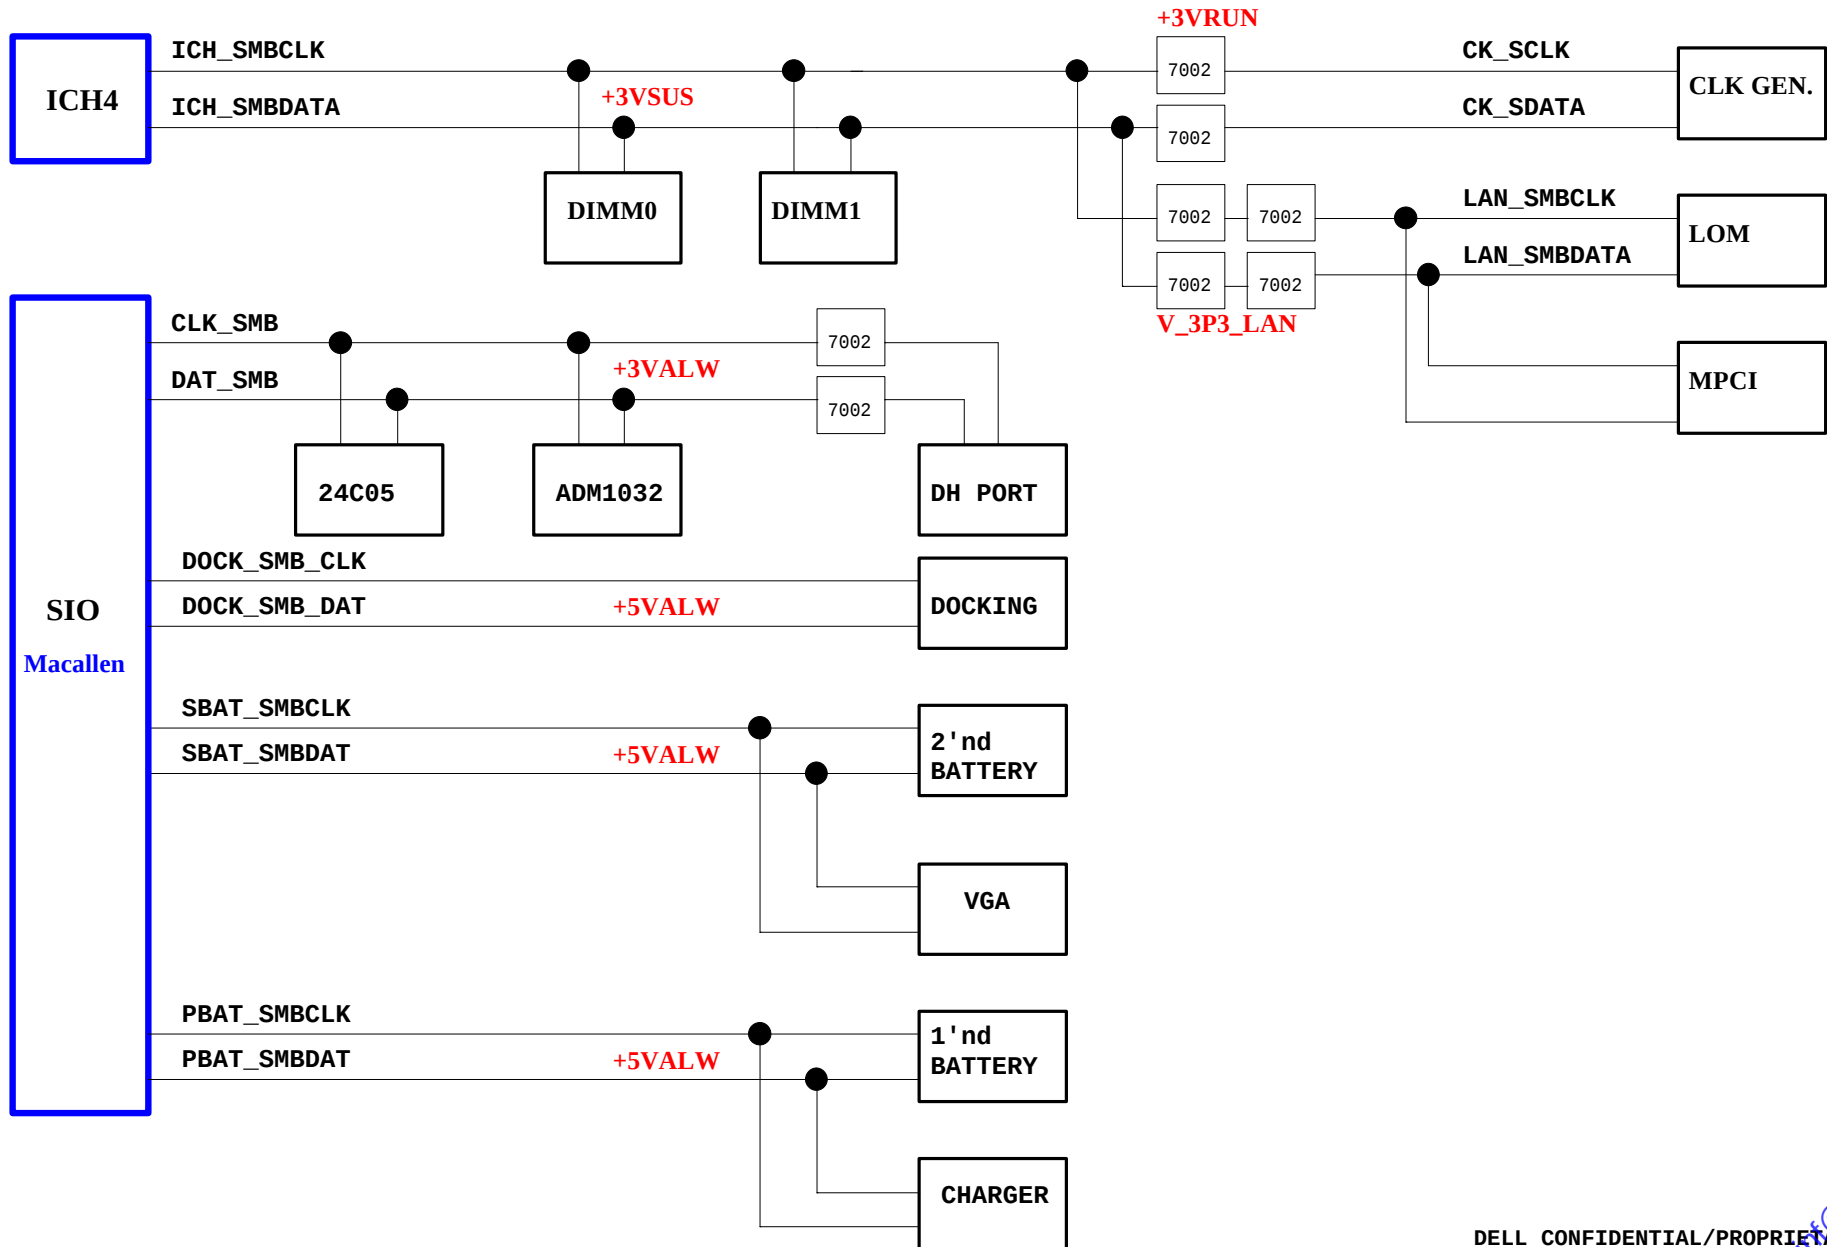















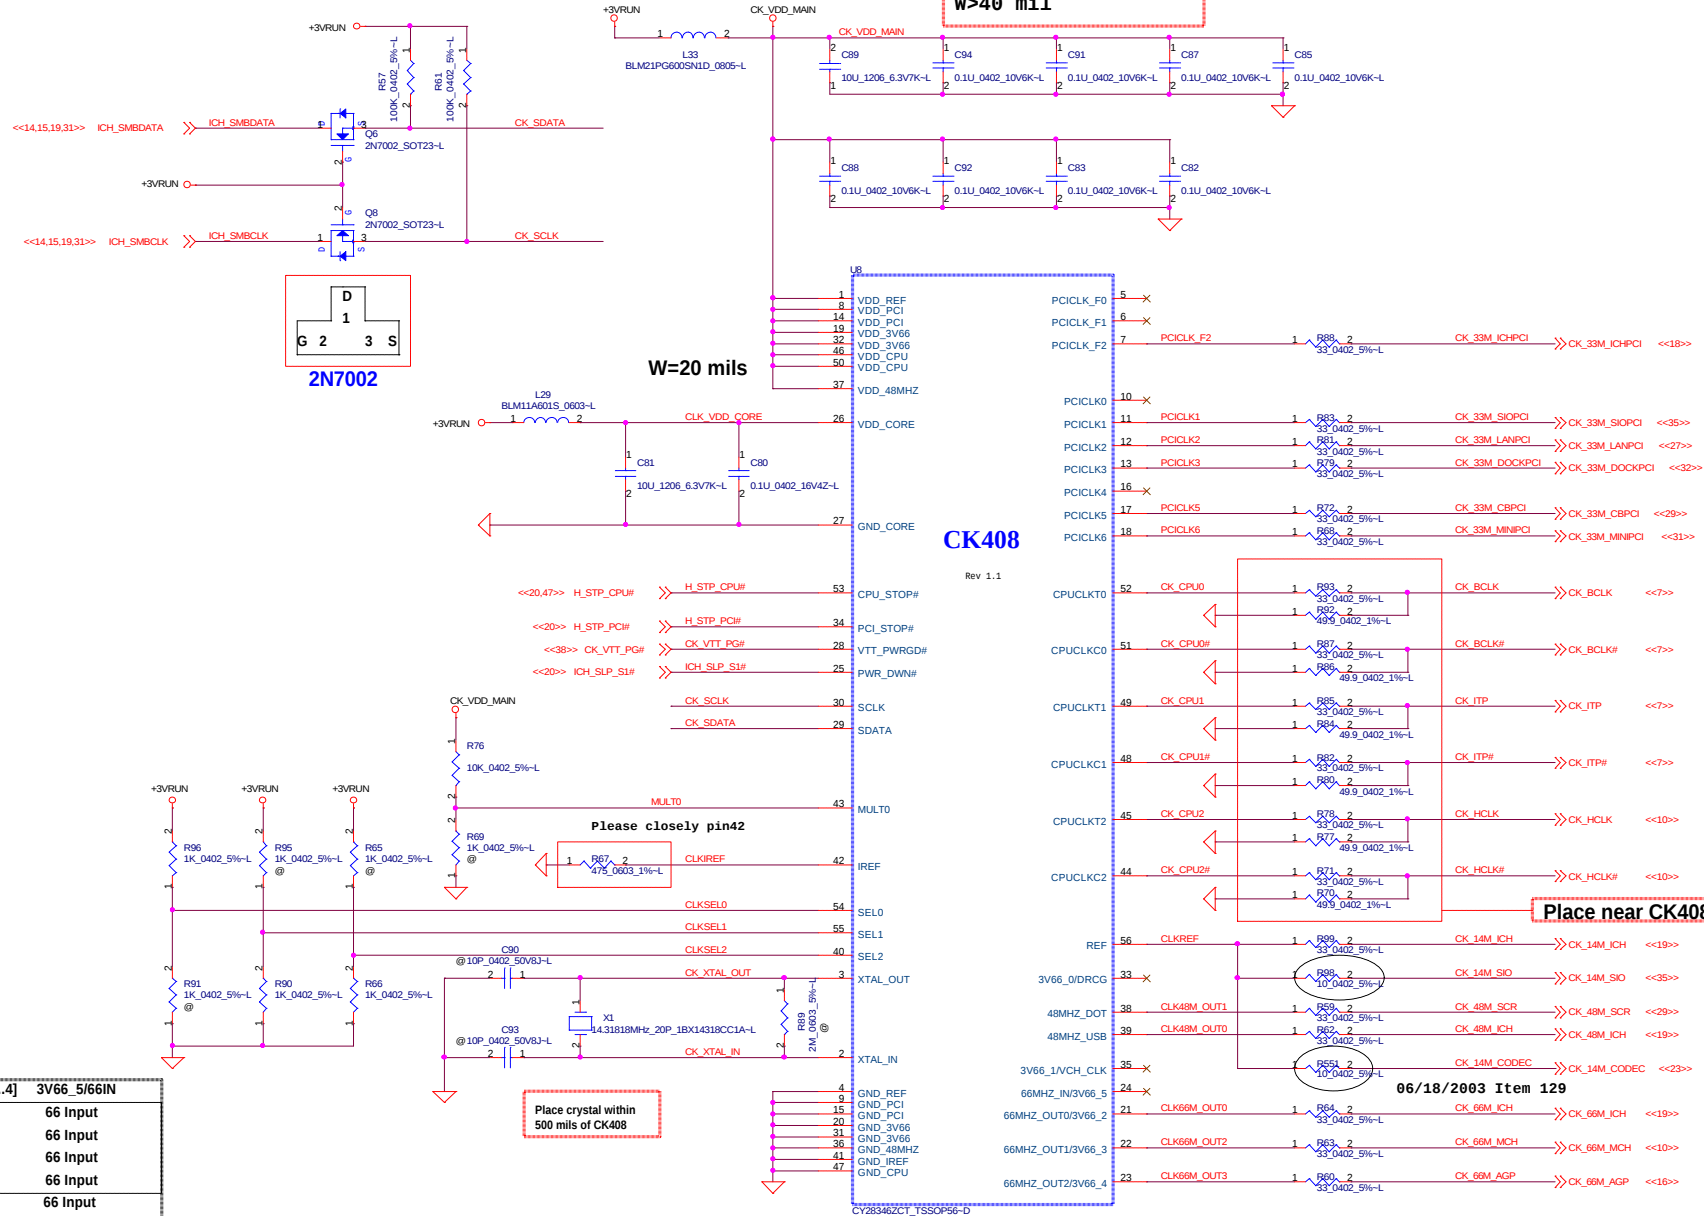


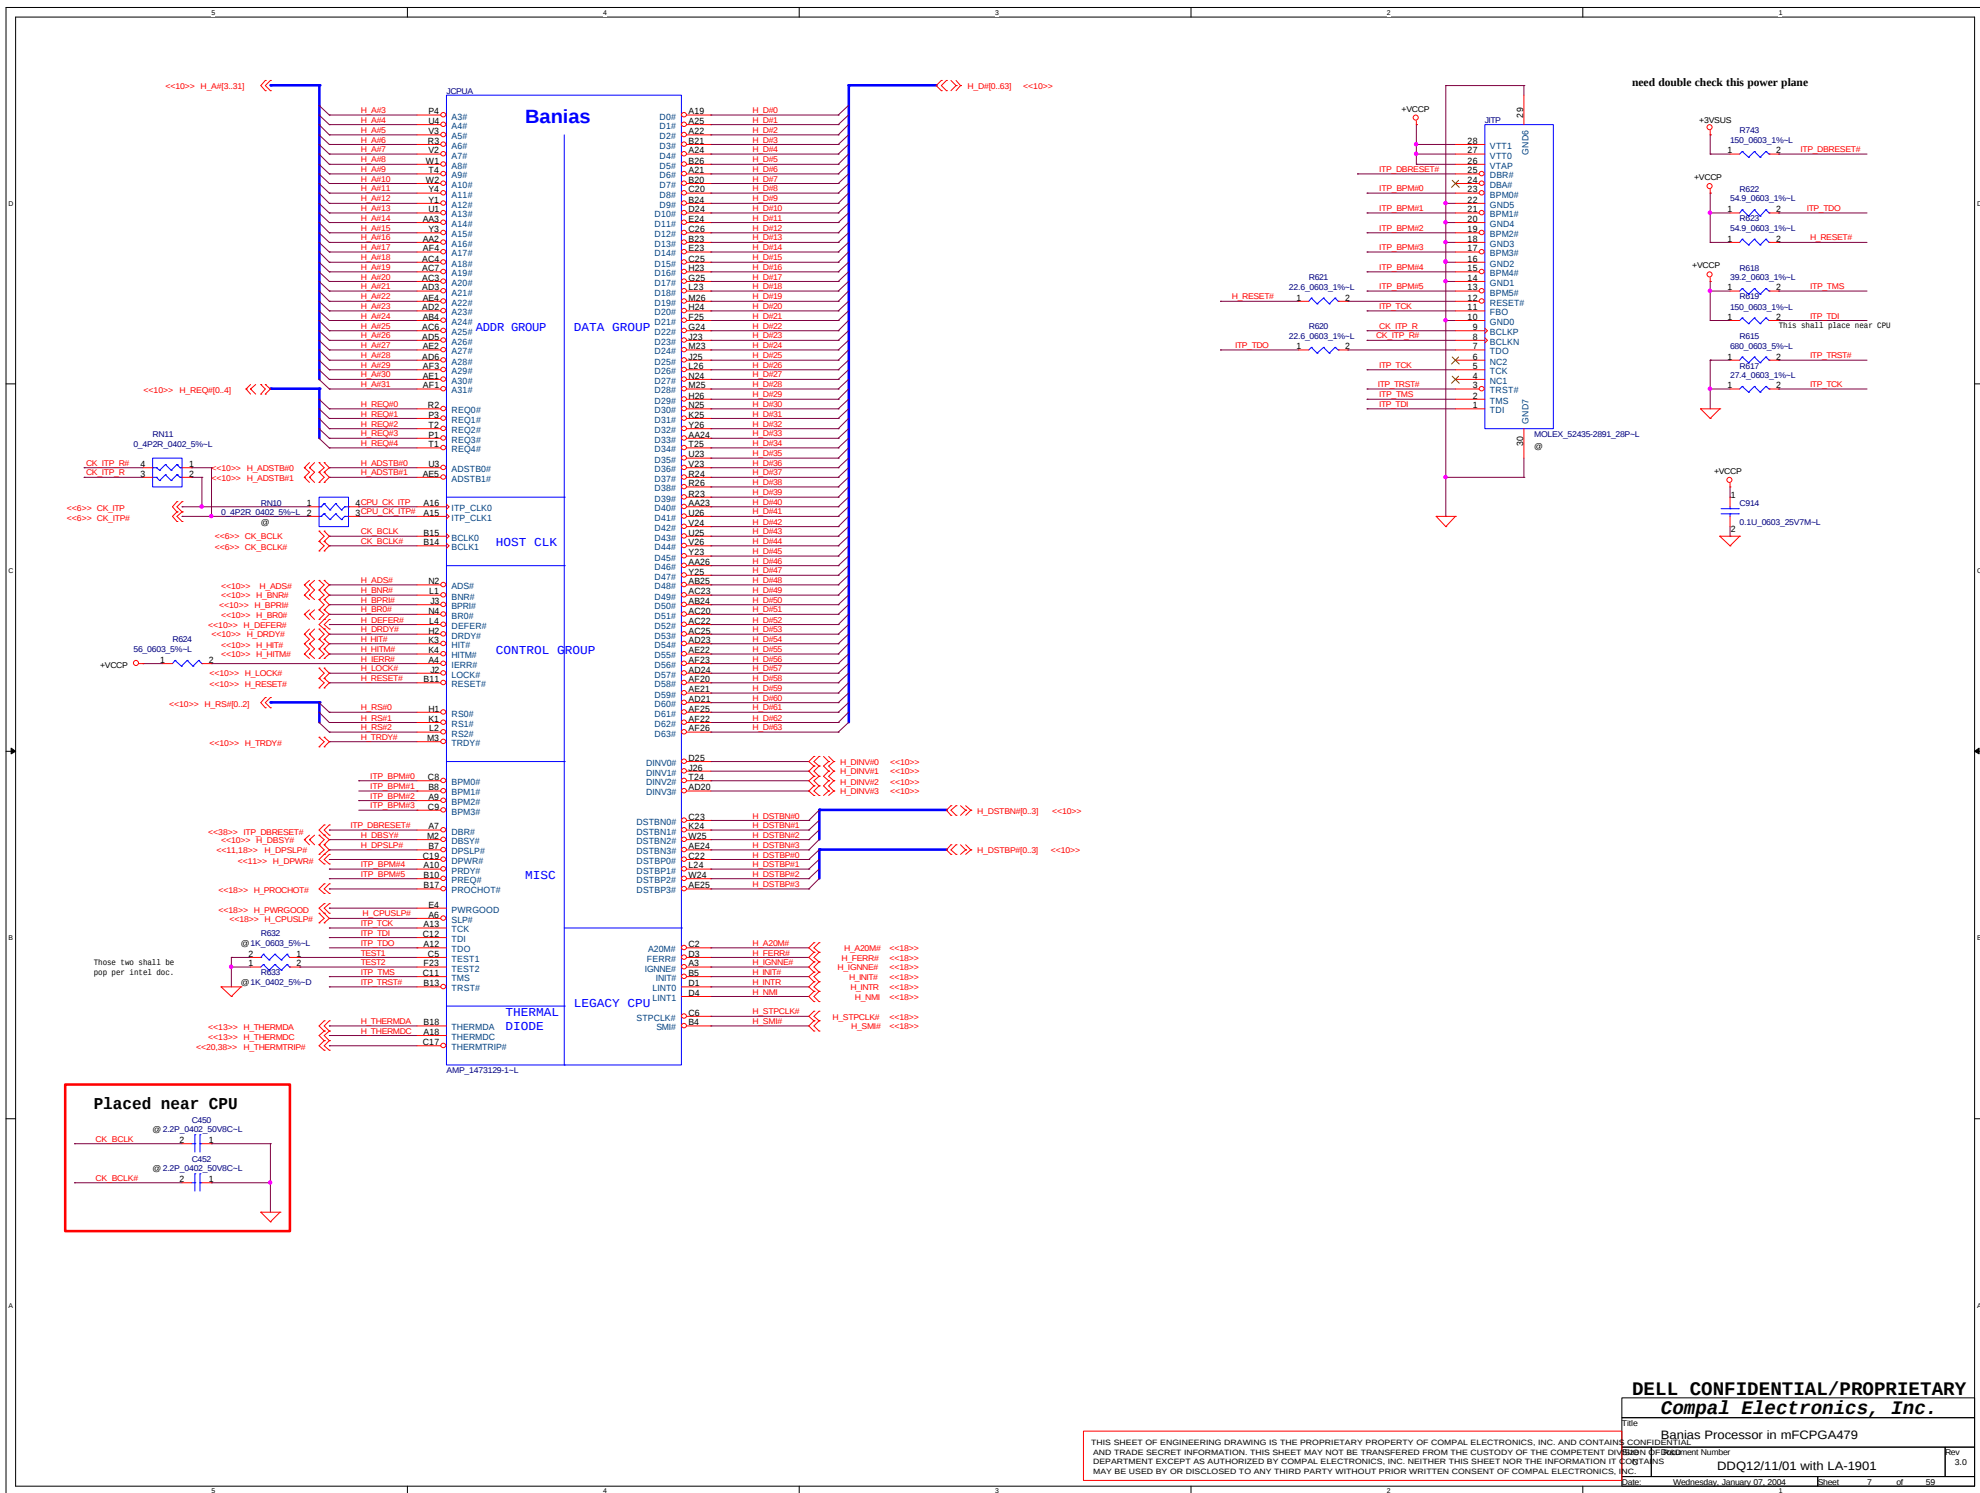

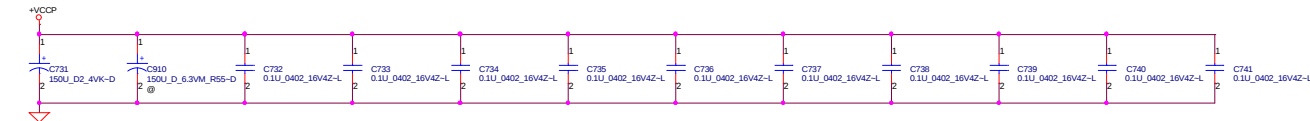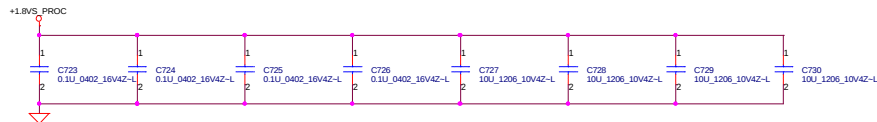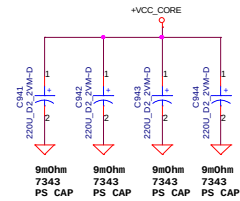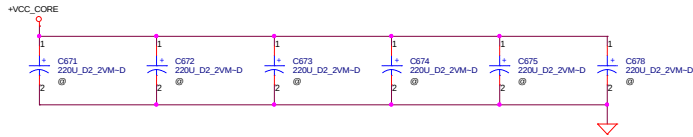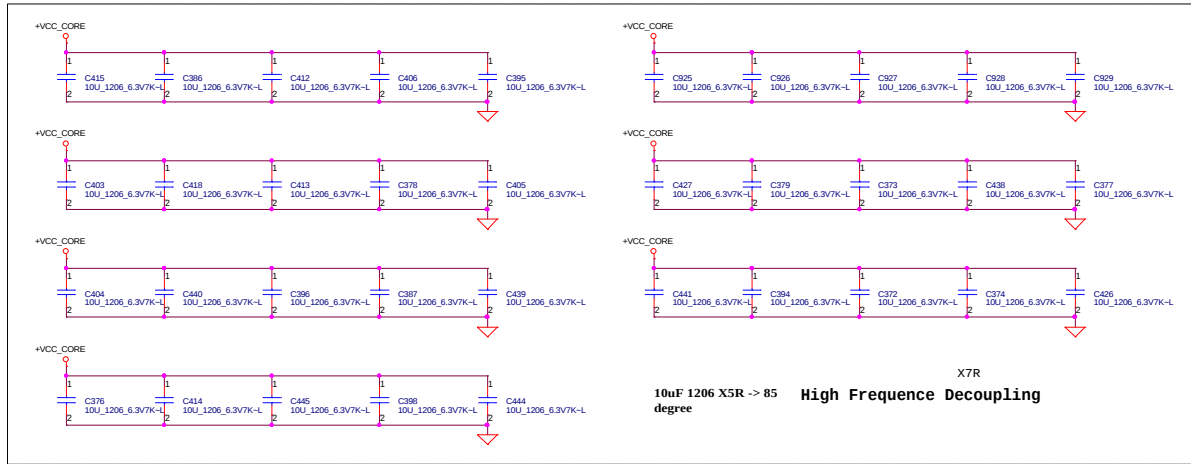

DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.



Title CPU Bypass		
Size C	Document Number DDQ12/11/01 with LA-1901	Rev 3.0
Date Wednesday, January 07, 2004	Sheet 9	of 59

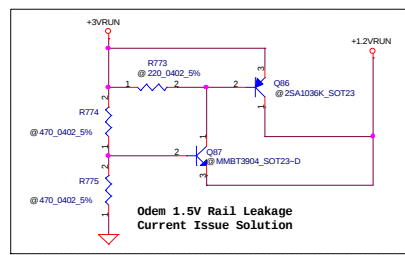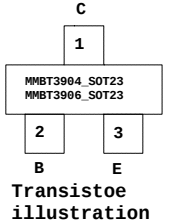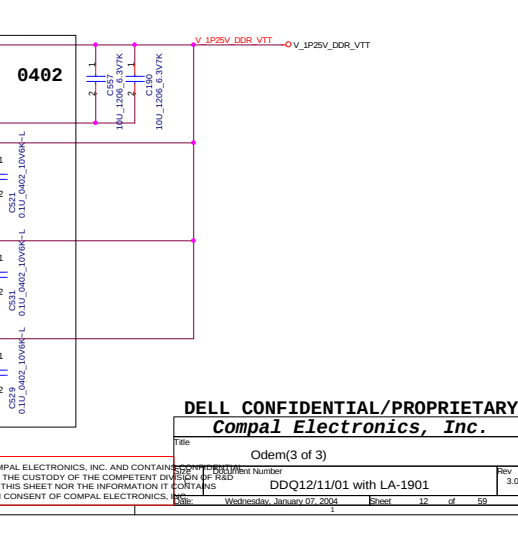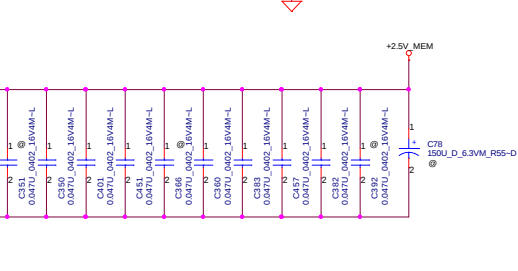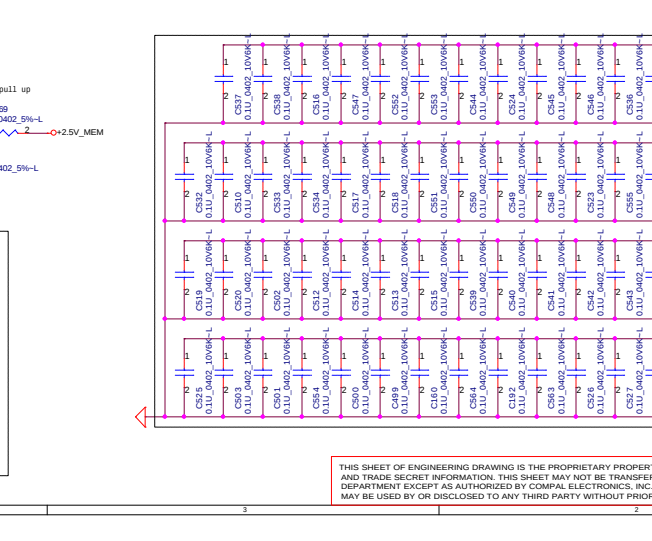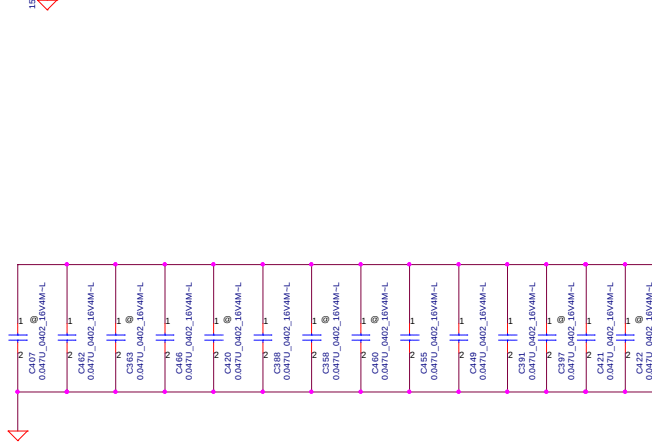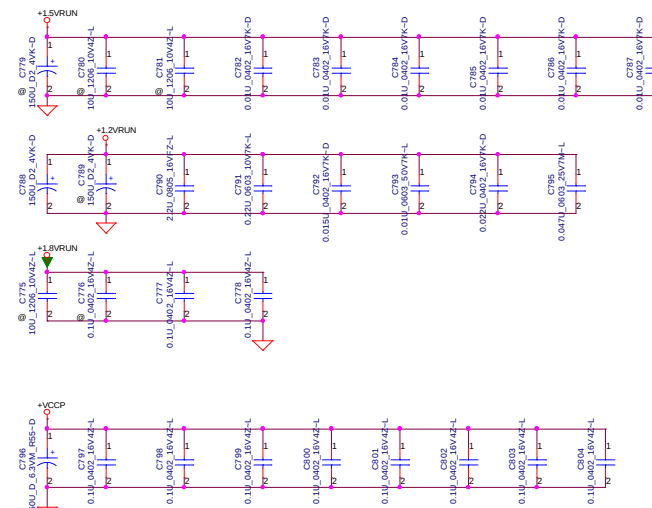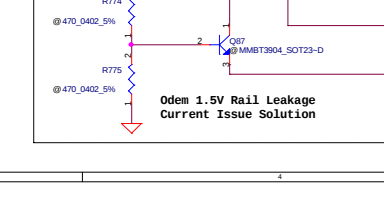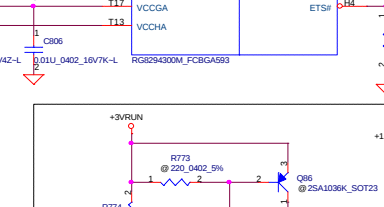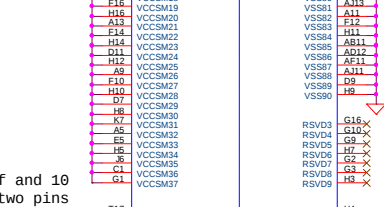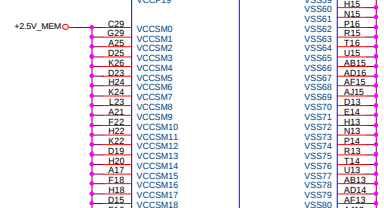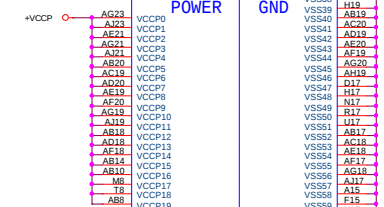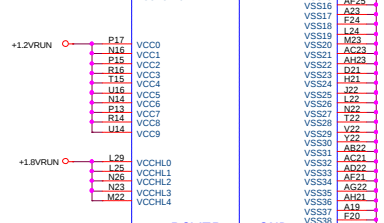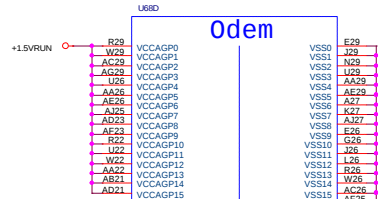

DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.

Title: Odem(3 of 3)
 Part Number: DDQ12/11/01 with LA-1901
 Date: Wednesday, January 07, 2004
 Page: 12 of 59

THIS SHEET OF ENGINEERING DRAWING IS THE PROPRIETARY PROPERTY OF COMPAL ELECTRONICS, INC. AND CONTAINS TRADE SECRET INFORMATION. THIS SHEET MAY NOT BE TRANSFERRED FROM THE CUSTODY OF THE COMPETENT DIVISION OF COMPAL ELECTRONICS, INC. WITHOUT THE WRITTEN PERMISSION OF COMPAL ELECTRONICS, INC. NO PART OF THIS SHEET MAY BE USED BY OR DISCLOSED TO ANY THIRD PARTY WITHOUT PRIOR WRITTEN CONSENT OF COMPAL ELECTRONICS, INC.

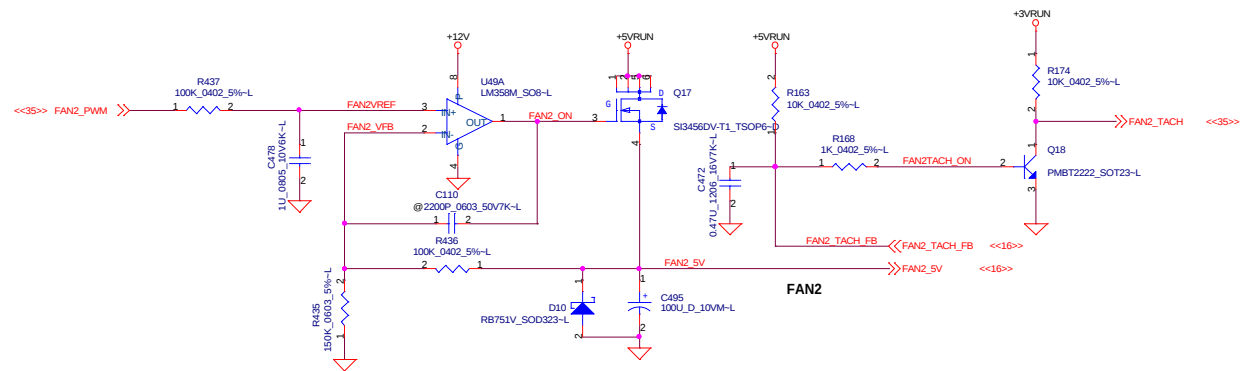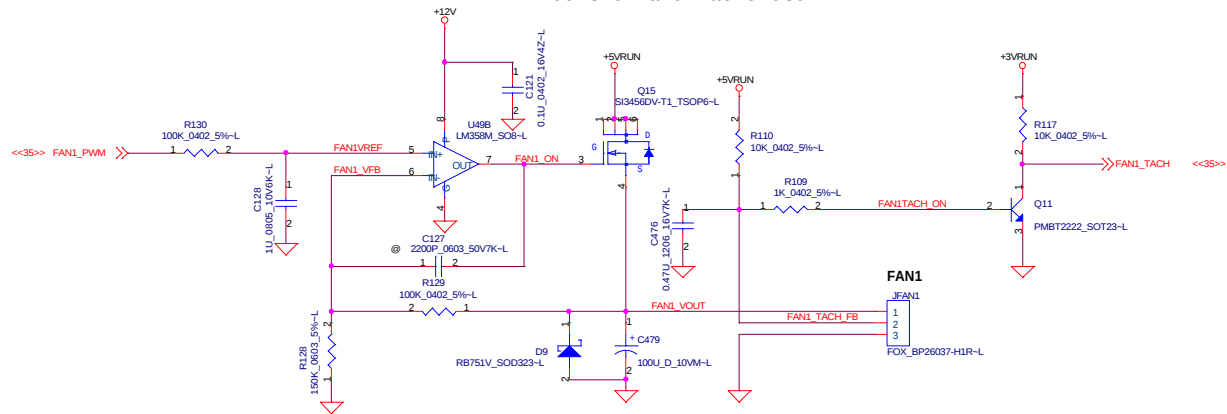

CPU Temperature Sensor

U5: ADM1032AR_SOP-8

Pin 1: VDD1

Pin 2: D+

Pin 3: D-

Pin 4: SCLK

Pin 5: SDATA

Pin 6: THERM

Pin 7: ALERT

Pin 8: GND

Resistors:

- R43: 2.2k 0.003 5%
- R42: 2.2k 0.003 5%
- R23: 10k 0.002 5%-L
- R41: 10k 0.002 5%-L

Capacitors:

- C44: 220pF 0.003 30V7K
- C25: 0.1uF 0.002 5%-L

Power Supplies:

- +3V3ALW
- +3V3UN


Signals:

- H_THERMDA
- H_THERMDC
- CLK_SMB
- DAT_SMB
- ATX_INT#

06/18/2003 Item 128

06/18/2003 Item 128

Date: Wednesday, January 07, 2004 Sheet 13 of 59

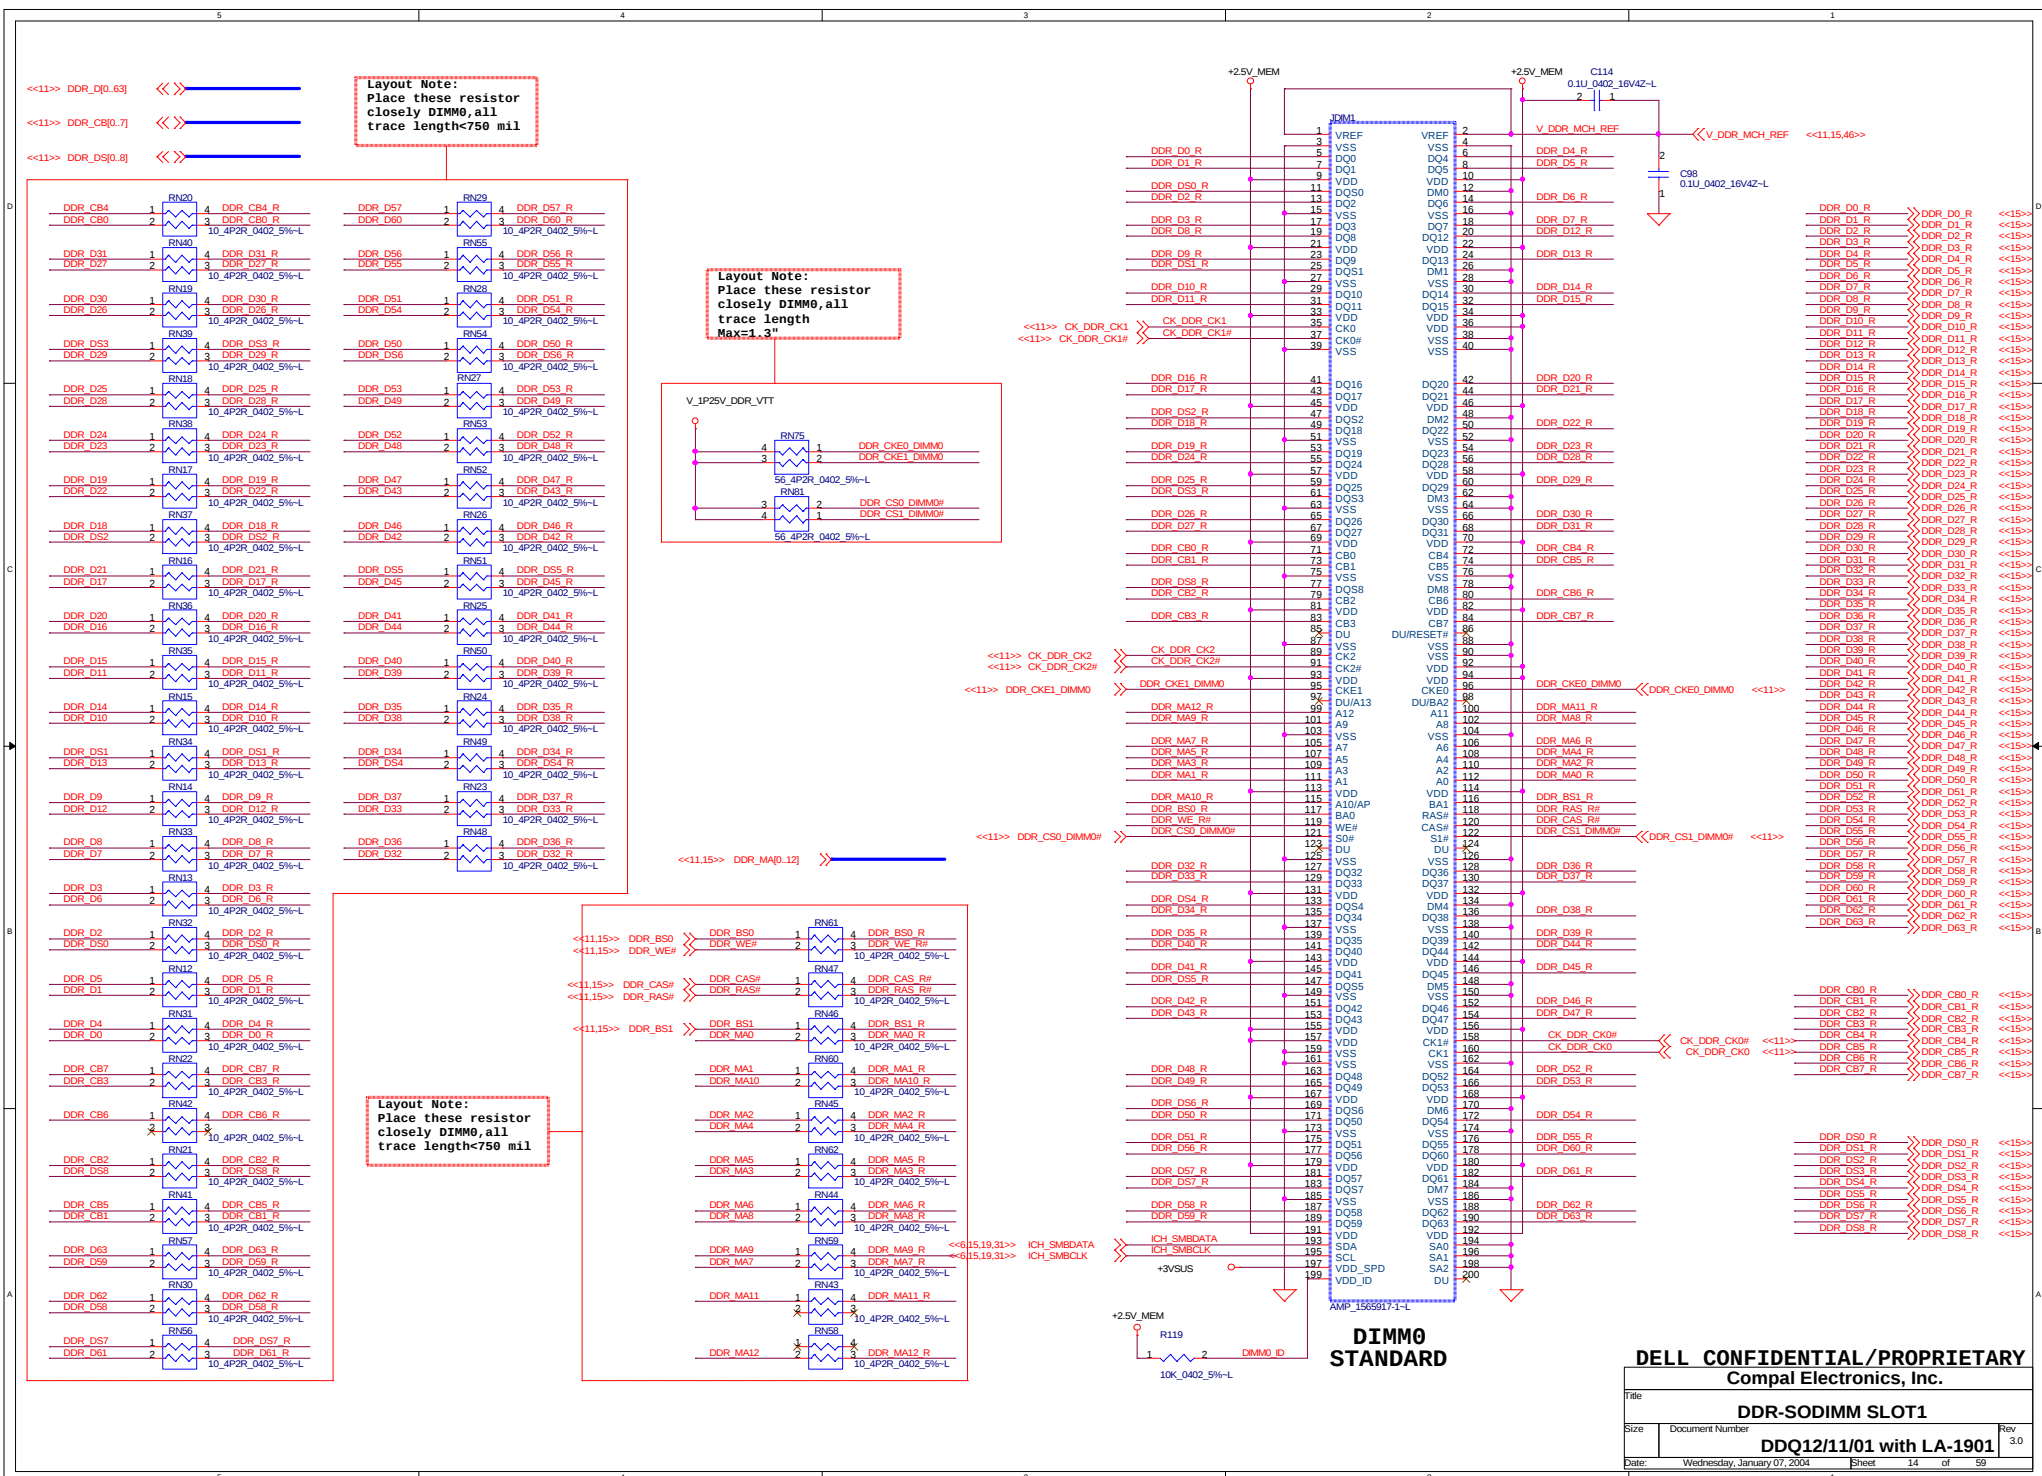

Layout Note:
Place these resistors
closely DIMM1,all
trace length<=800 mil

Layout Note:
Place CAP
near SODIMM


<<11.14>> DDR_MA[0:12]

<<14>> DDR_D0 R
<<14>> DDR_D1 R
<<14>> DDR_D2 R
<<14>> DDR_D3 R
<<14>> DDR_D4 R
<<14>> DDR_D5 R
<<14>> DDR_D6 R
<<14>> DDR_D7 R
<<14>> DDR_D8 R
<<14>> DDR_D9 R
<<14>> DDR_D10 R
<<14>> DDR_D11 R
<<14>> DDR_D12 R
<<14>> DDR_D13 R
<<14>> DDR_D14 R
<<14>> DDR_D15 R
<<14>> DDR_D16 R
<<14>> DDR_D17 R
<<14>> DDR_D18 R
<<14>> DDR_D19 R
<<14>> DDR_D20 R
<<14>> DDR_D21 R
<<14>> DDR_D22 R
<<14>> DDR_D23 R
<<14>> DDR_D24 R
<<14>> DDR_D25 R
<<14>> DDR_D26 R
<<14>> DDR_D27 R
<<14>> DDR_D28 R
<<14>> DDR_D29 R
<<14>> DDR_D30 R
<<14>> DDR_D31 R
<<14>> DDR_D32 R
<<14>> DDR_D33 R
<<14>> DDR_D34 R
<<14>> DDR_D35 R
<<14>> DDR_D36 R
<<14>> DDR_D37 R
<<14>> DDR_D38 R
<<14>> DDR_D39 R
<<14>> DDR_D40 R
<<14>> DDR_D41 R
<<14>> DDR_D42 R
<<14>> DDR_D43 R
<<14>> DDR_D44 R
<<14>> DDR_D45 R
<<14>> DDR_D46 R
<<14>> DDR_D47 R
<<14>> DDR_D48 R
<<14>> DDR_D49 R
<<14>> DDR_D50 R
<<14>> DDR_D51 R
<<14>> DDR_D52 R
<<14>> DDR_D53 R
<<14>> DDR_D54 R
<<14>> DDR_D55 R
<<14>> DDR_D56 R
<<14>> DDR_D57 R
<<14>> DDR_D58 R
<<14>> DDR_D59 R
<<14>> DDR_D60 R
<<14>> DDR_D61 R
<<14>> DDR_D62 R
<<14>> DDR_D63 R

<<14>> DDR_C80 R
<<14>> DDR_C81 R
<<14>> DDR_C82 R
<<14>> DDR_C83 R
<<14>> DDR_C84 R
<<14>> DDR_C85 R
<<14>> DDR_C86 R
<<14>> DDR_C87 R

<<14>> DDR_D50 R
<<14>> DDR_D51 R
<<14>> DDR_D52 R
<<14>> DDR_D53 R
<<14>> DDR_D54 R
<<14>> DDR_D55 R
<<14>> DDR_D56 R
<<14>> DDR_D57 R
<<14>> DDR_D58 R

<<11.14>> DDR_BS0
<<11.14>> DDR_BS1
<<11.14>> DDR_WE#
<<11.14>> DDR_CAS#
<<11.14>> DDR_RAS#

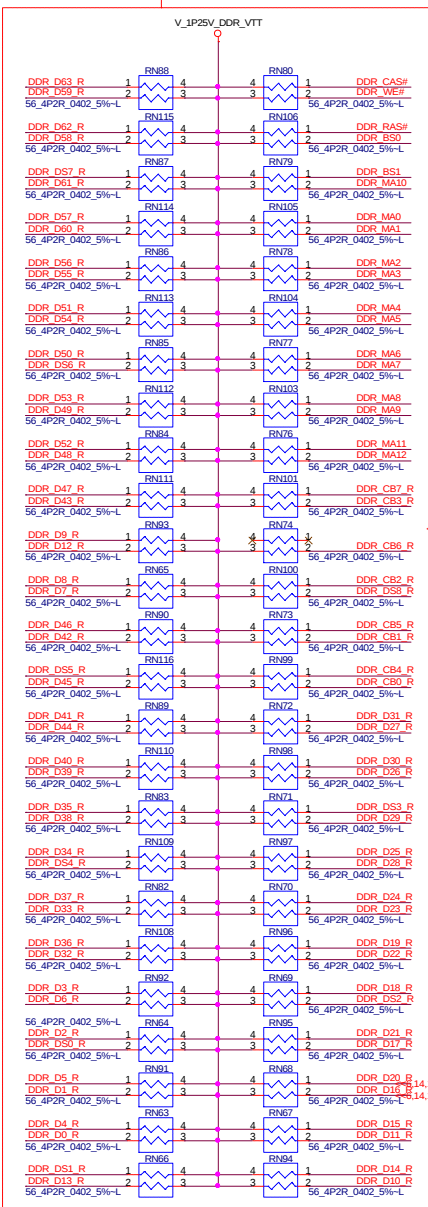

<<11>> CK_DDR_CK4
<<11>> CK_DDR_CK4#

<<11>> CK_DDR_CK5
<<11>> CK_DDR_CK5#

<<11>> DDR_CKE3_DIMM1

<<11>> DDR_CS2_DIMM1#

<<11>> CK_DDR_CK3#
<<11>> CK_DDR_CK3


ICH_SMBDATA
ICH_SMBCLK



DIMM1
REVERSE





One .1uF cap per power pin.
Place each cap close to
pin.

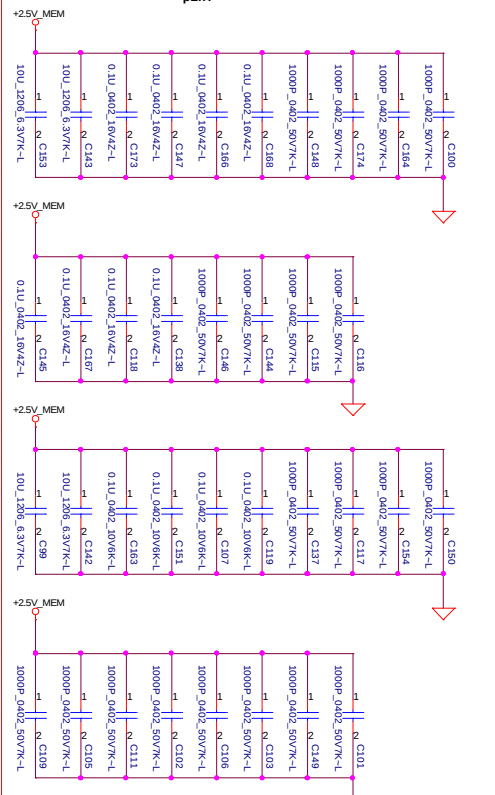

Layout Note:
Place these resistor
closely DIMM1,all
trace length
Max=1.3"


Place by pin197 of each SODIMM

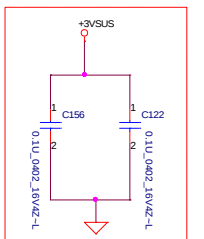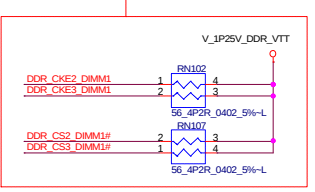



DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.

DDR-SODIMM SLOT2

Title	DDQ12/11/01 with LA-1901	Rev	3.0
Size	Document Number	Sheet	15 of 59
Date:	Wednesday, January 07, 2004	Sheet	15 of 59

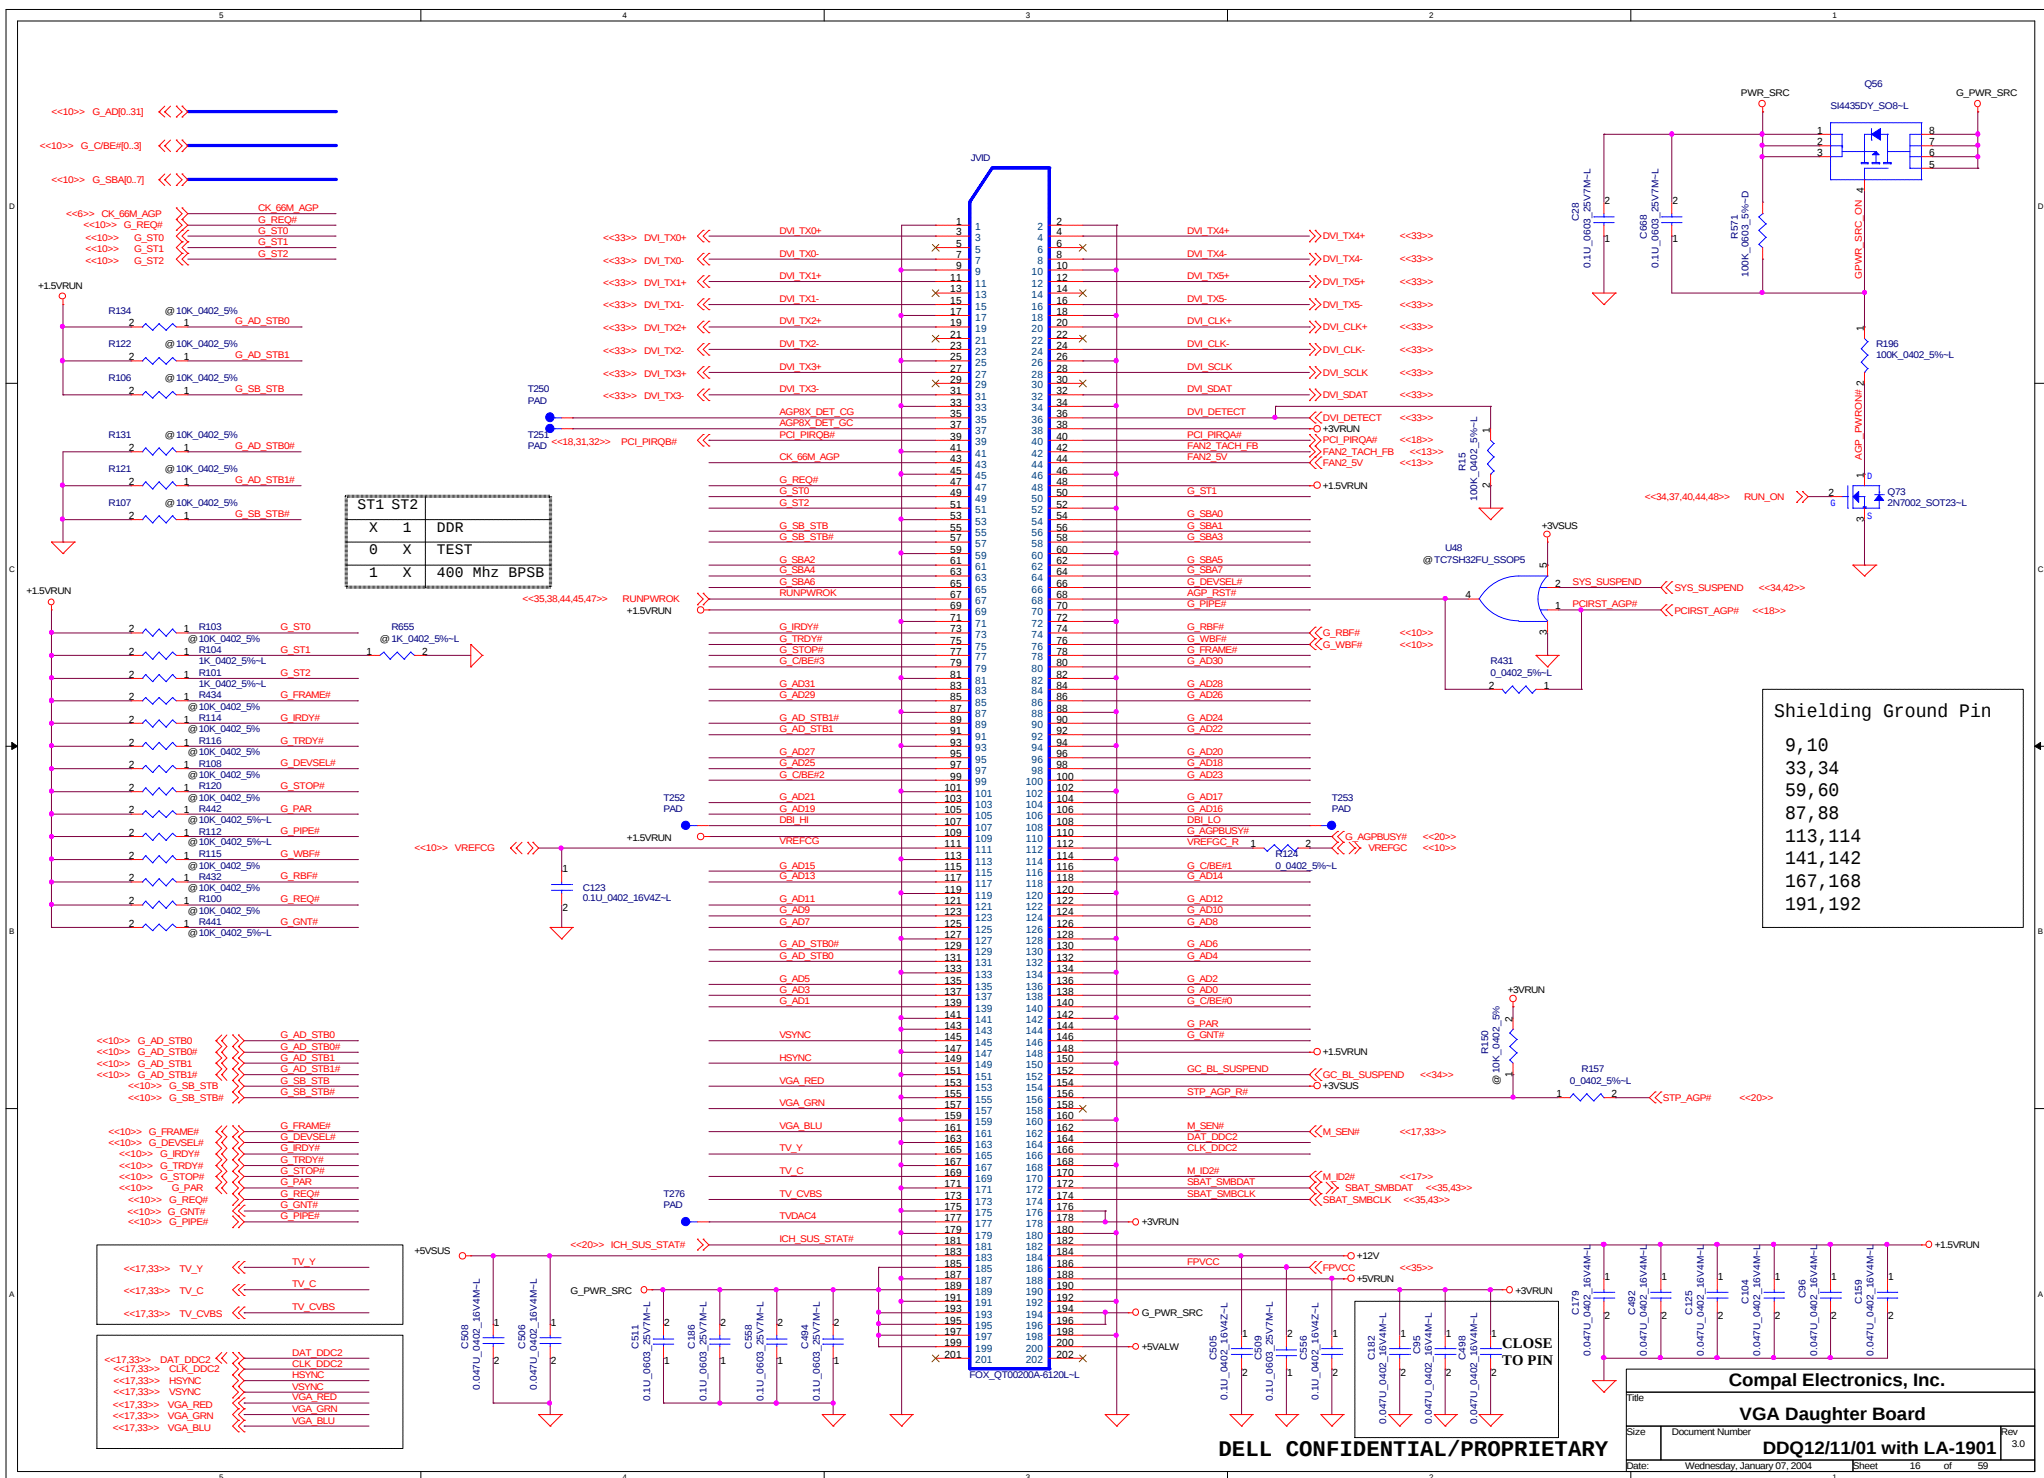

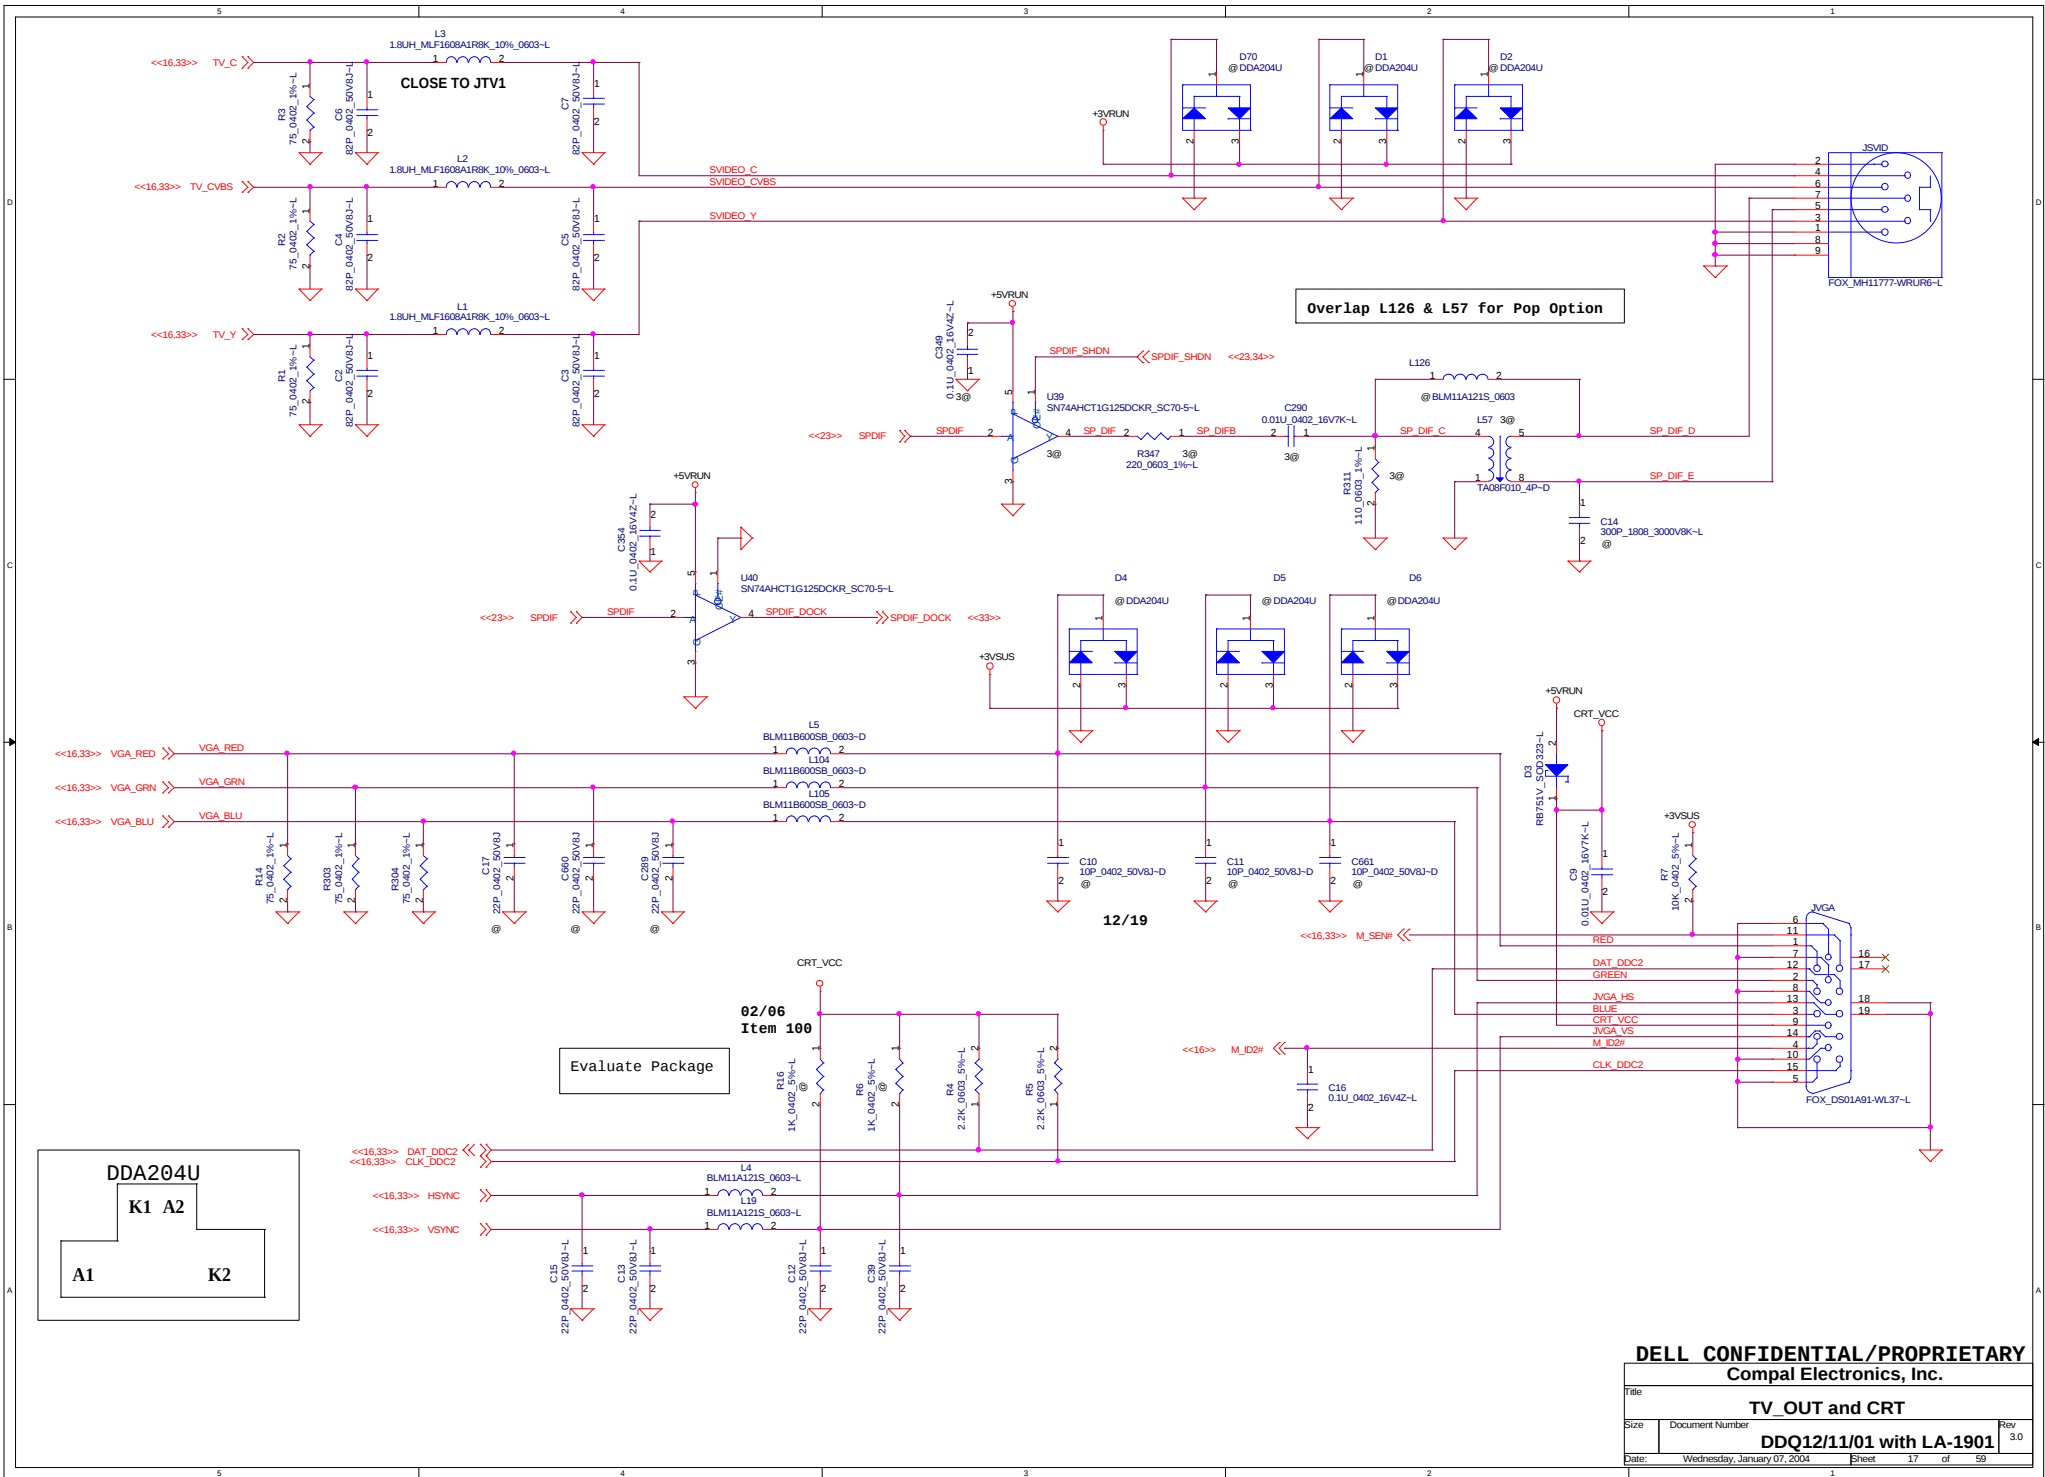

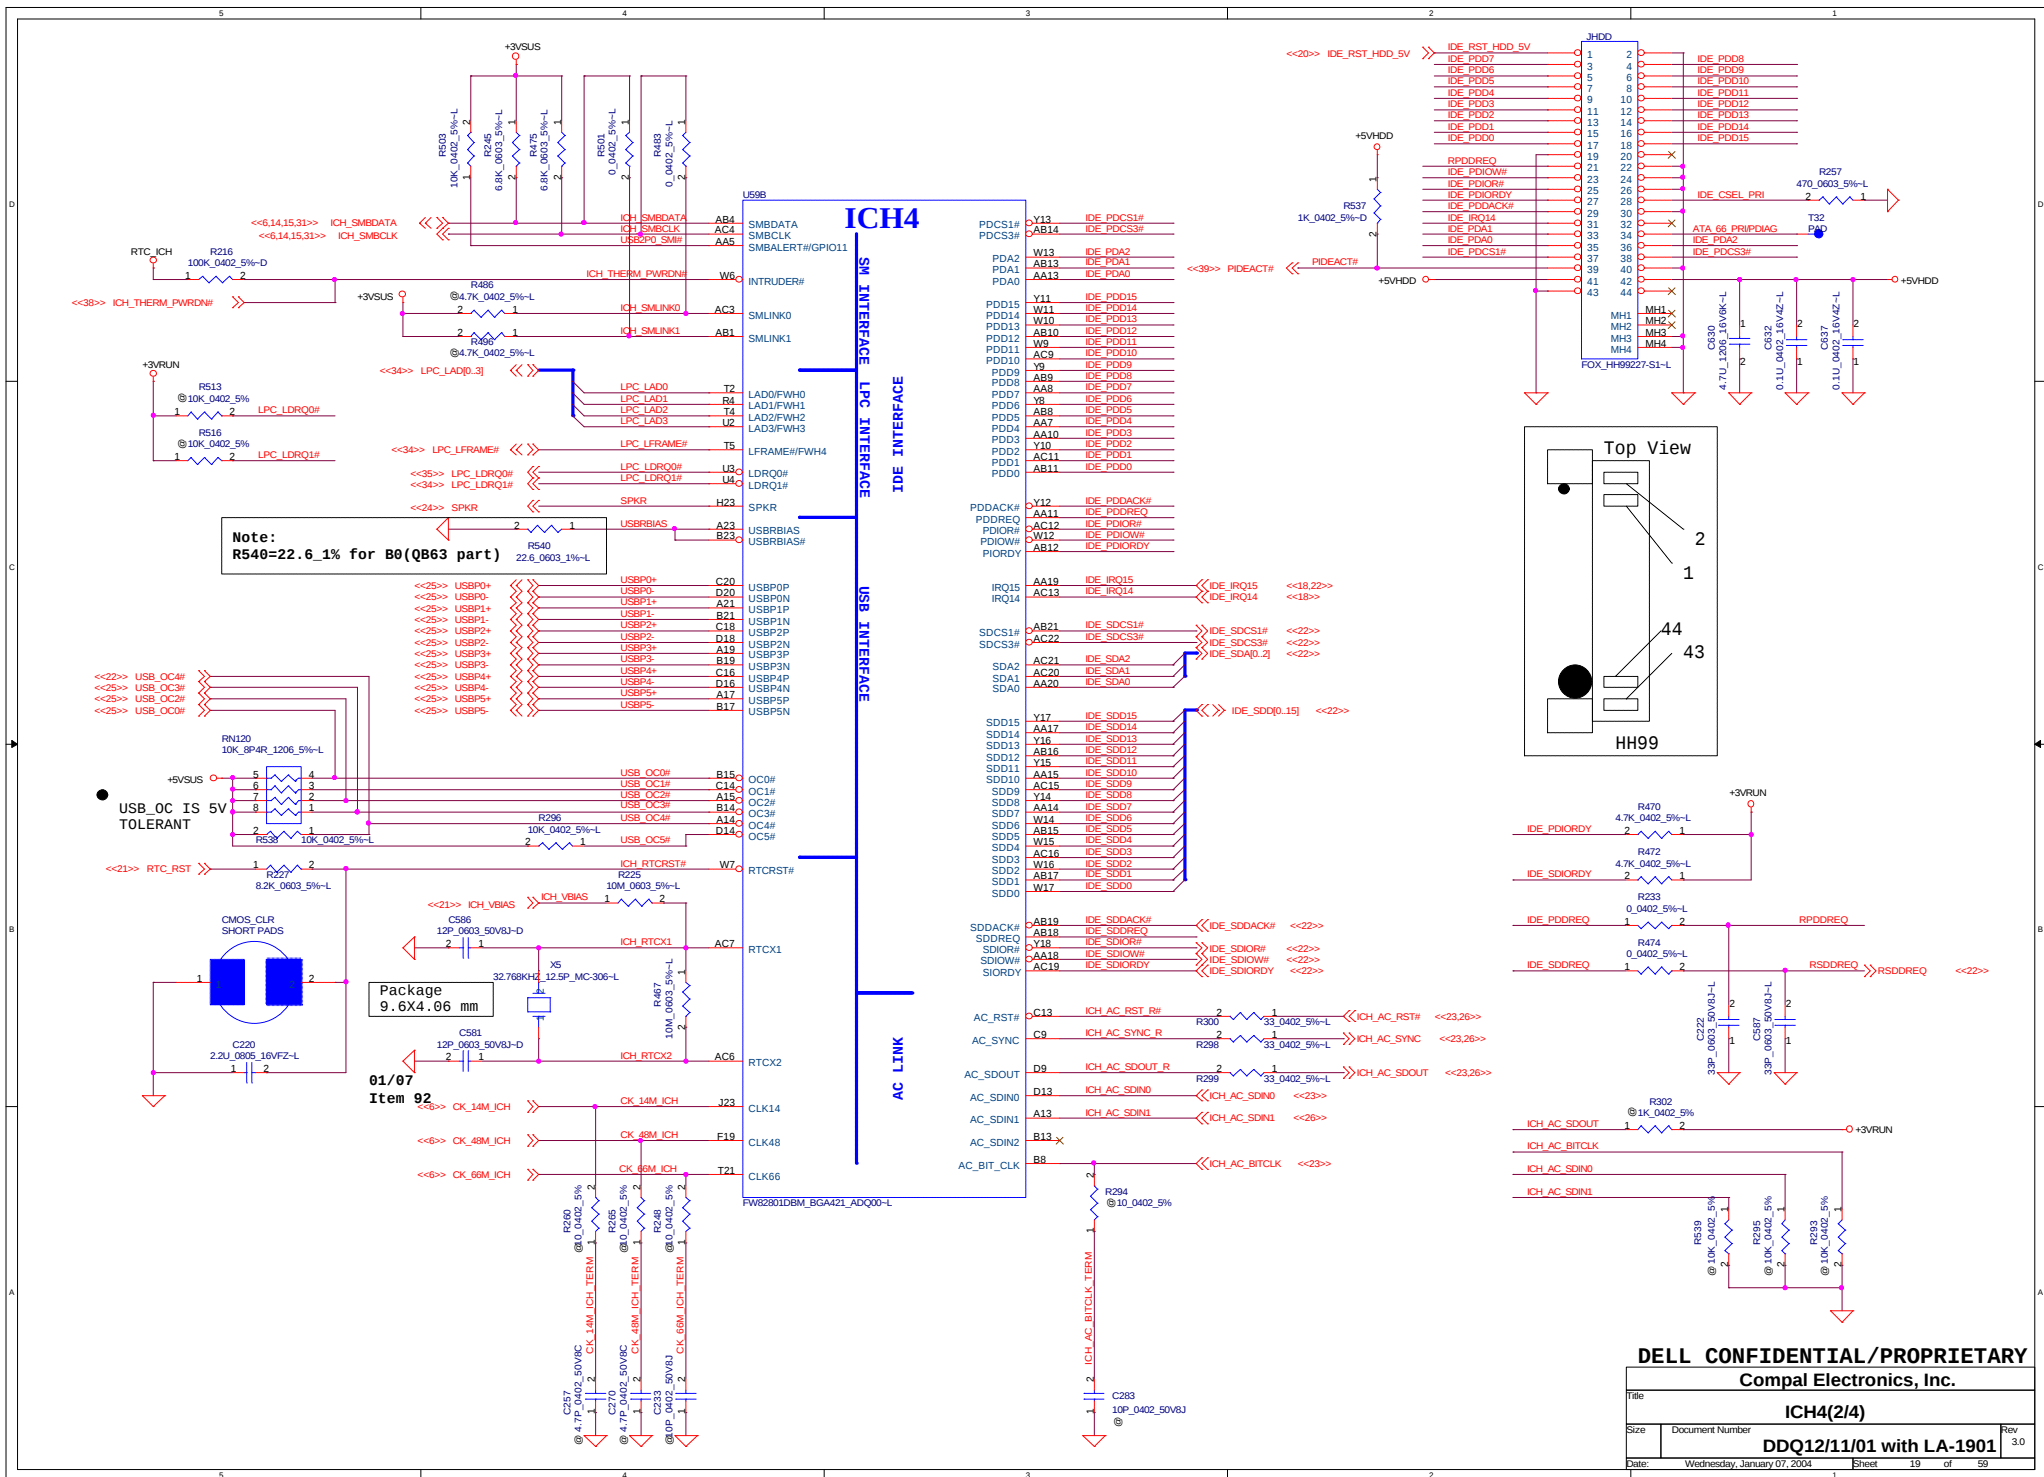

05/29, Item 123

ICH4


LAN INTERFACE


GPIO


BID3	BID2	BID1	BID0	REV
0	0	0	0	X00
0	0	0	1	X01
0	0	1	0	A00
0	0	1	1	A01
0	1	0	0	A02


DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.


Title	ICH4(3/4)		
Size	Document Number	DDQ12/11/01 with LA-1901	
Date:	Wednesday, January 07, 2004	Sheet	20 of 59

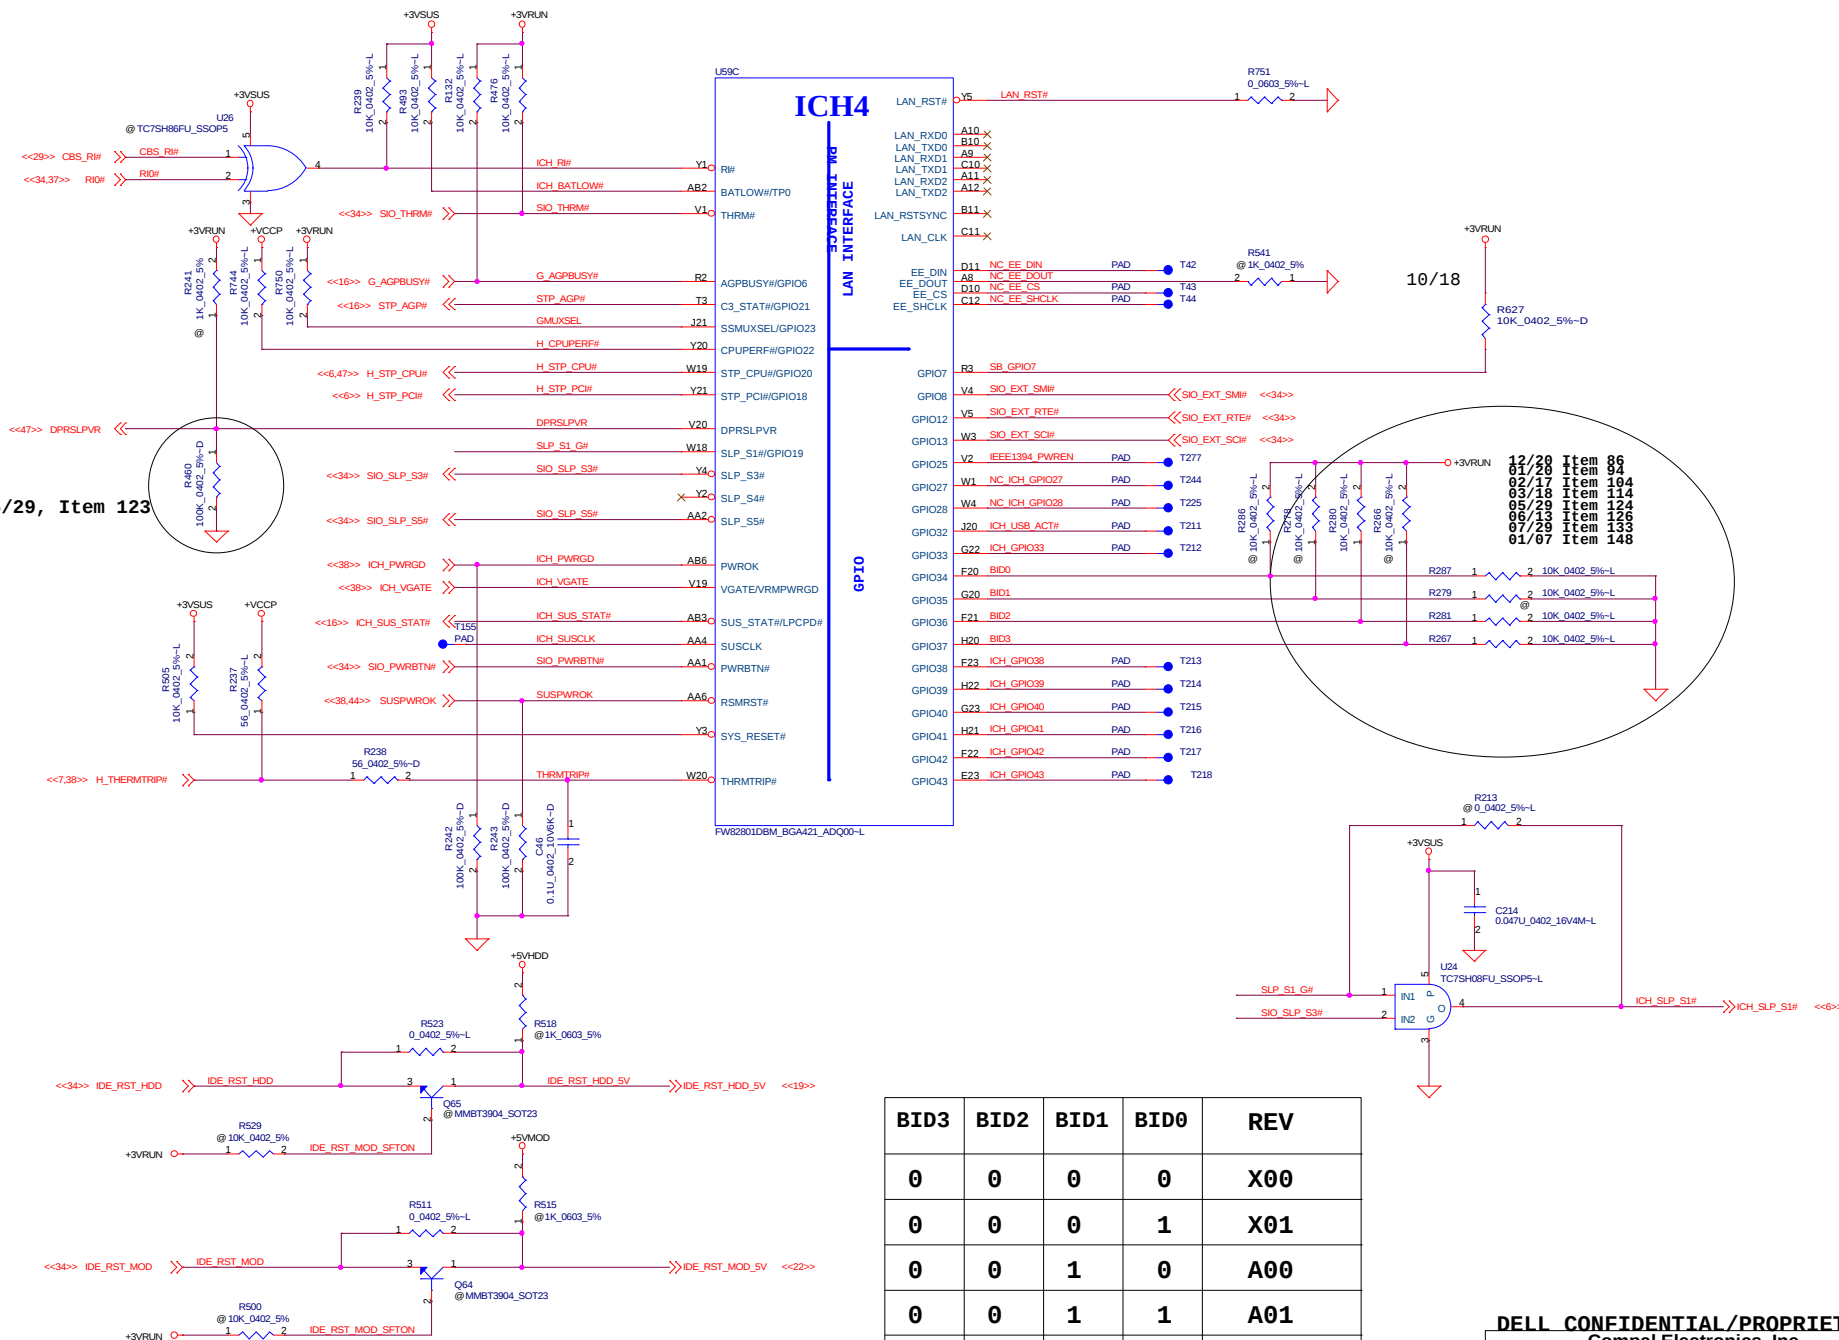

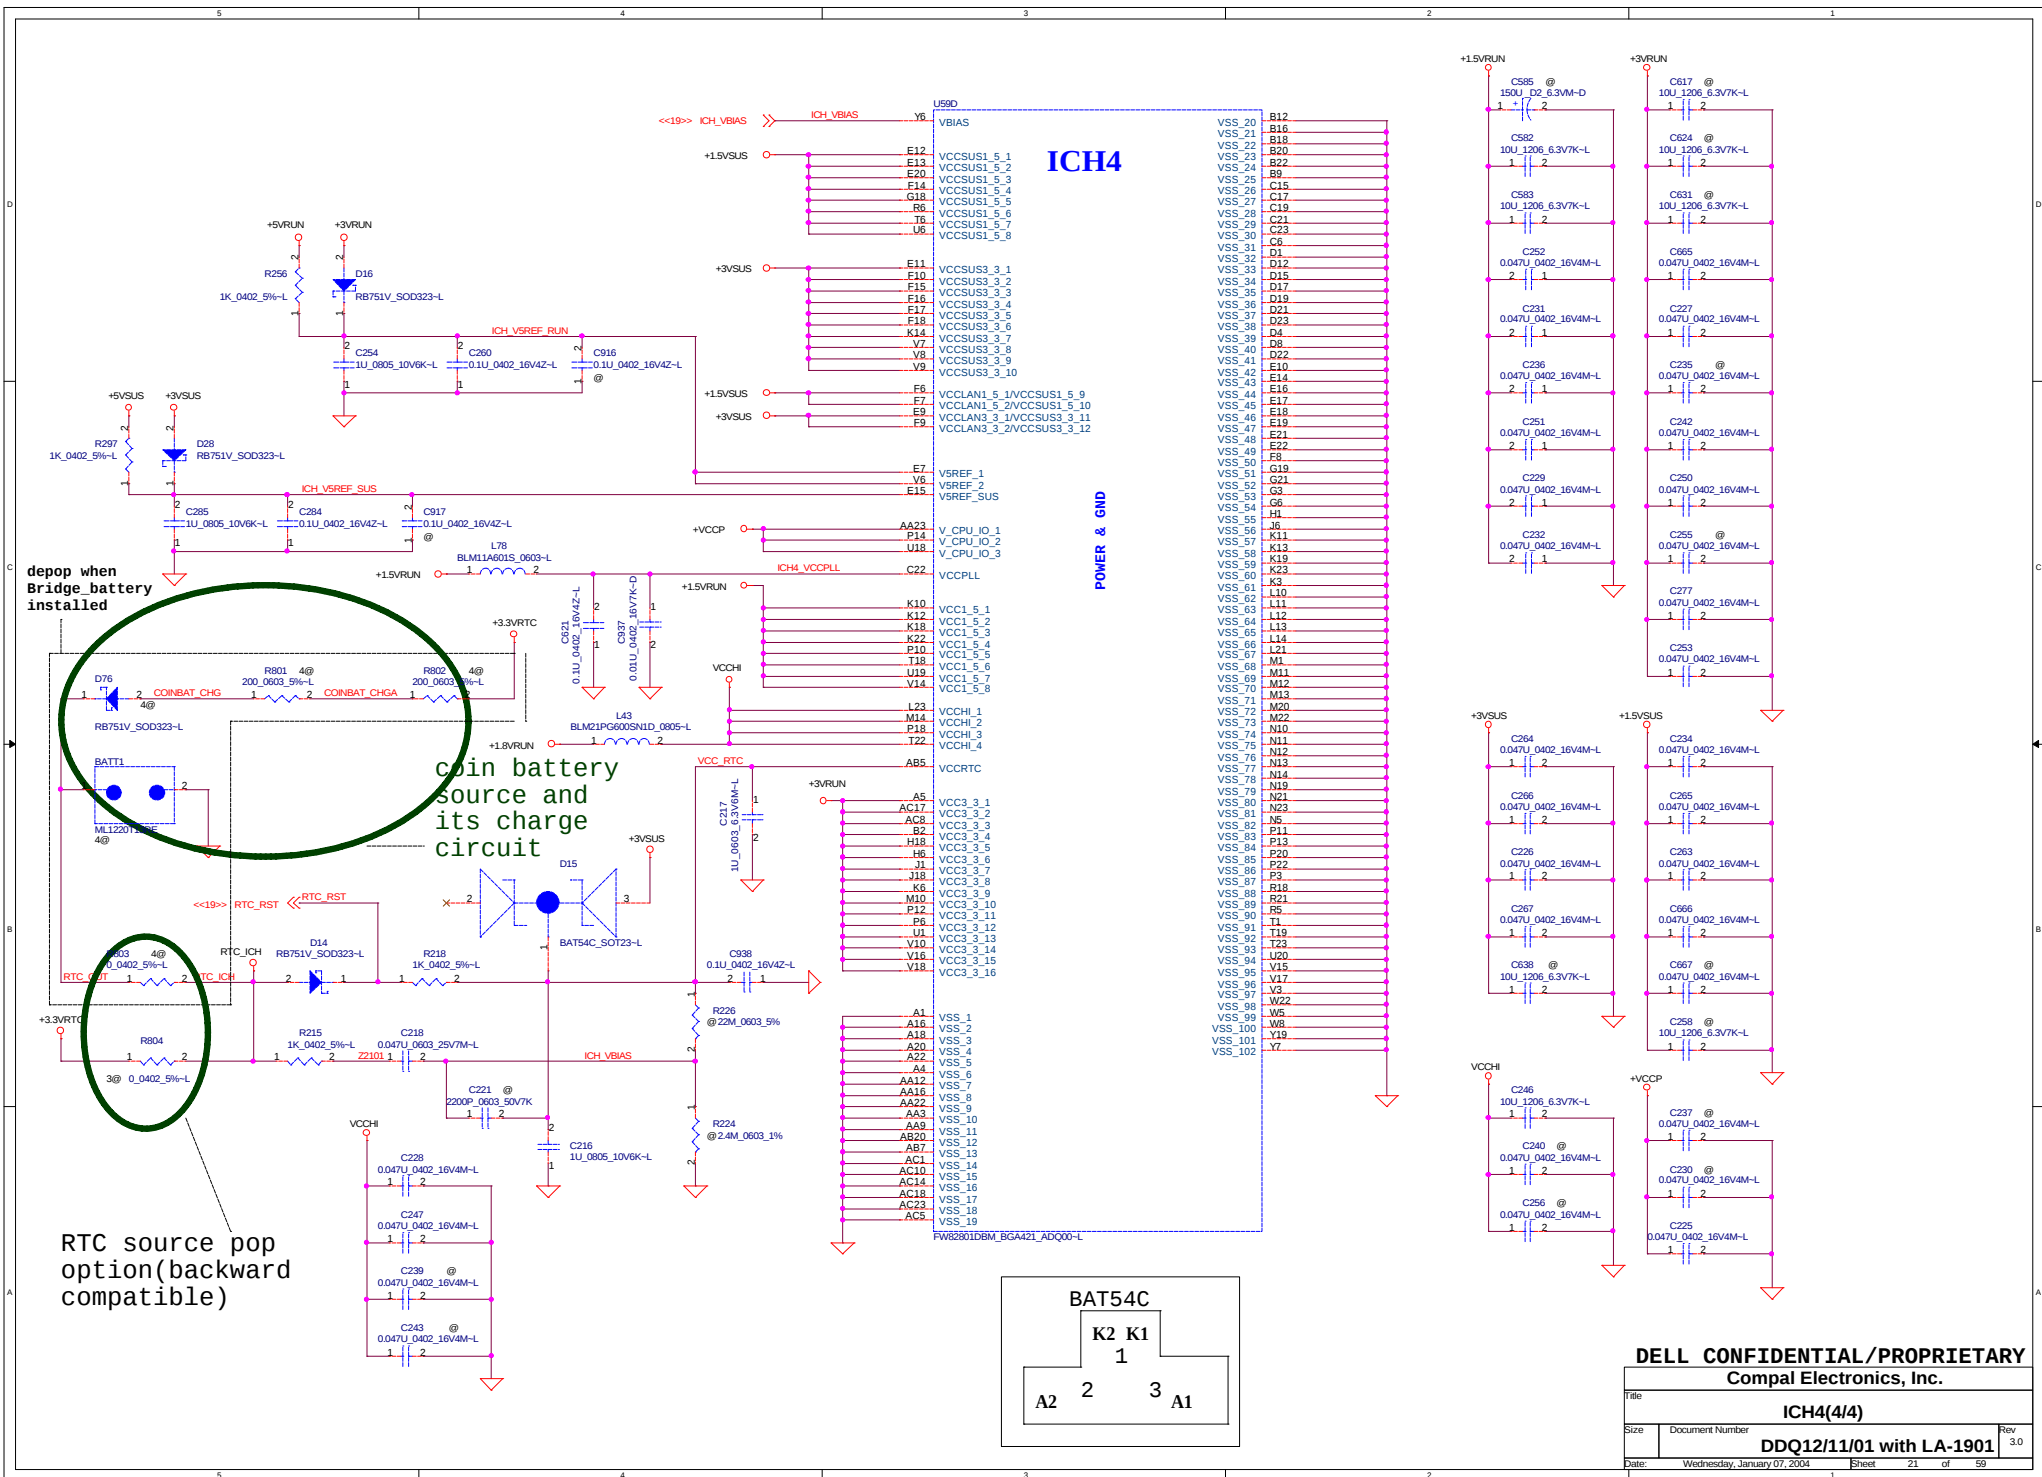

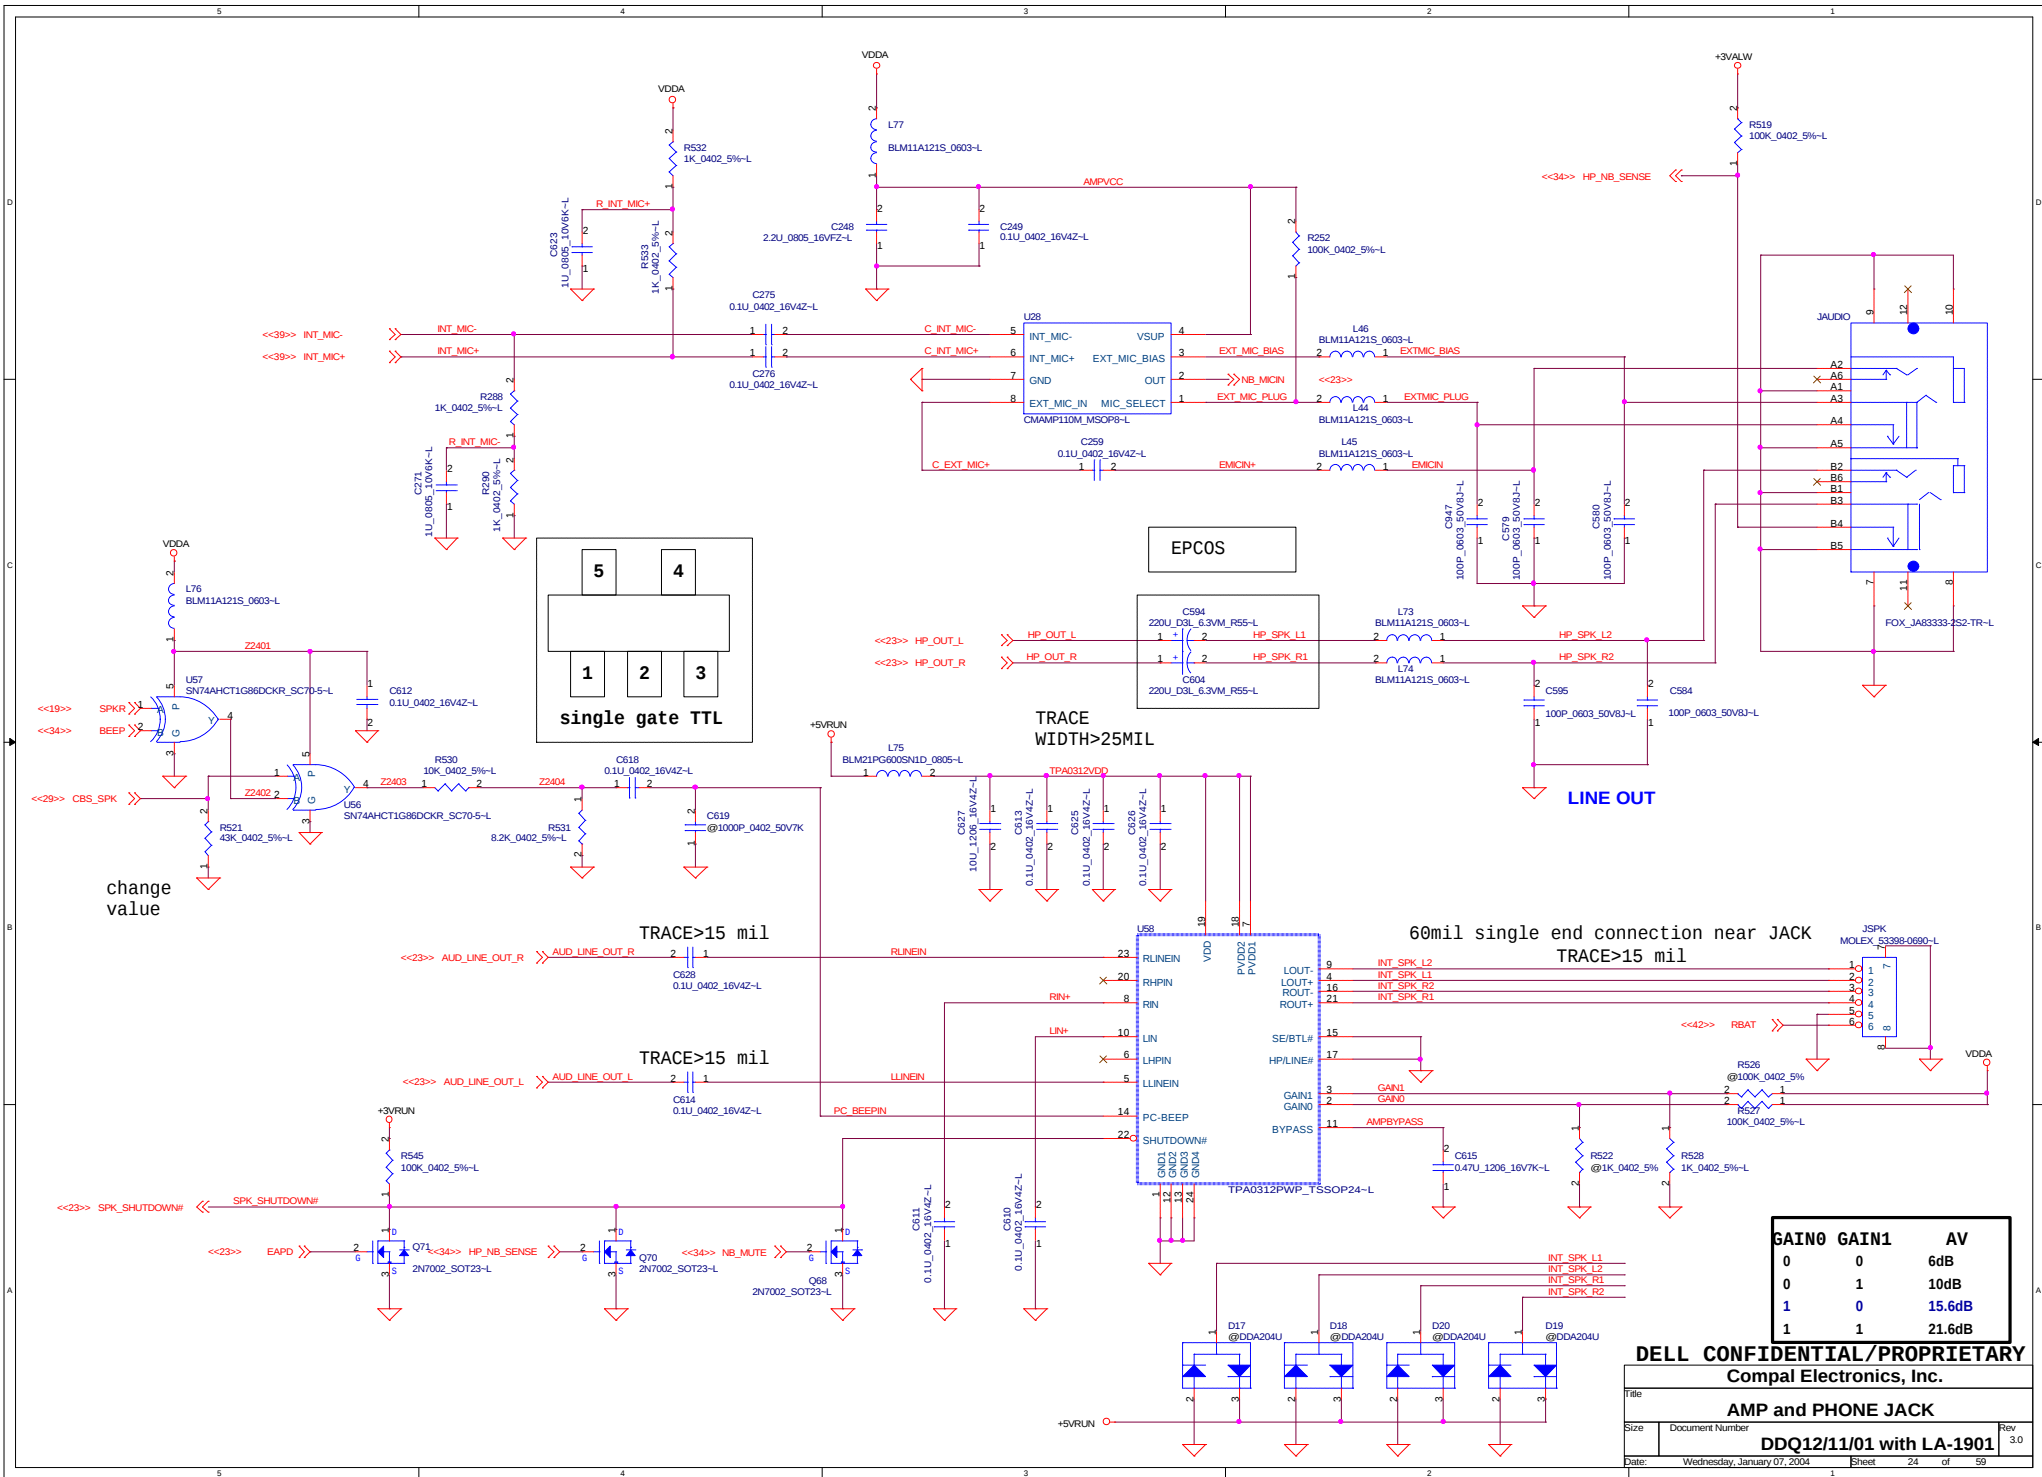


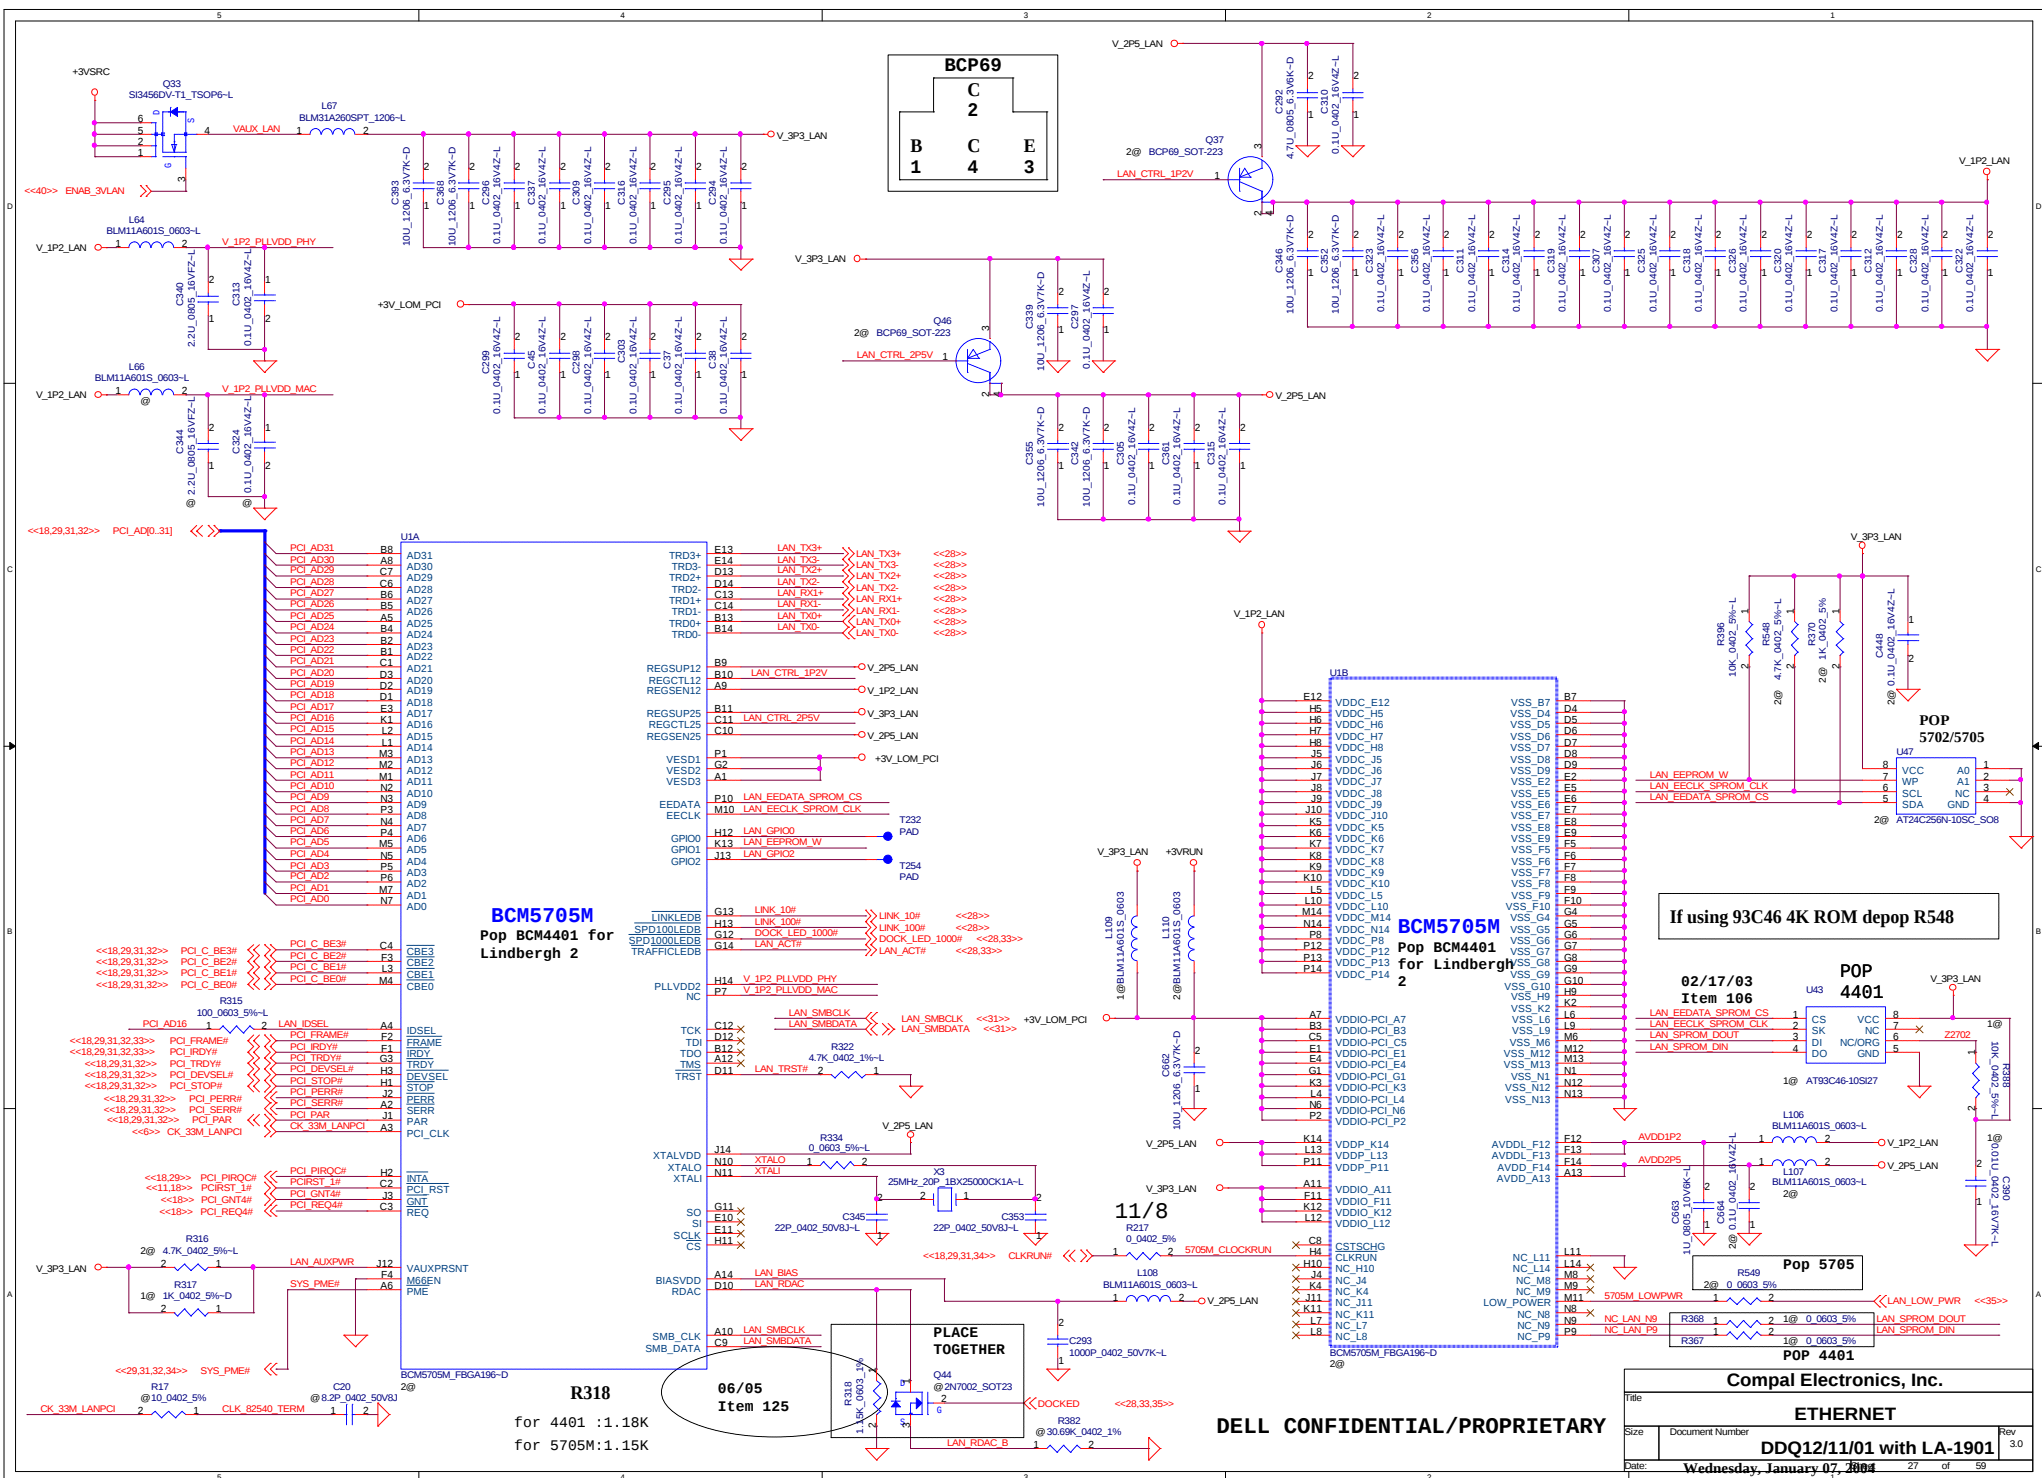

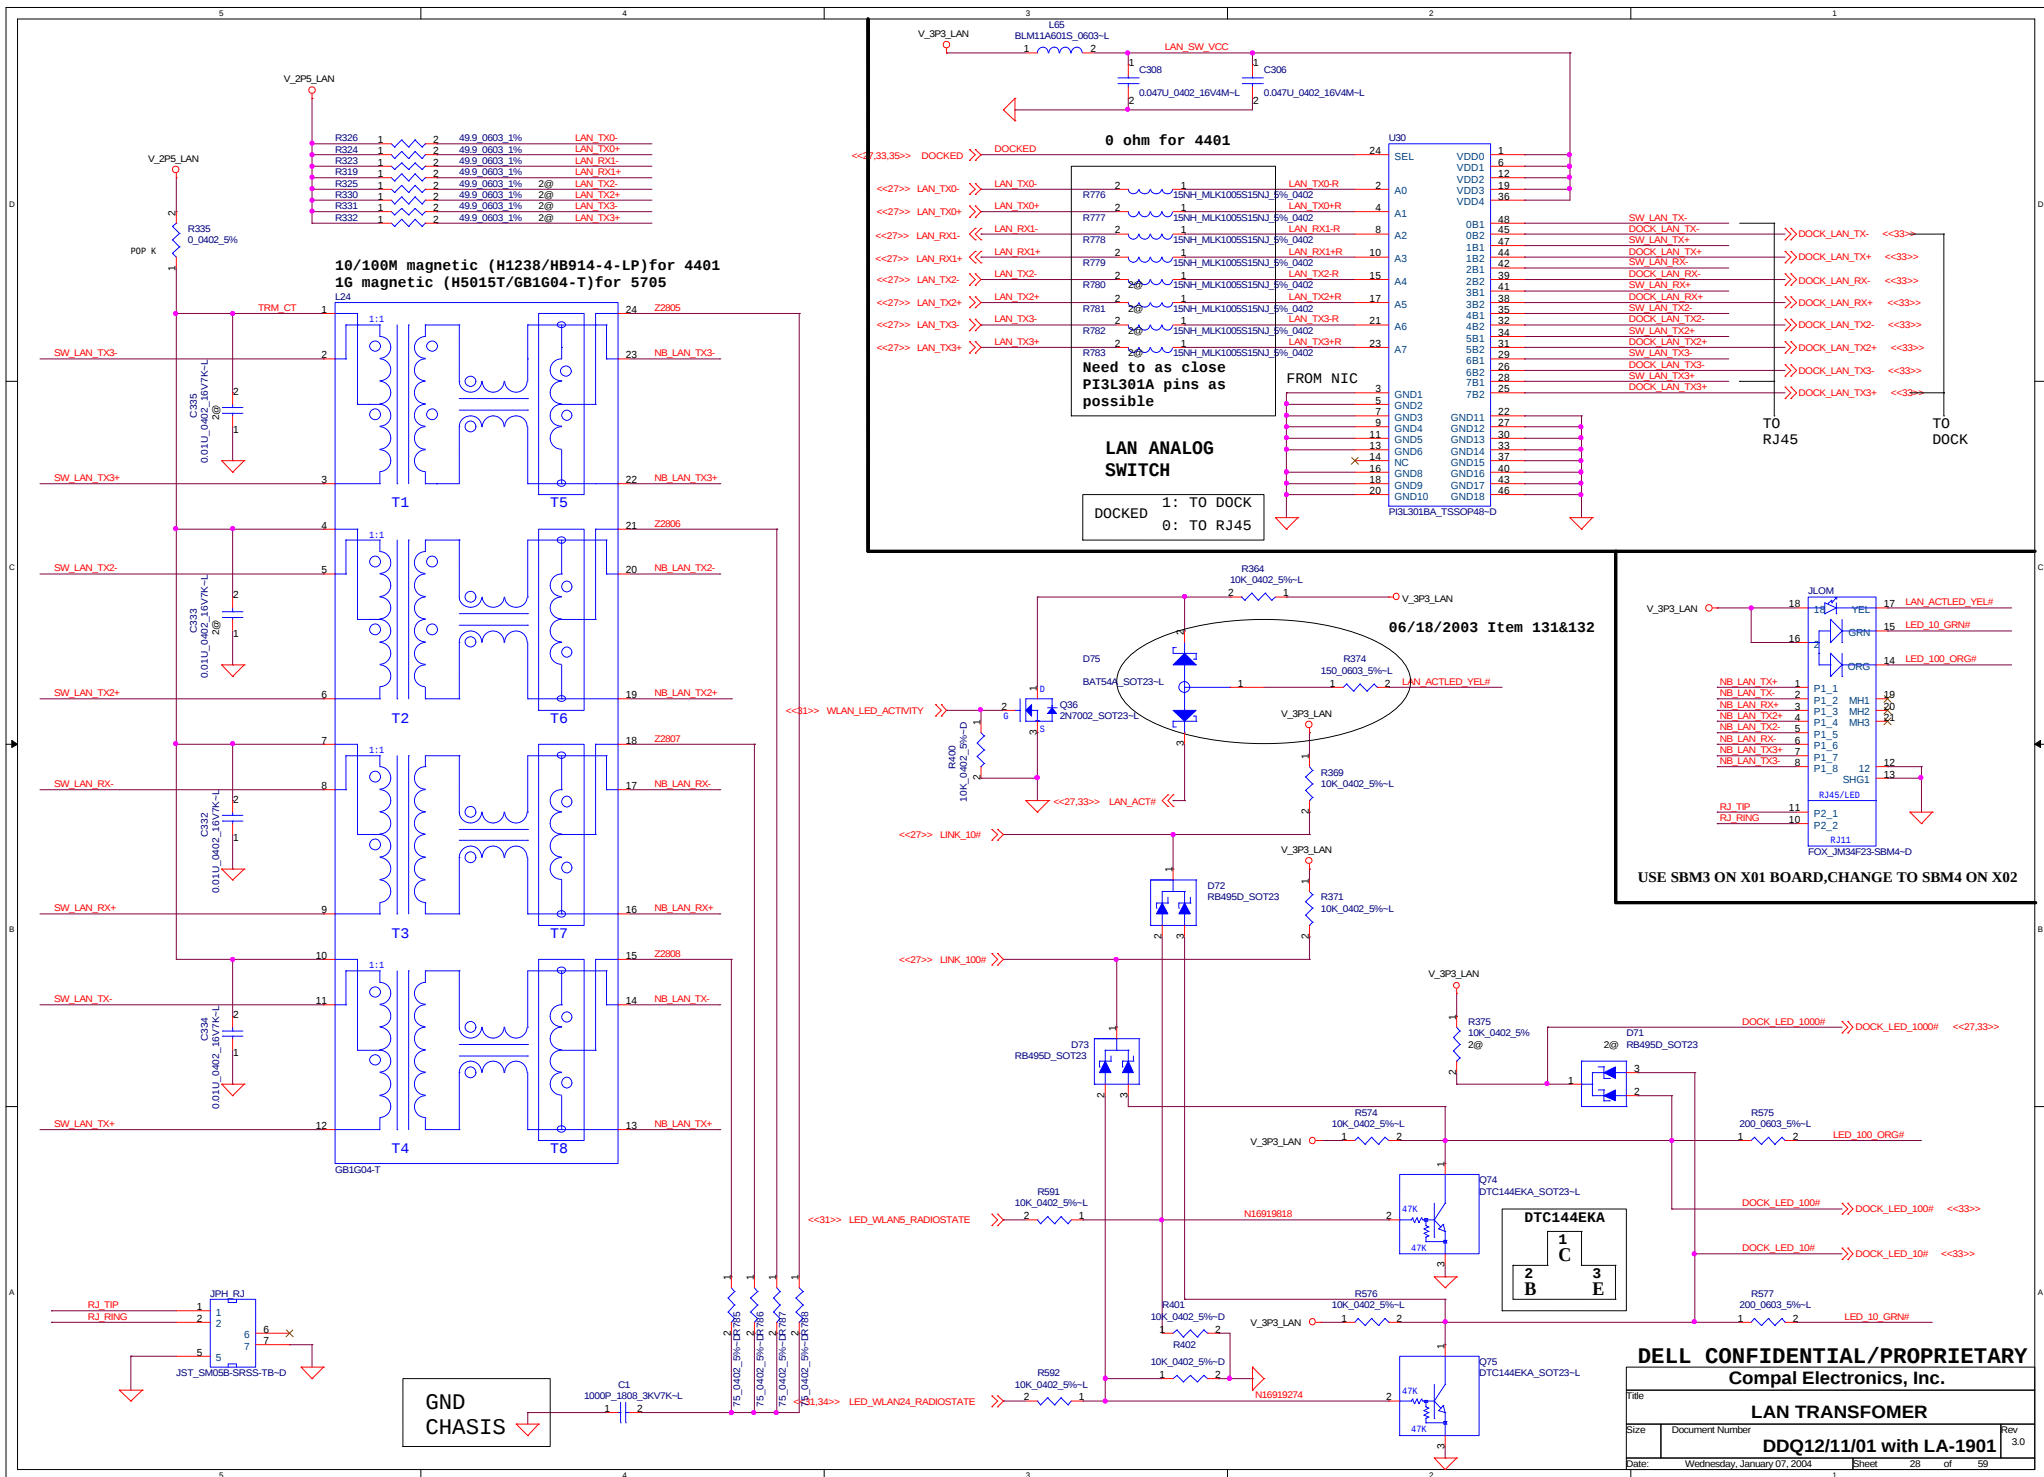

<<18.27.31.32>> PCI_AD[0..31]


<<18.27.31.32>> PCI_AD[0..31]

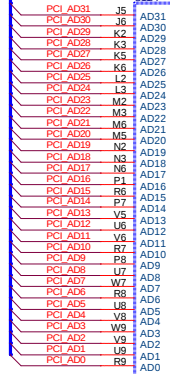

PCI7510
Pop PCI4510 for
Lindbergh 2

<<18.27.31.32>> PCI_C_BE3#
<<18.27.31.32>> PCI_C_BE2#
<<18.27.31.32>> PCI_C_BE1#
<<18.27.31.32>> PCI_C_BE0#

<<18.27.31.32>> PCI_C_BE3#
<<18.27.31.32>> PCI_C_BE2#
<<18.27.31.32>> PCI_C_BE1#
<<18.27.31.32>> PCI_C_BE0#




<<18.27.31.32>> PCI_PAR

<<18.27.31.32>> PCI_PAR




<<18.27.31.32>> PCI_FRAME#
<<18.27.31.32>> PCI_GNT1#

<<18.27.31.32>> PCI_FRAME#
<<18.27.31.32>> PCI_GNT1#



<<18.27.31.32>> PCI_RDY#
<<18.27.31.32>> PCI_PERR#
<<18.27.31.32>> PCI_REQ#
<<18.27.31.32>> PCI_SERR#
<<18.27.31.32>> PCI_STOP#
<<18.27.31.32>> PCI_TRDY#
<<18.31>> PCIRST_2#

<<18.27.31.32>> PCI_RDY#
<<18.27.31.32>> PCI_PERR#
<<18.27.31.32>> PCI_REQ#
<<18.27.31.32>> PCI_SERR#
<<18.27.31.32>> PCI_STOP#
<<18.27.31.32>> PCI_TRDY#
<<18.31>> PCIRST_2#



<<3>> CBS_GRST#

<<3>> CBS_GRST#



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI




<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI



<<6>> CK_33M_CBPCI

<<6>> CK_33M_CBPCI




<<6>> CK_33M_CBPCI









<<6>> CK_33M_CBPCI



Remove R756
8/12 changed by
Dell's Require





PCI7510
Pop PCI4510 for
Lindbergh 2

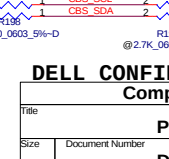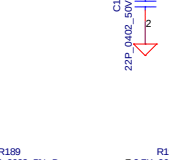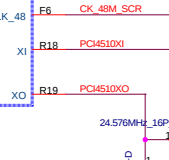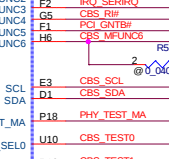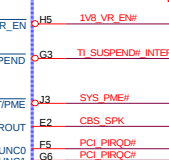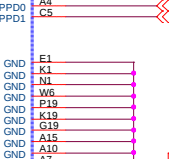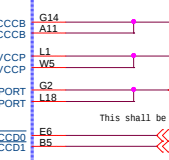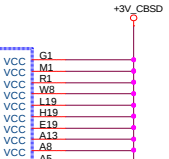



DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.


Title	PCMCIA Controller	Rev	3.0
Size	Document Number	DDQ12/11/01 with LA-1901	
Date	Wednesday, January 07, 2004	Sheet	29 of 59

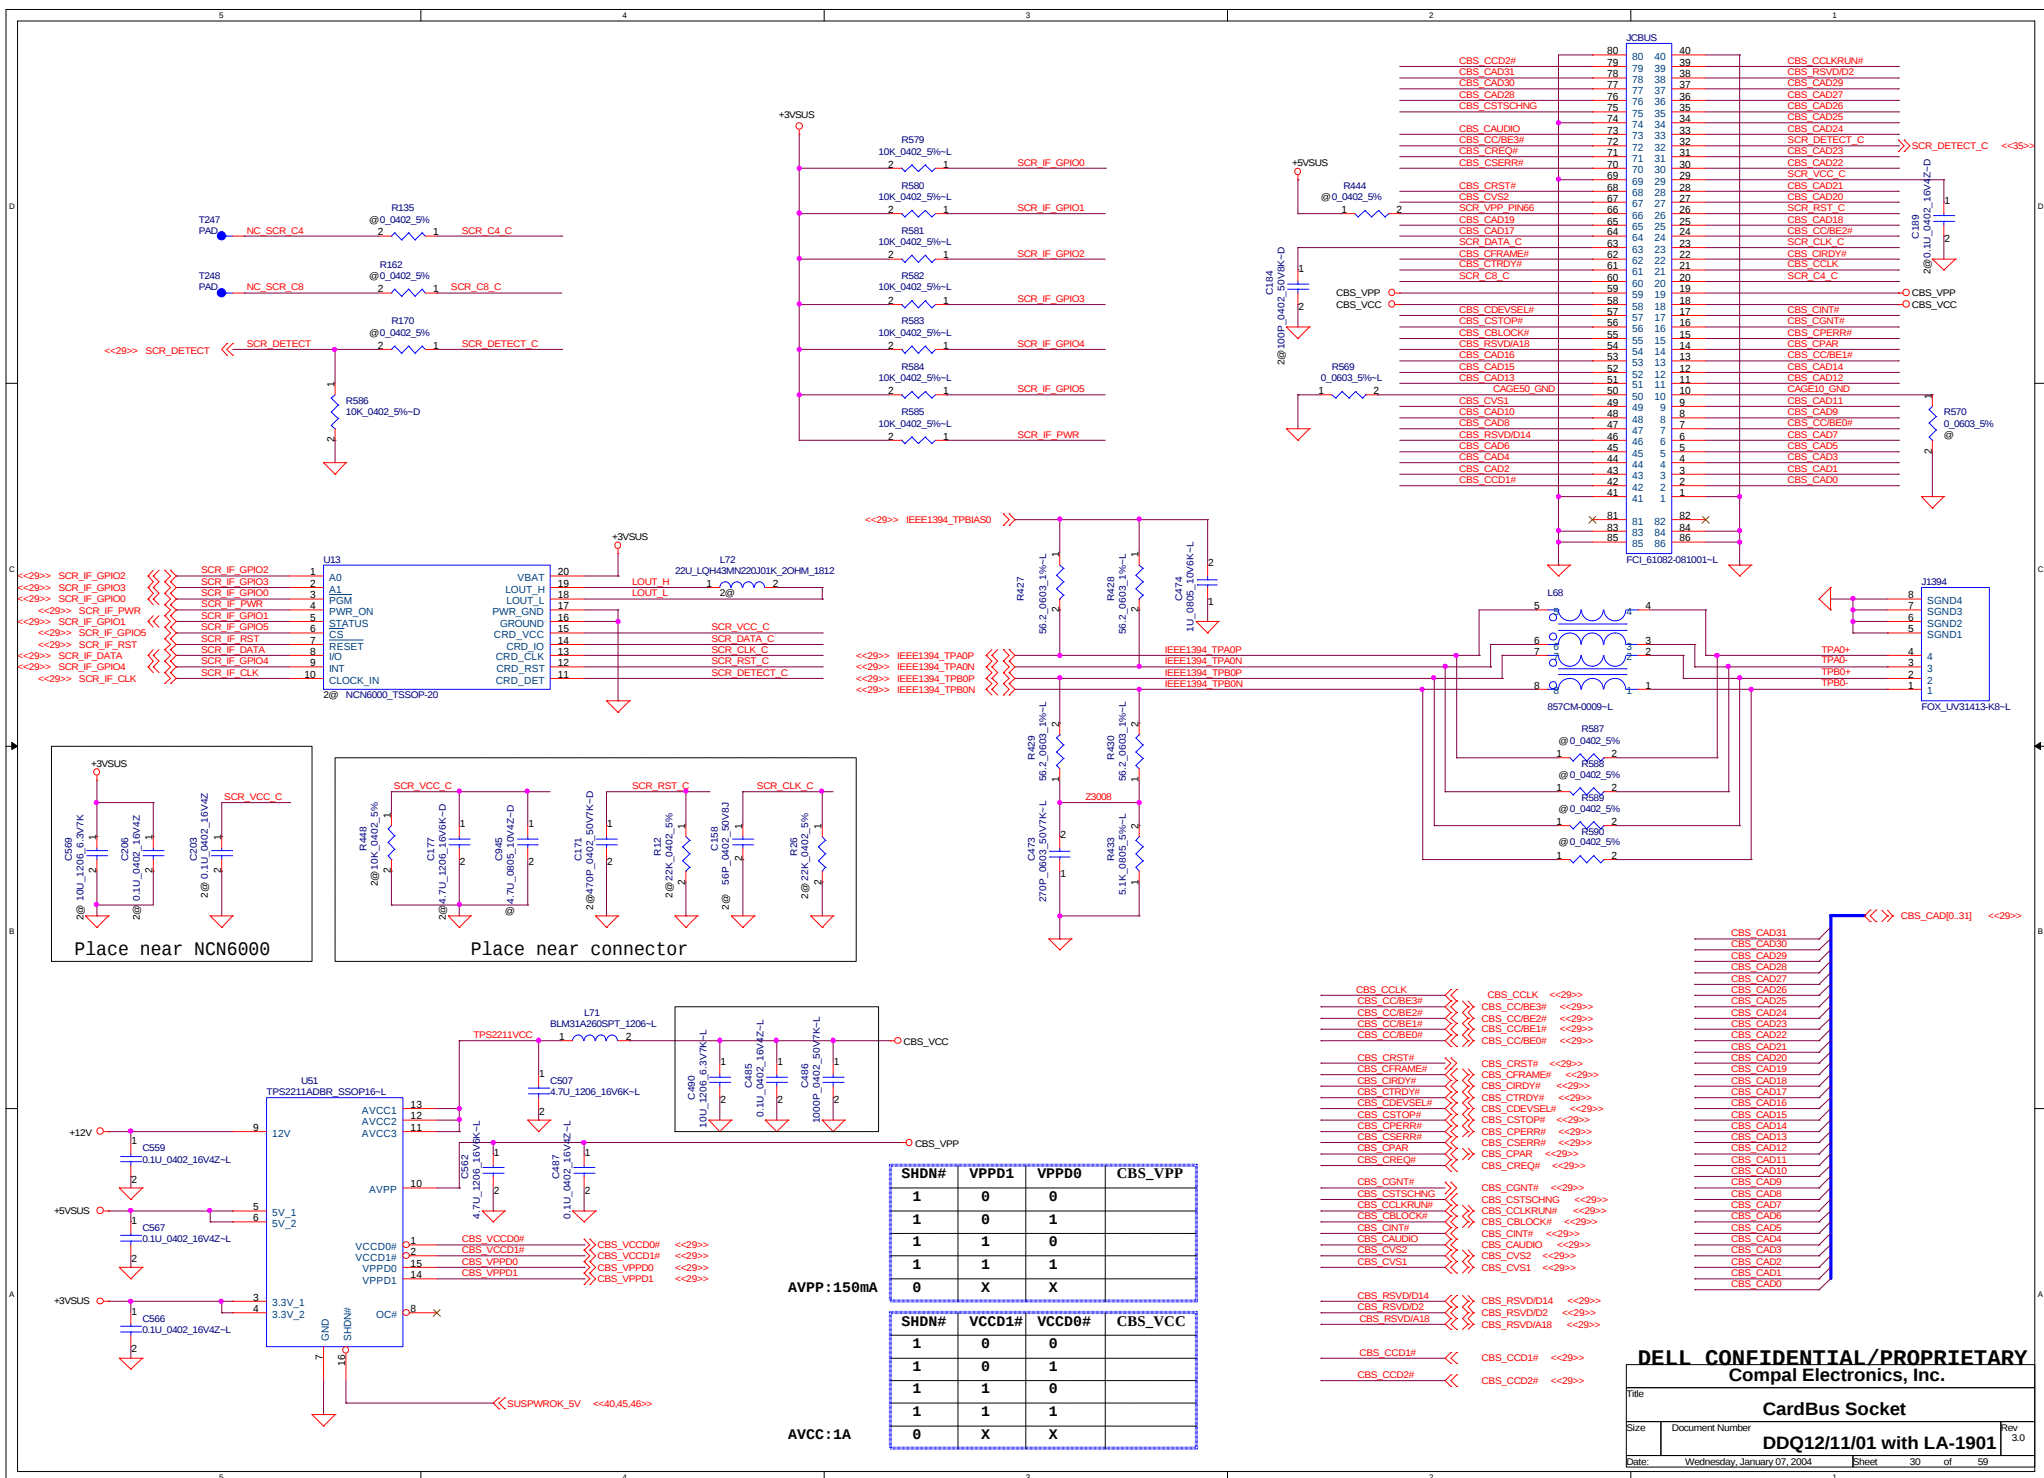

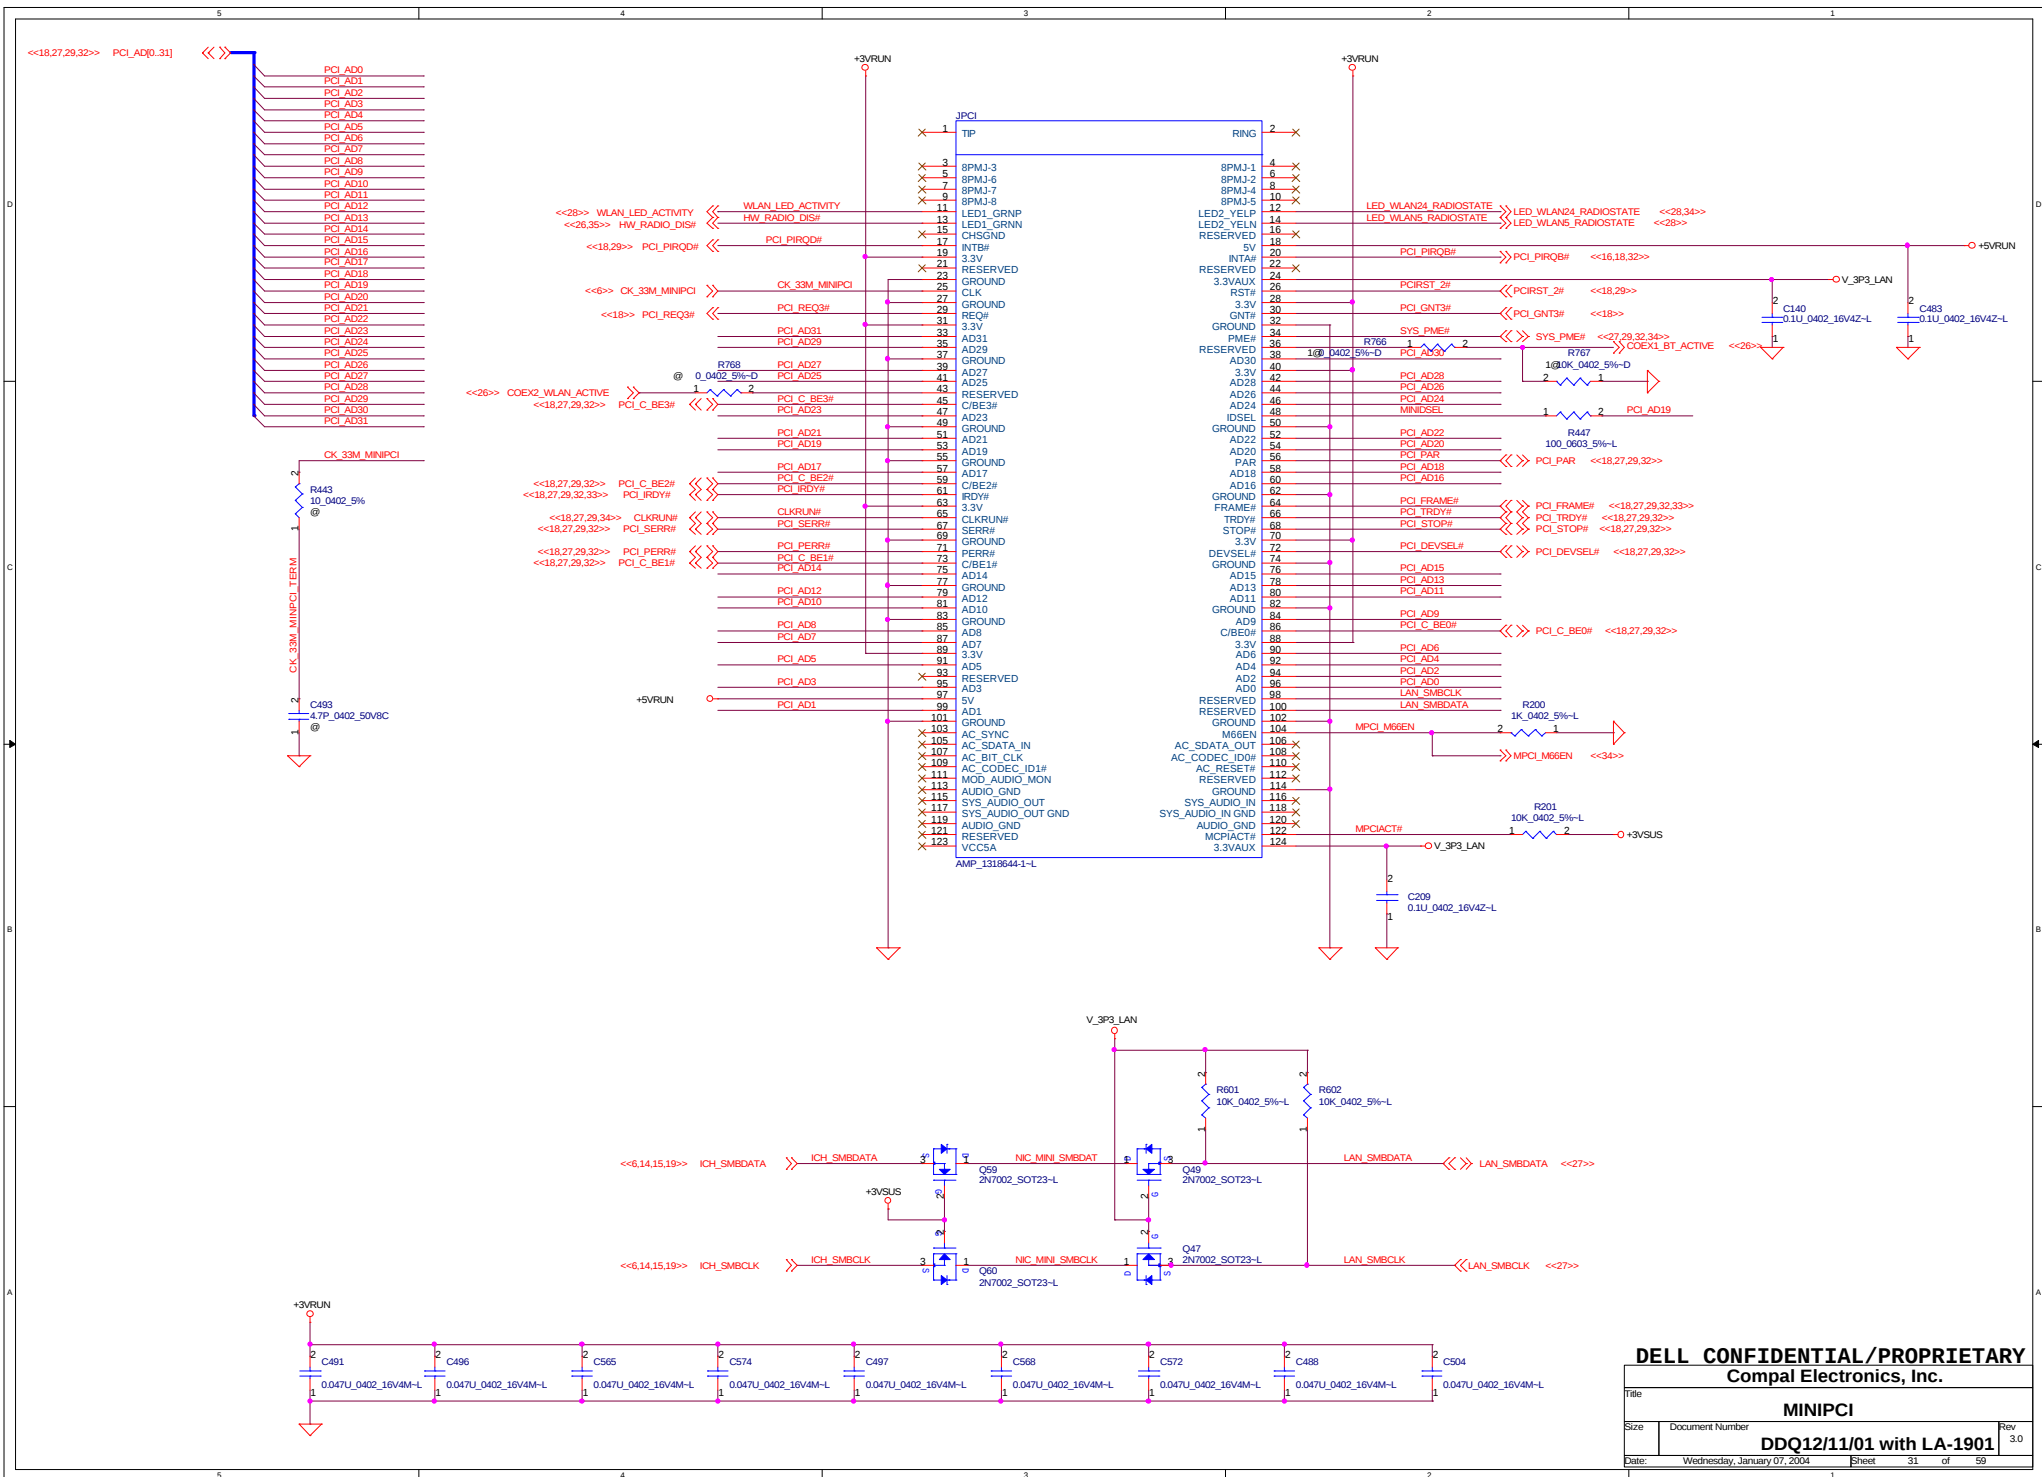

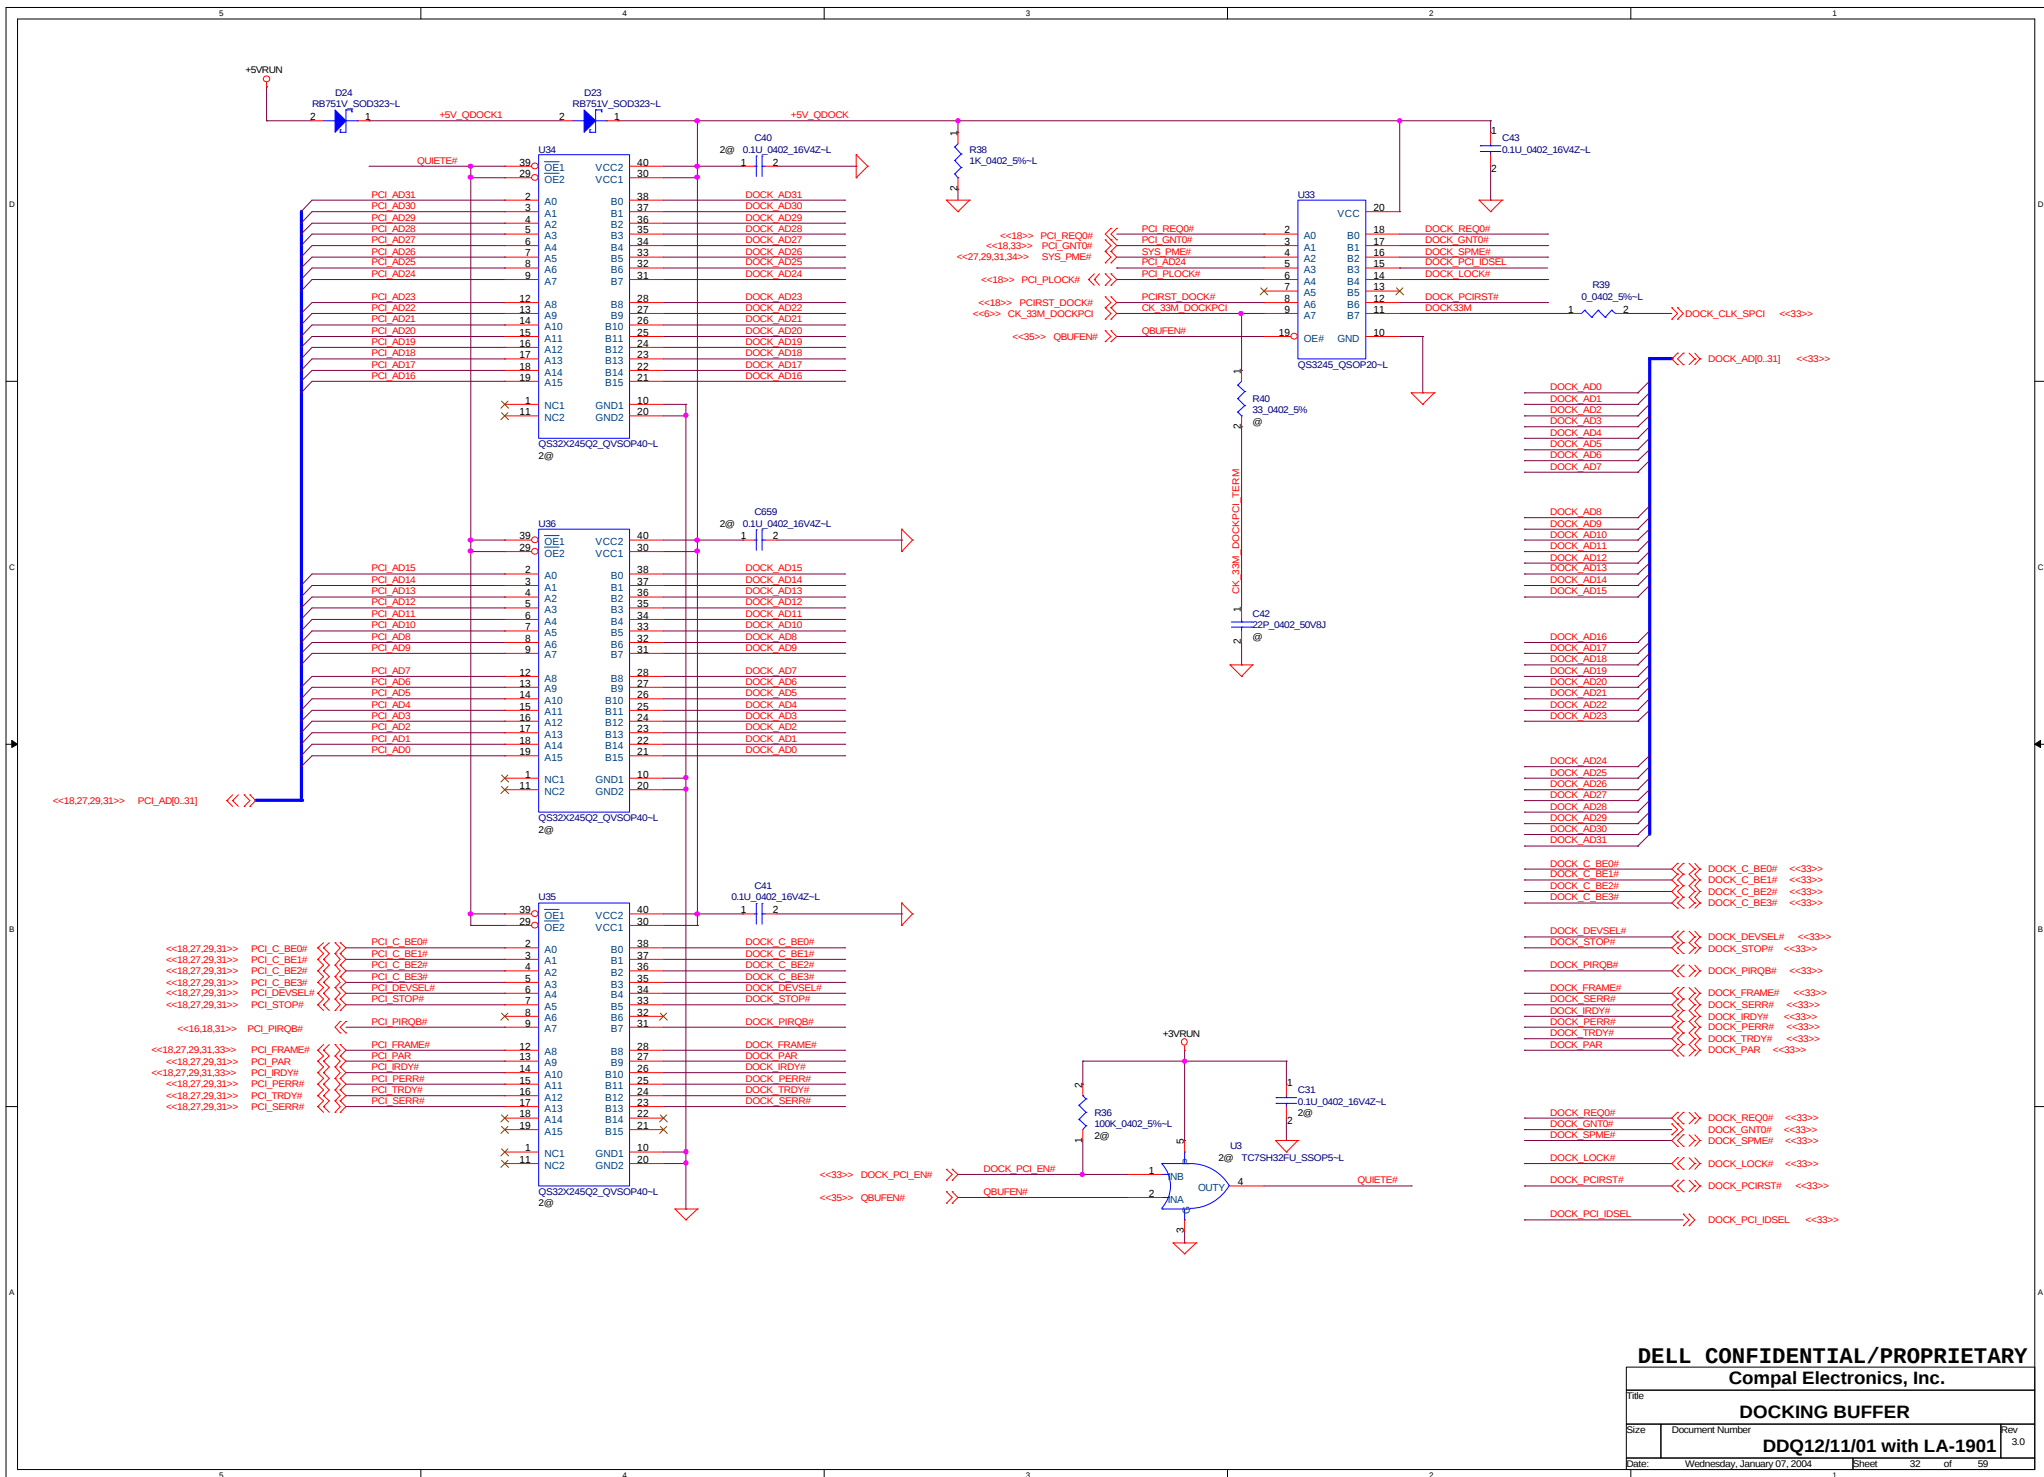

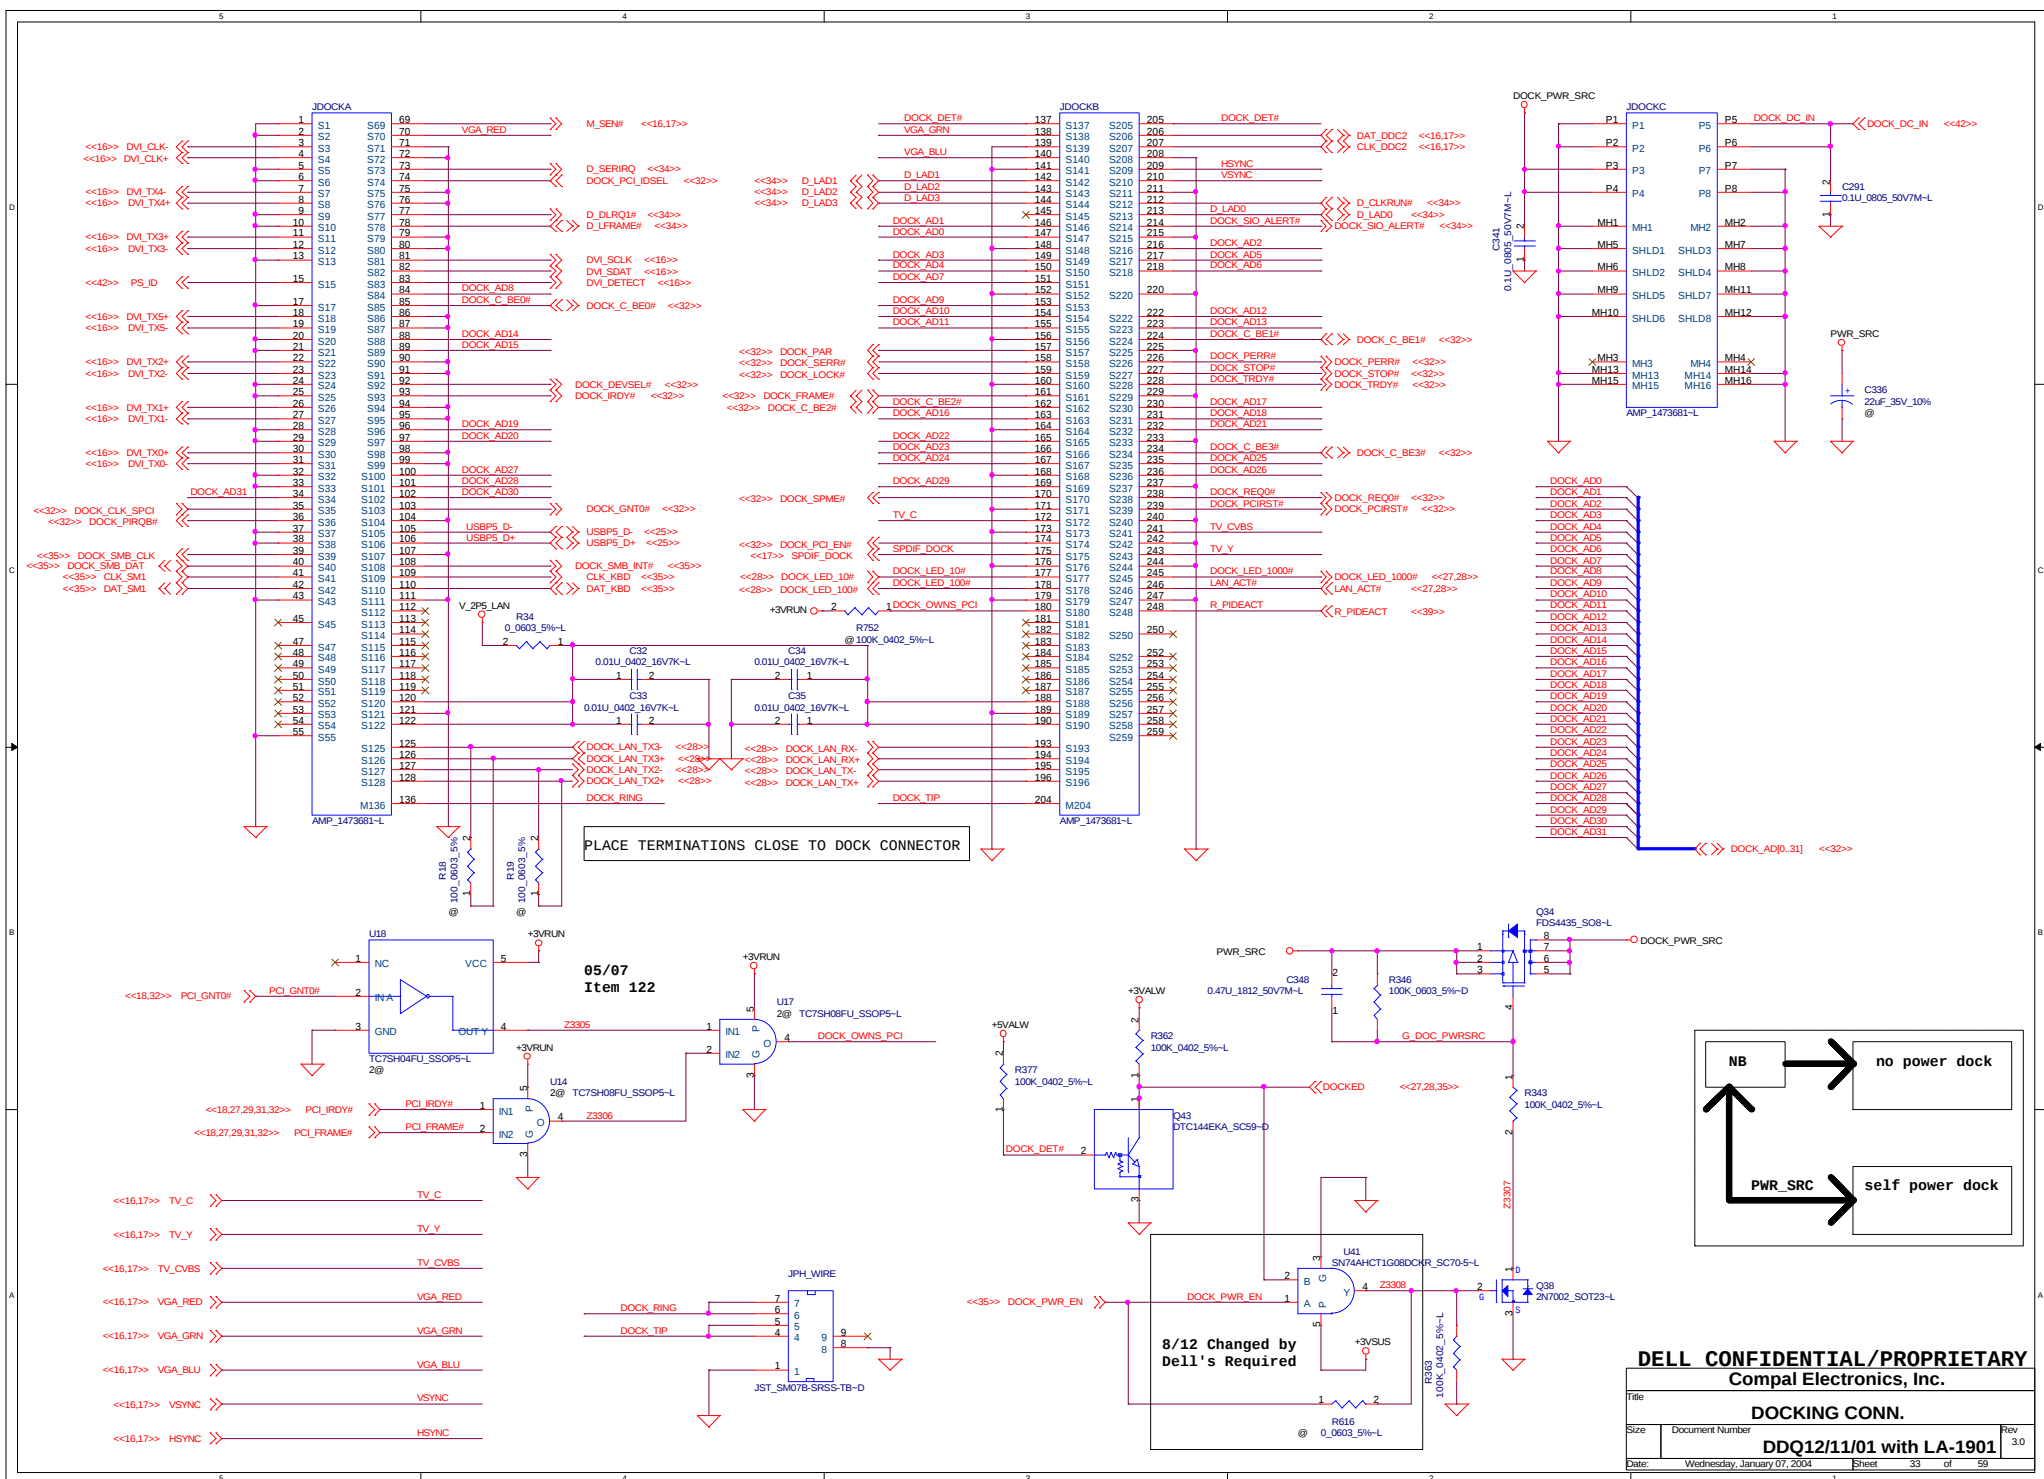

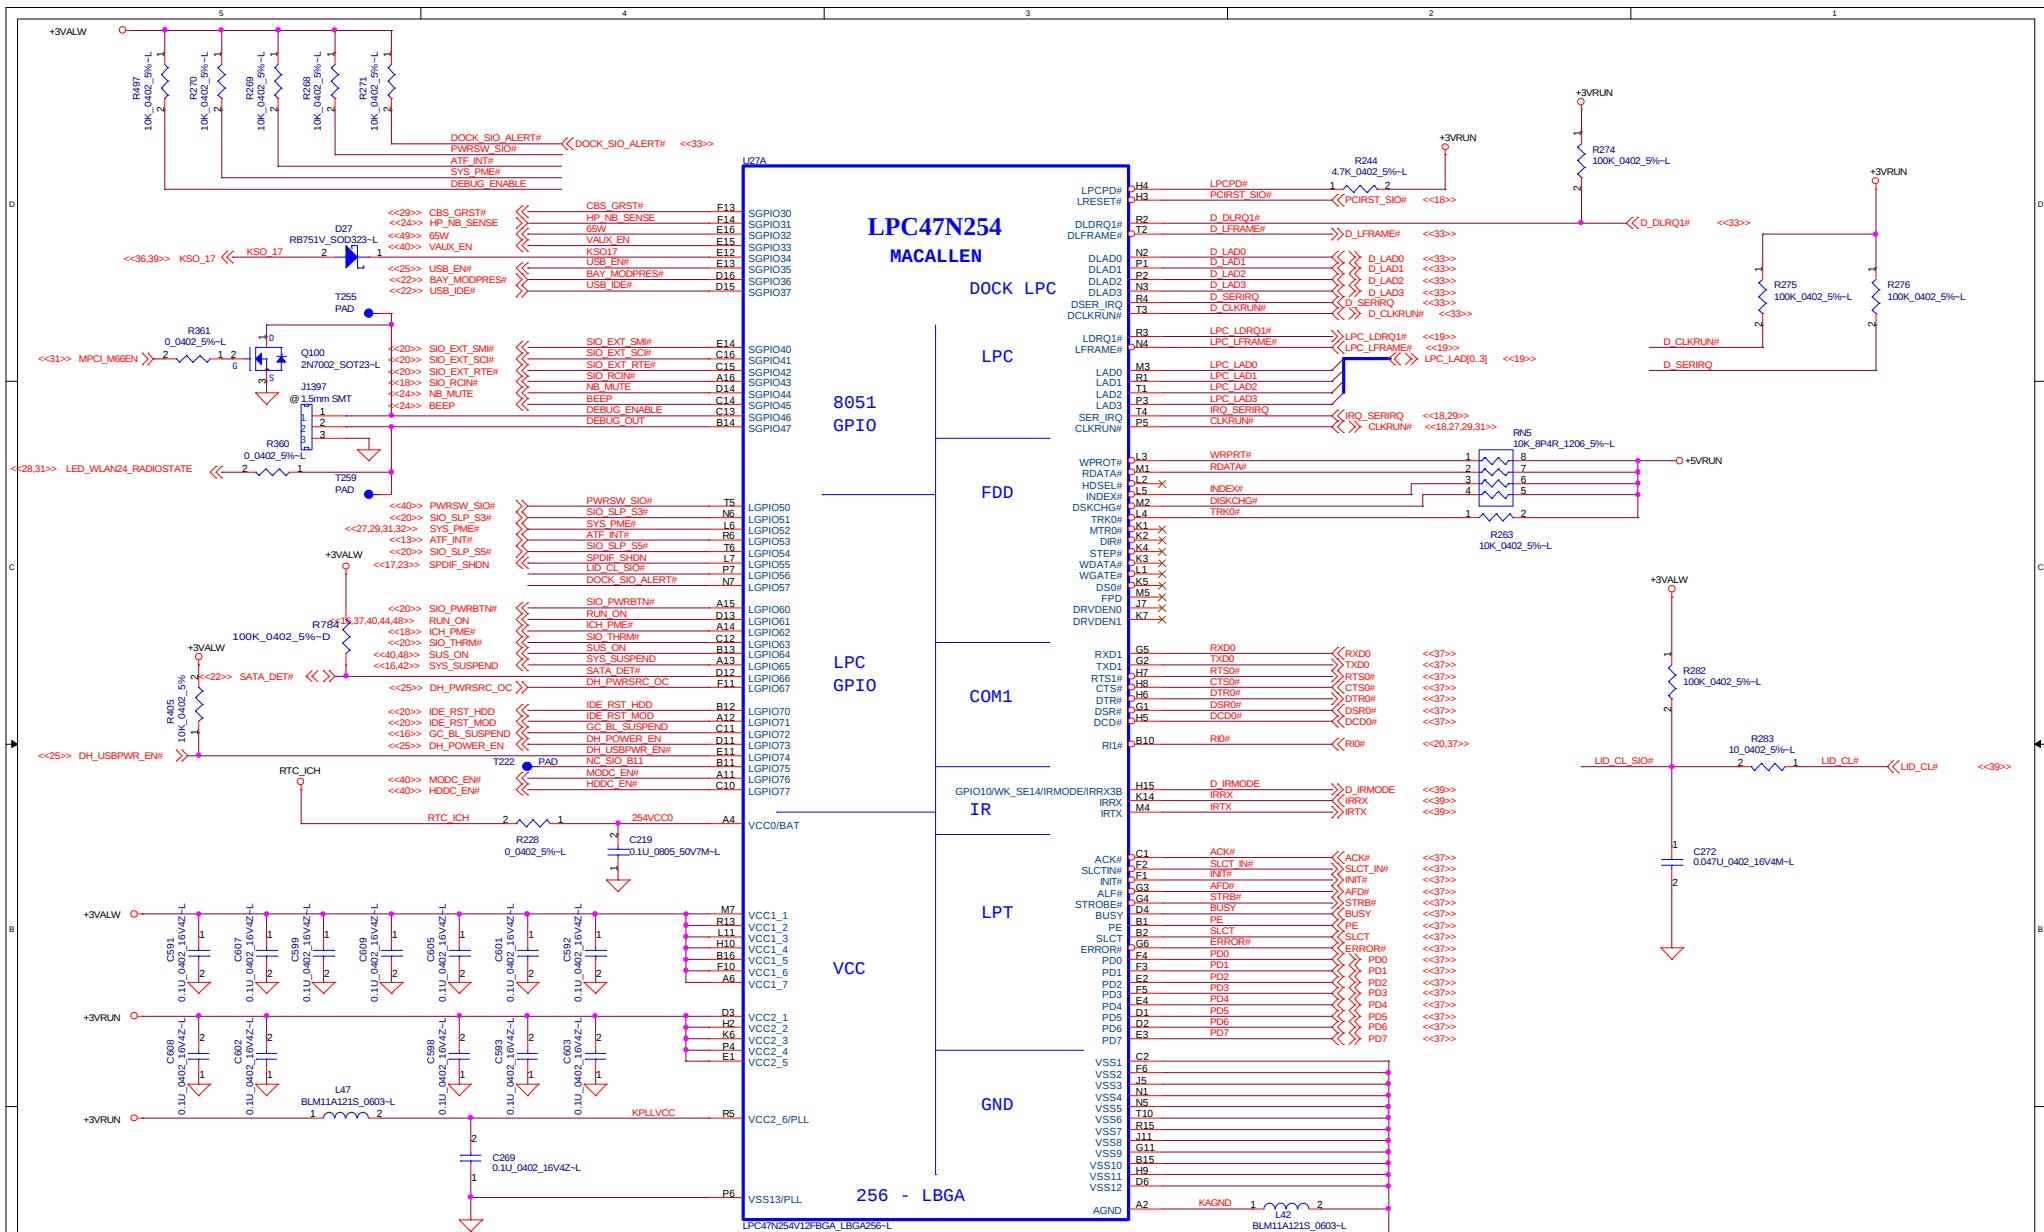





DELL CONFIDENTIAL/PROPRIETARY

Compal Electronics, Inc.

Title SIO (1/2)

Size Document Number DDQ12/11/01 with LA-1901 Rev 3.0







Date: Wednesday, January 07, 2004 Sheet 34 of 59

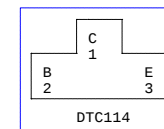
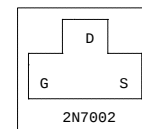
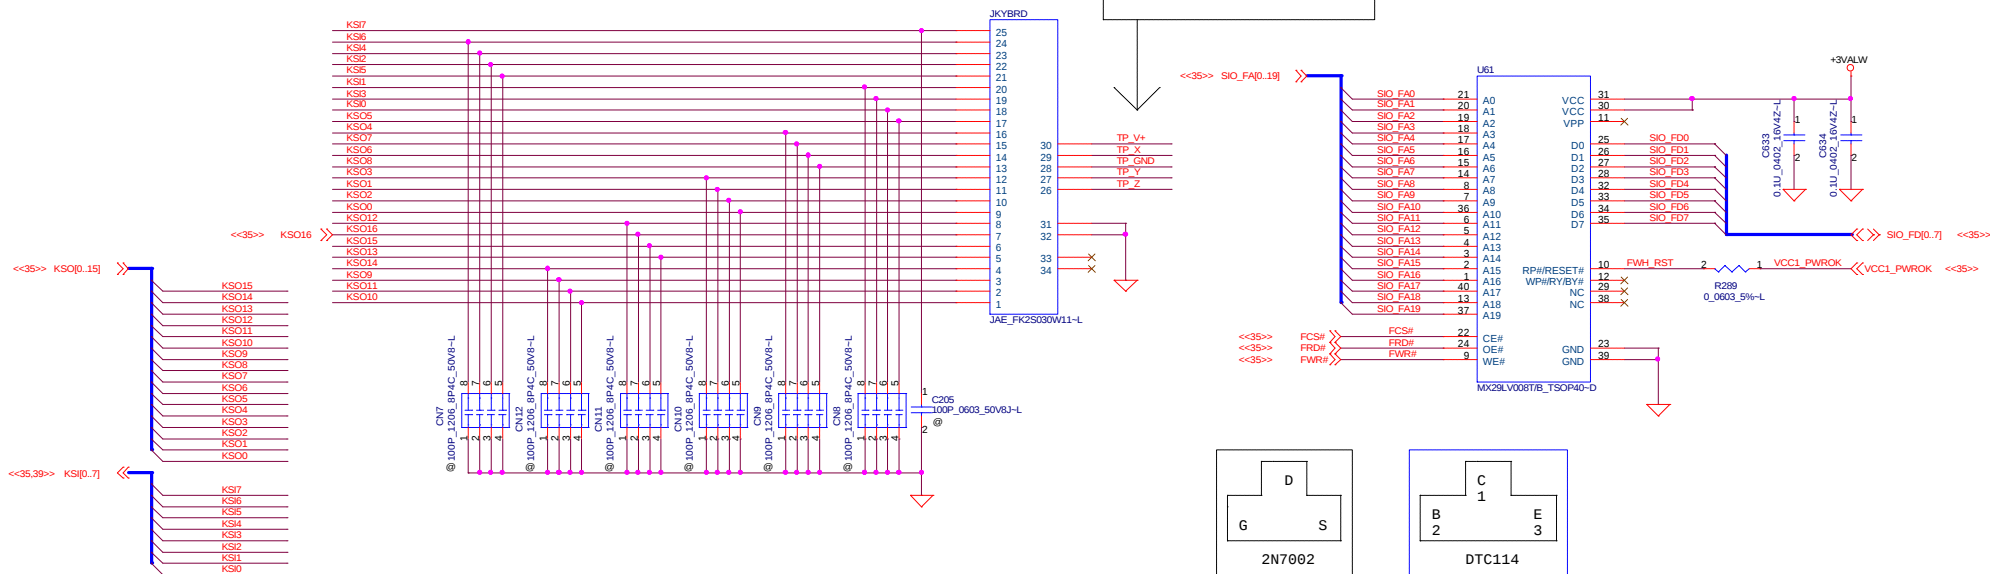
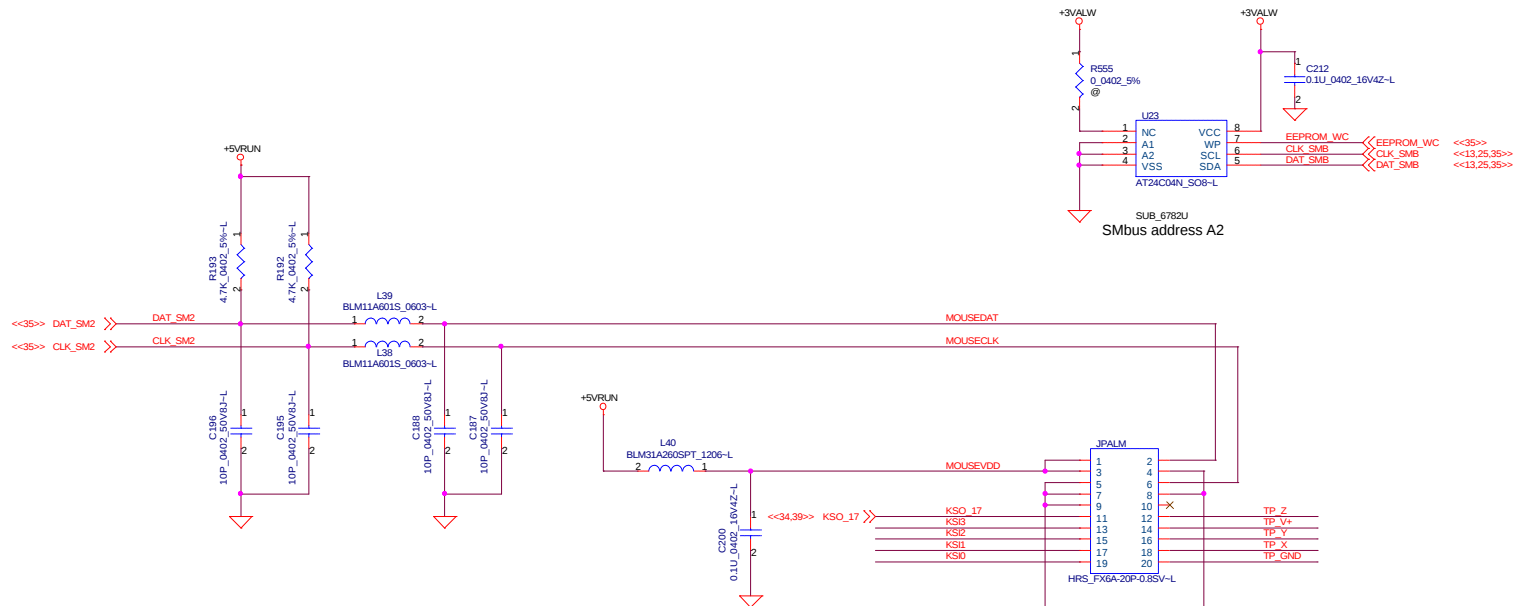







DELL CONFIDENTIAL/PROPRIETARY
Compal Electronics, Inc.




Title			INT KB
Size	Document Number	DDQ12/11/01 with LA-1901	
Date:	Wednesday, January 07, 2004	Sheet	36 of 59
		Rev	3.0

Parallel Port

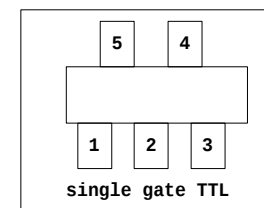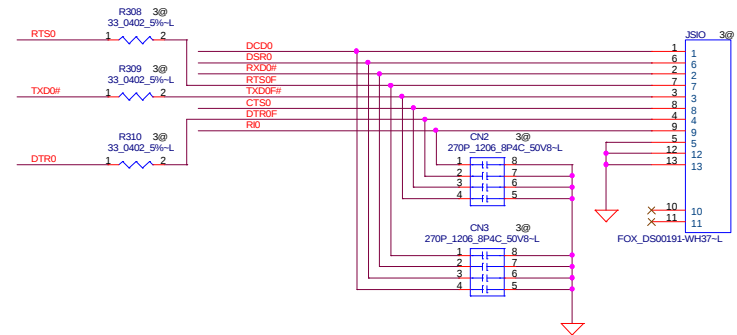
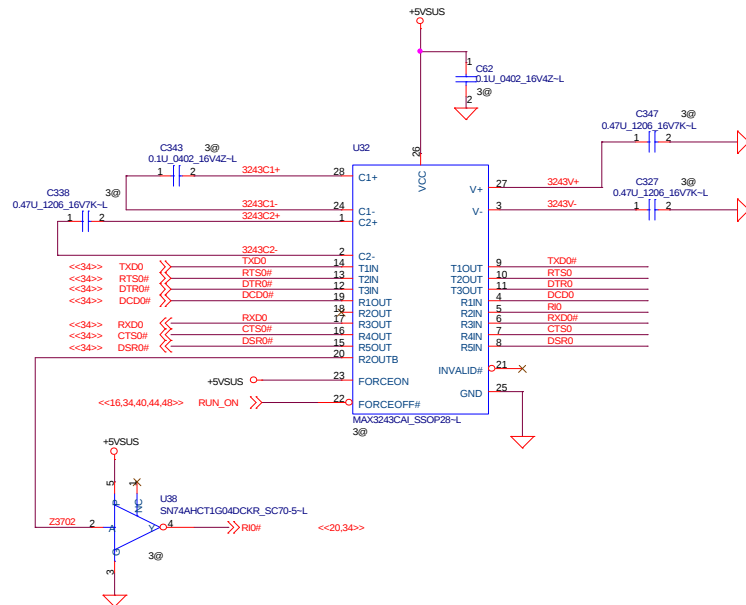
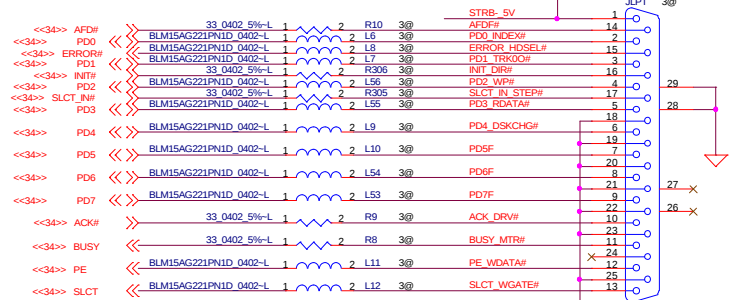
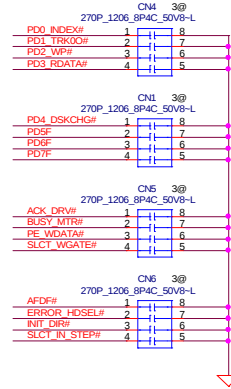
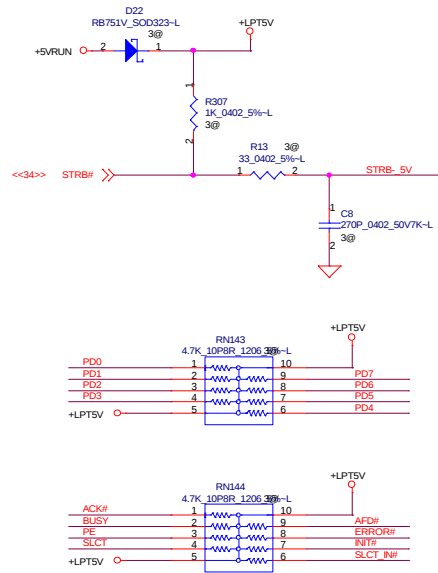


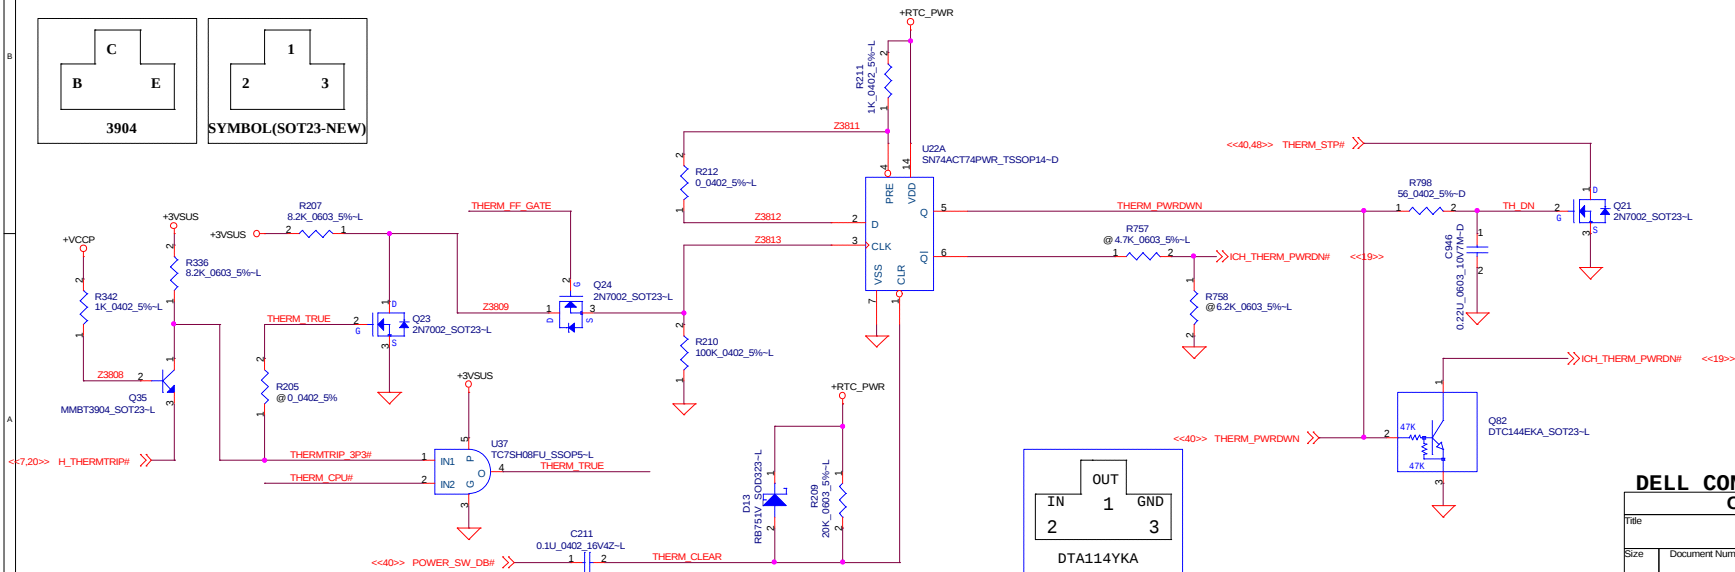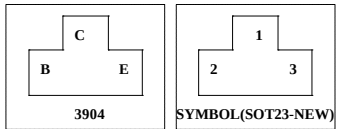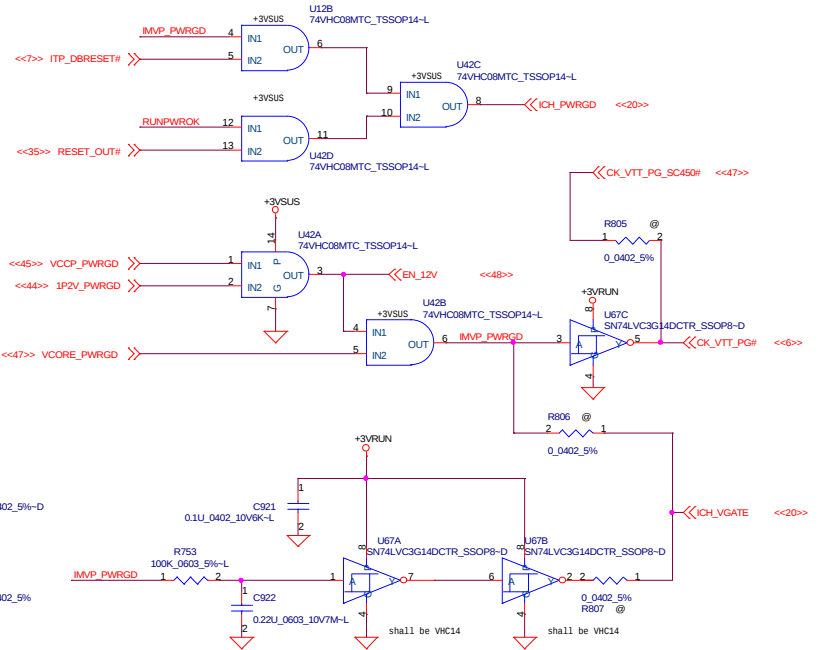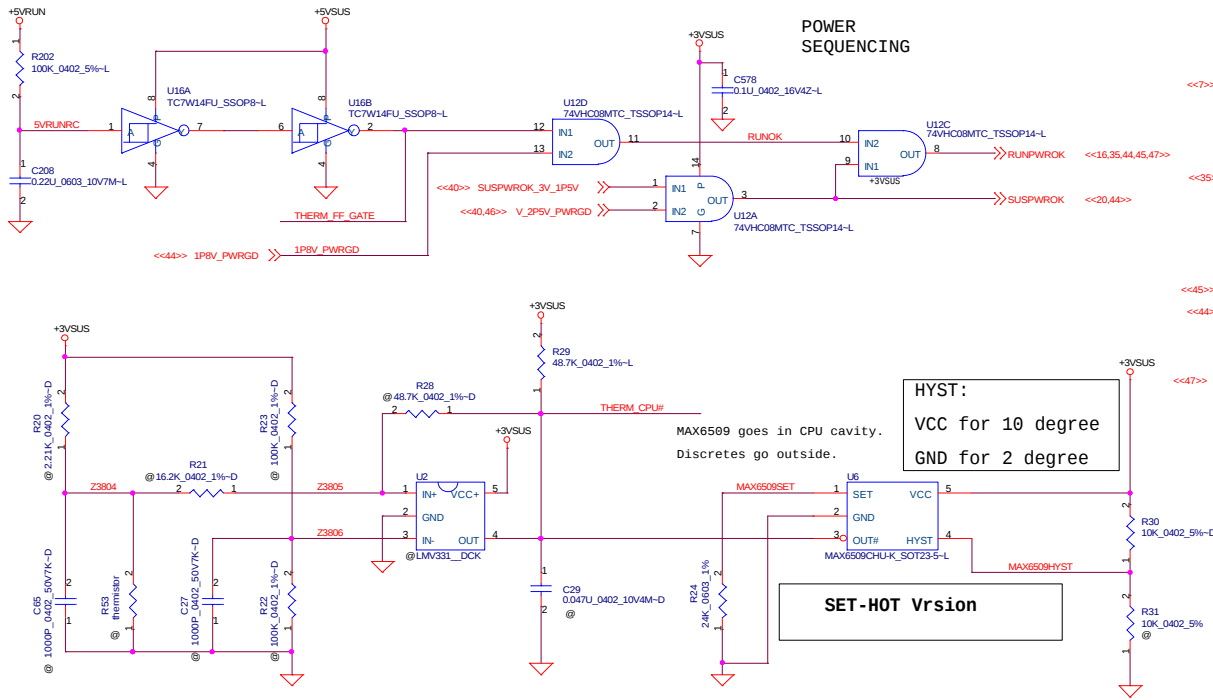


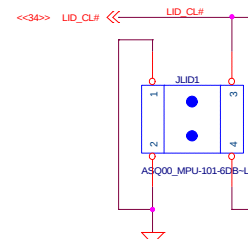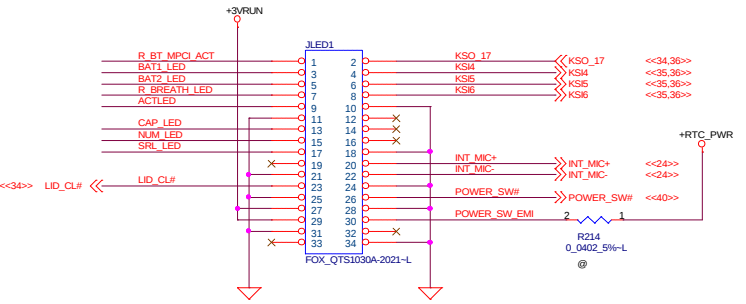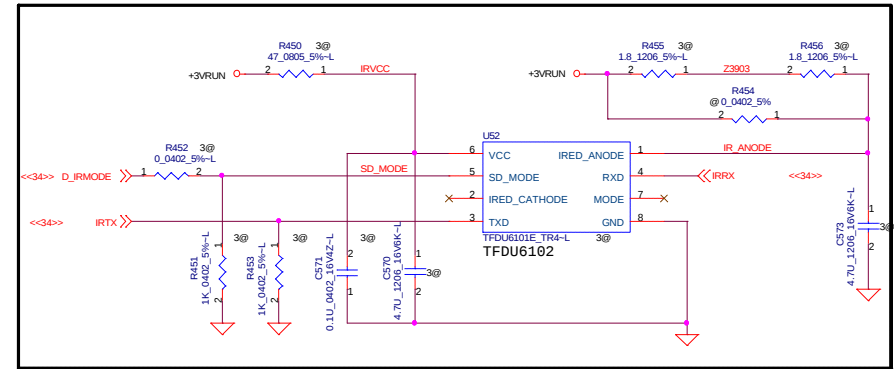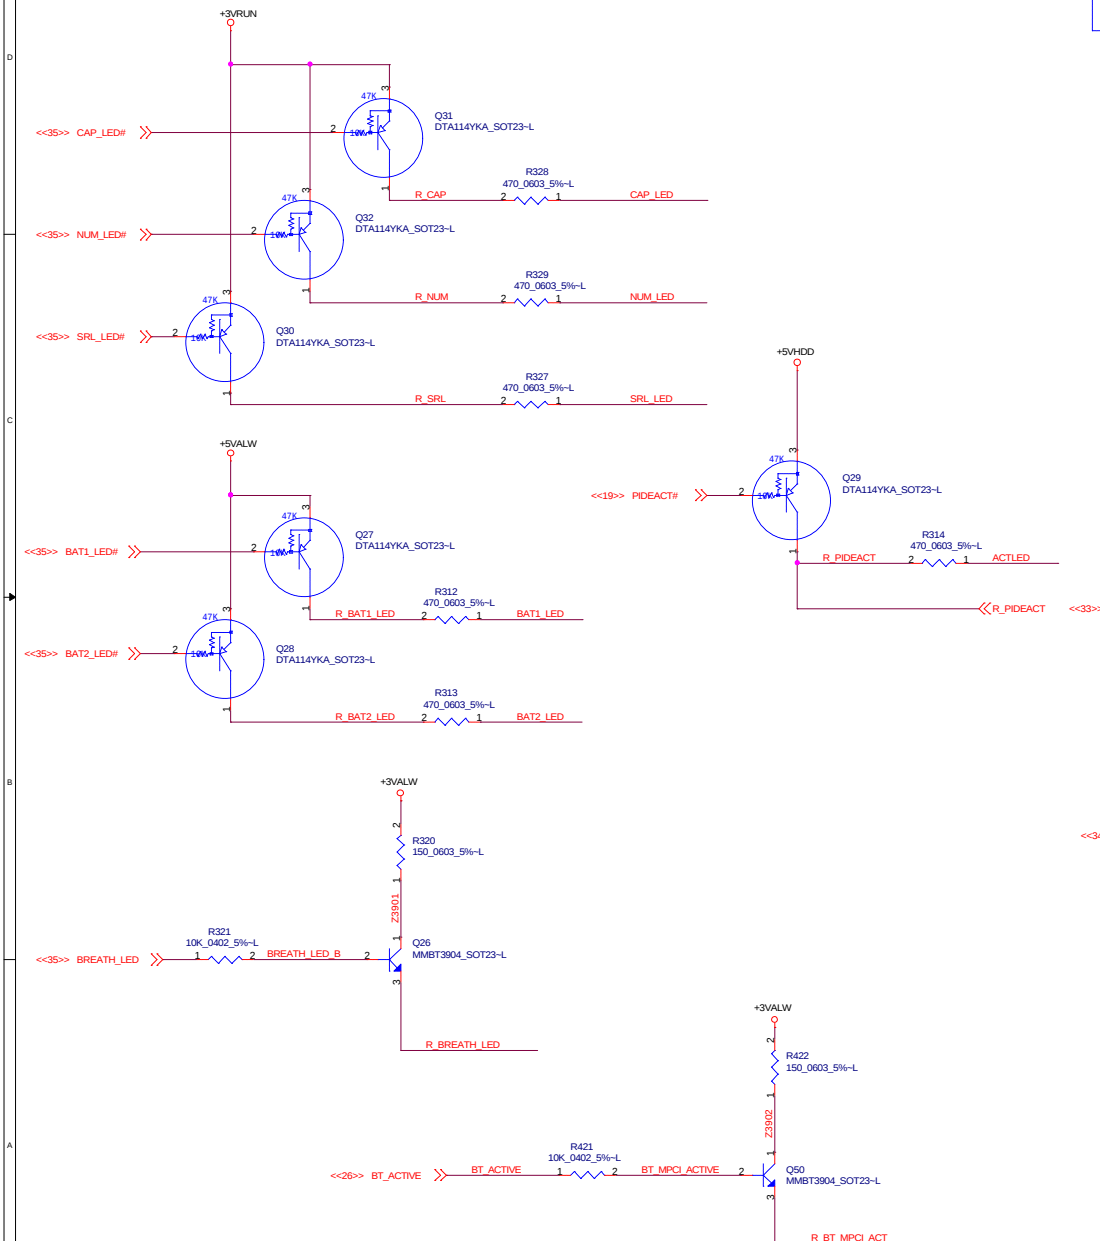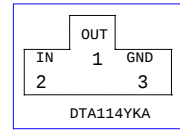

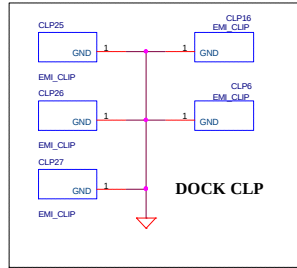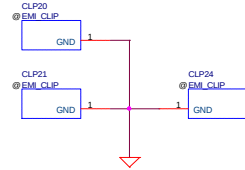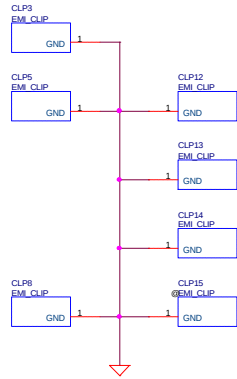


Fiducial Mark

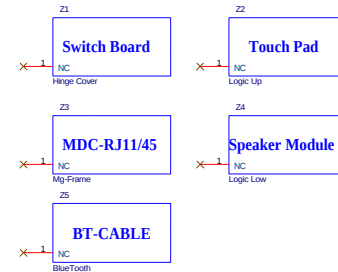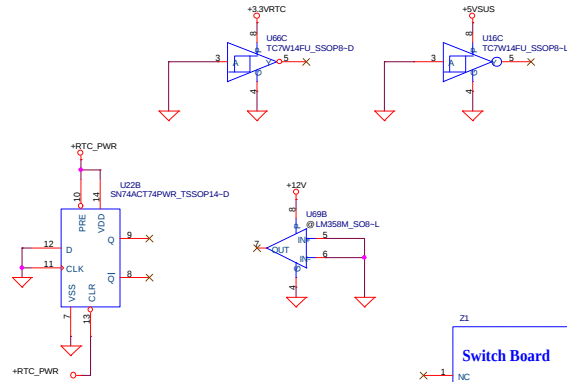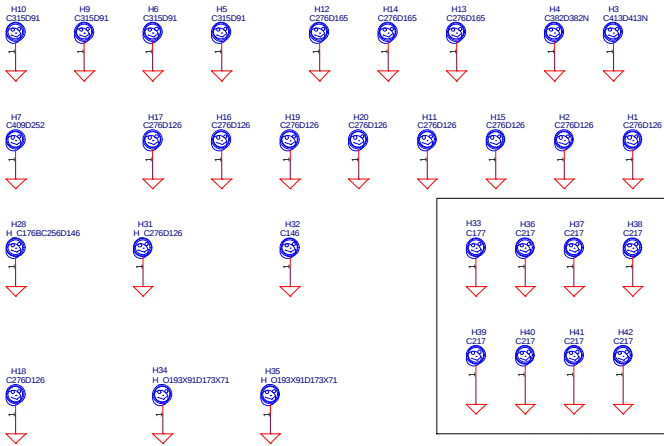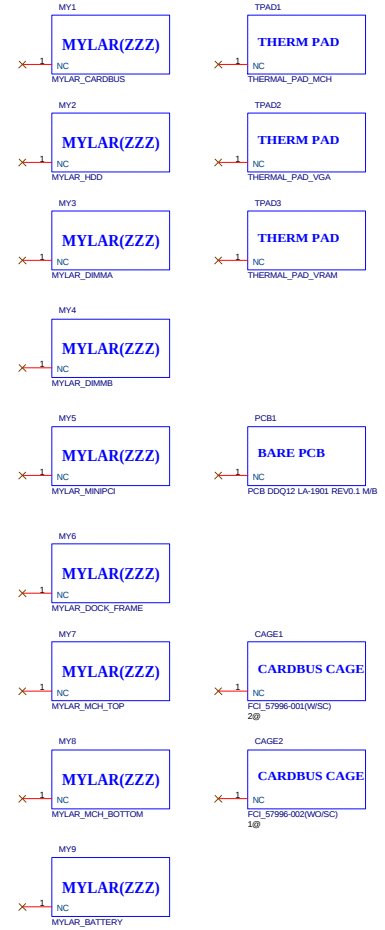
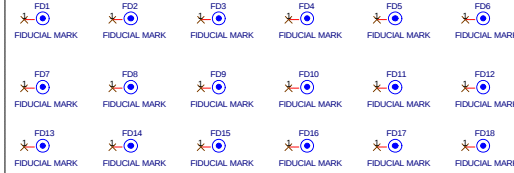


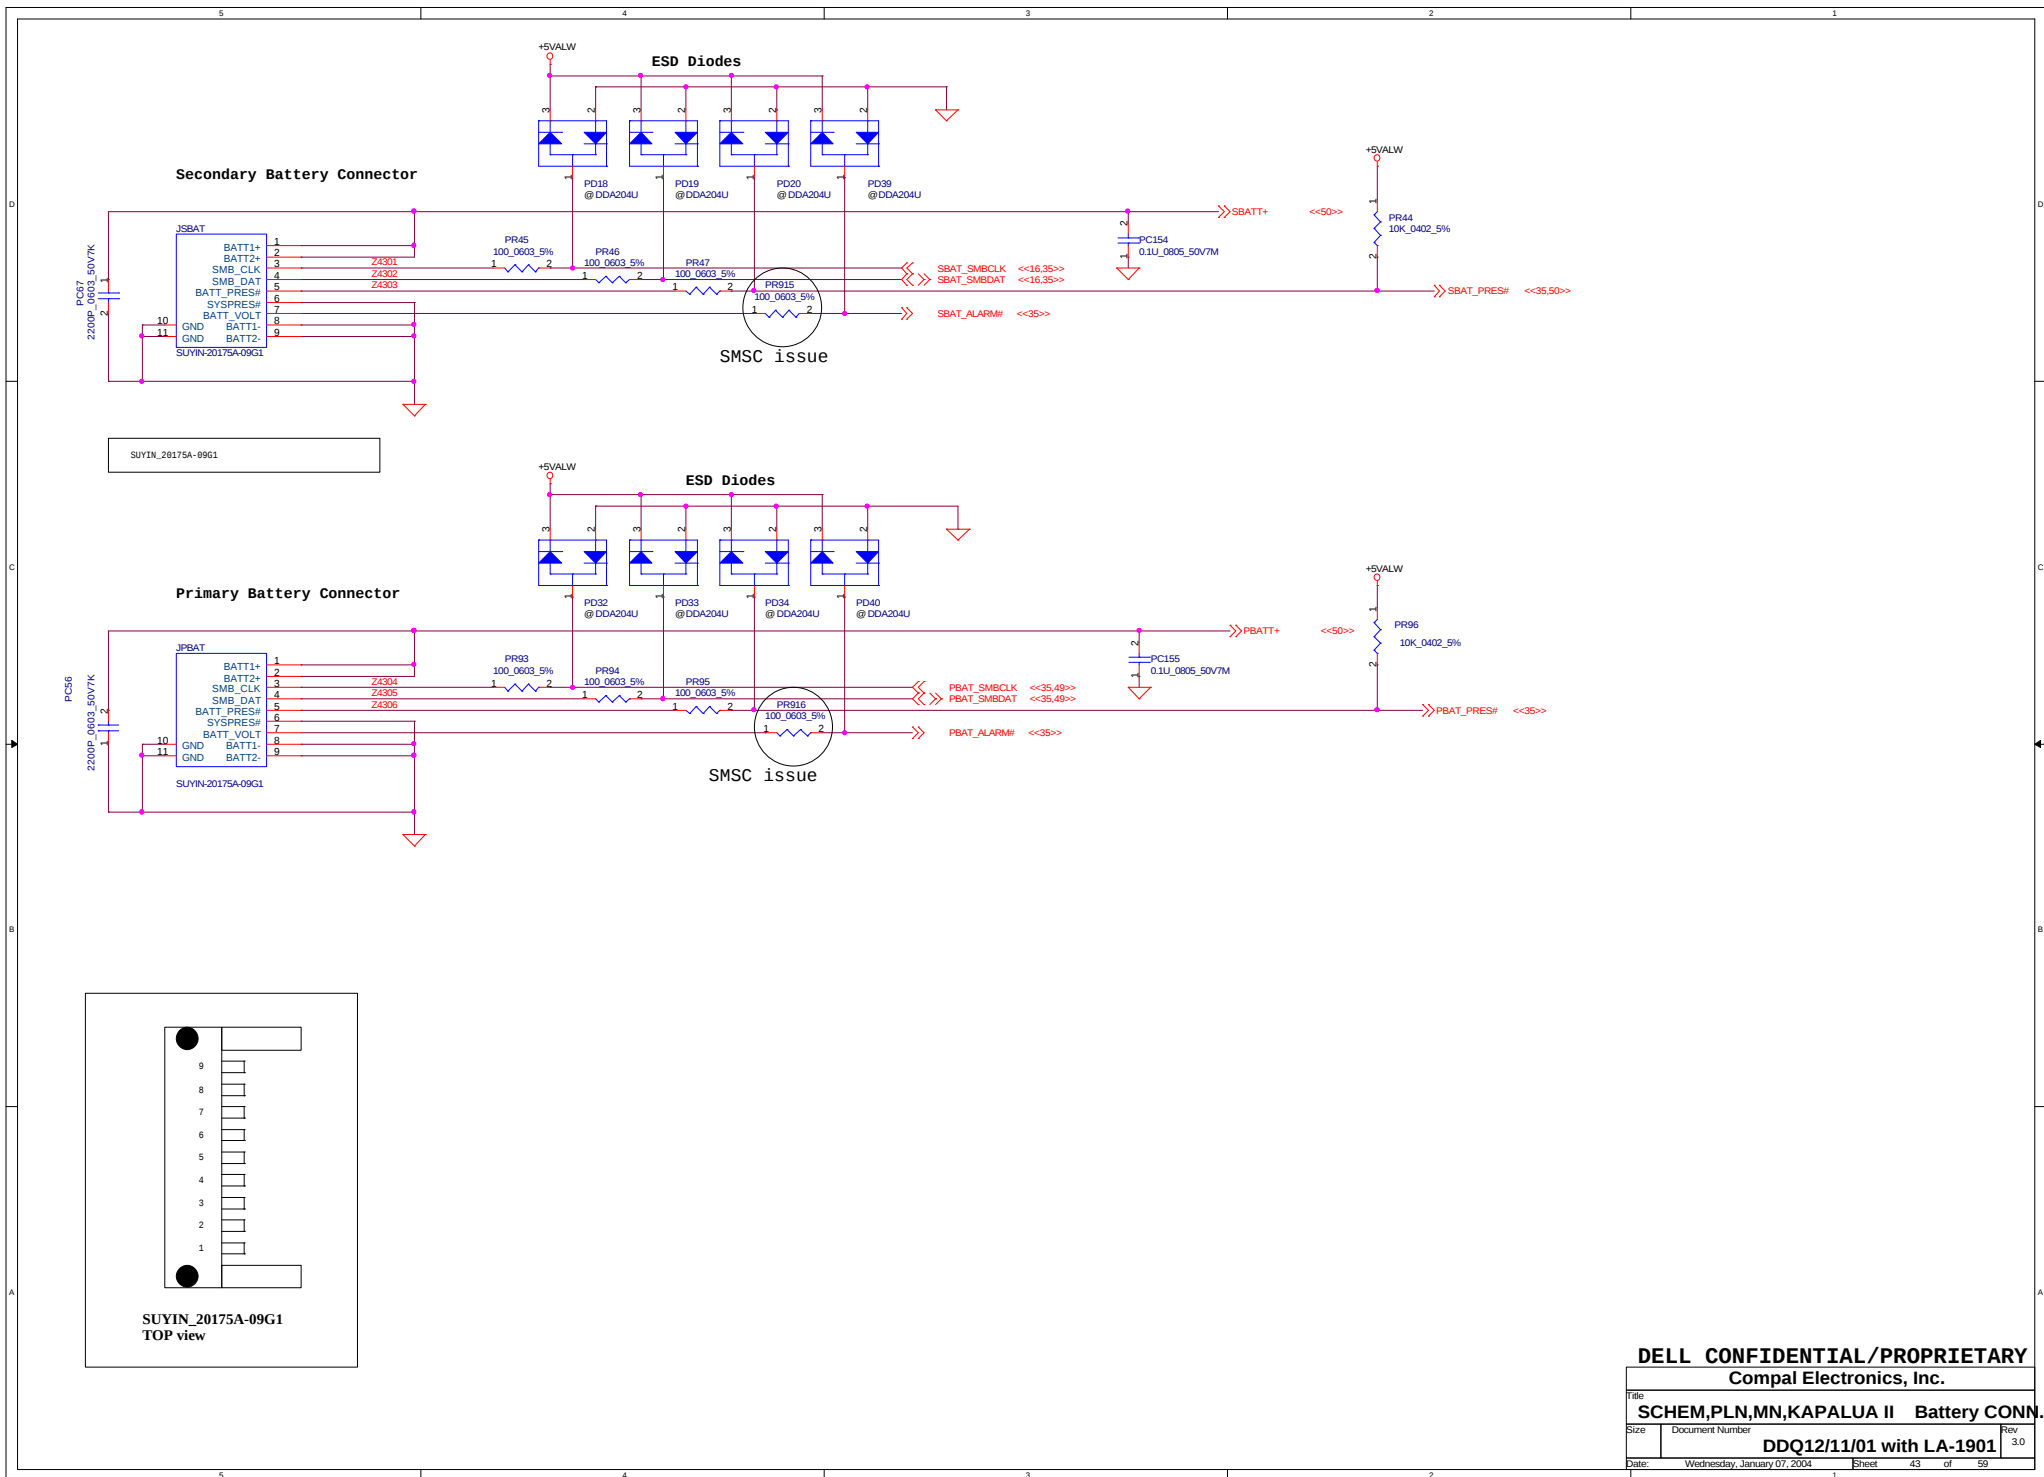

+1.2VRUN/+1.8VRUN SOURCE

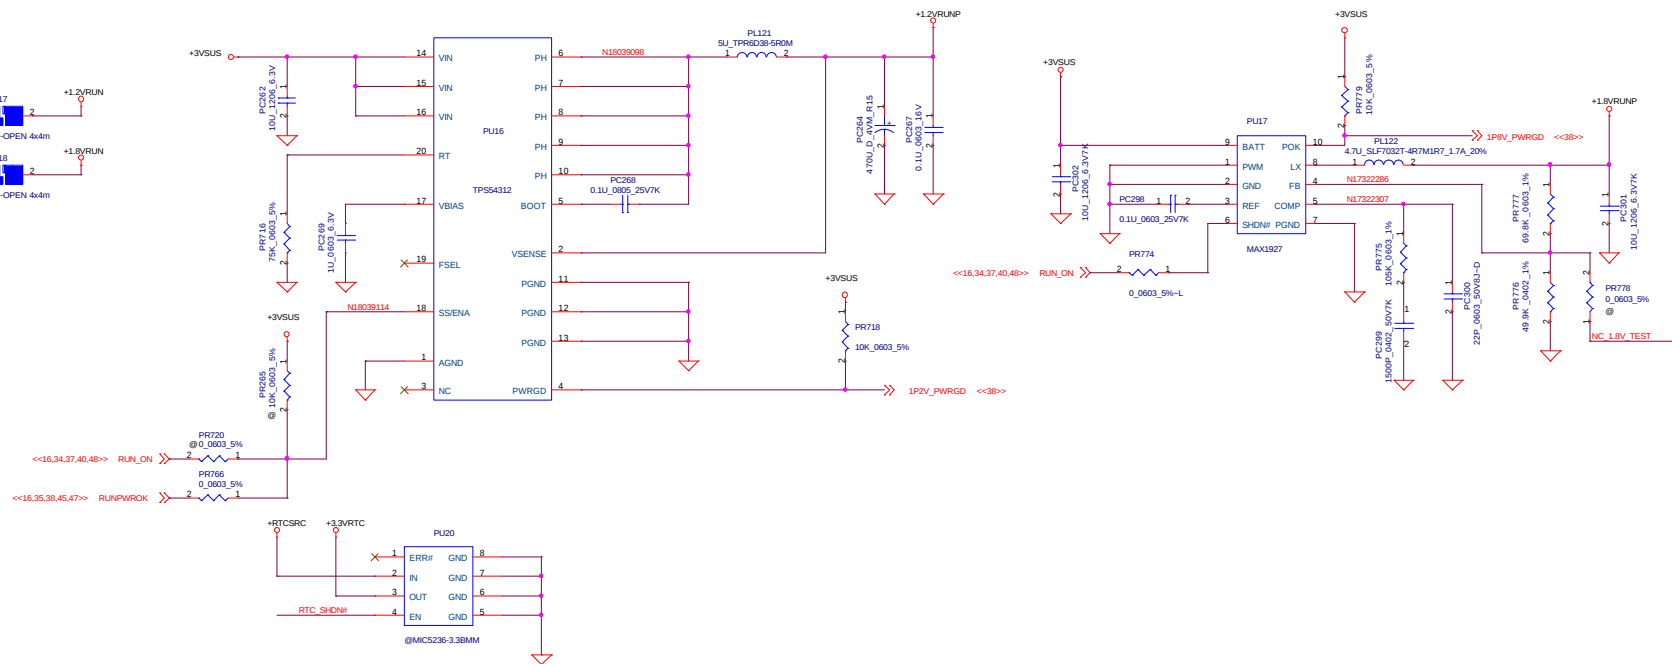

Allows SUS planes to power ALW planes when possible

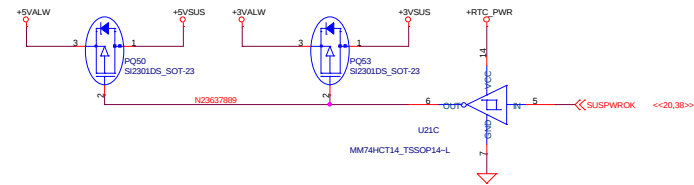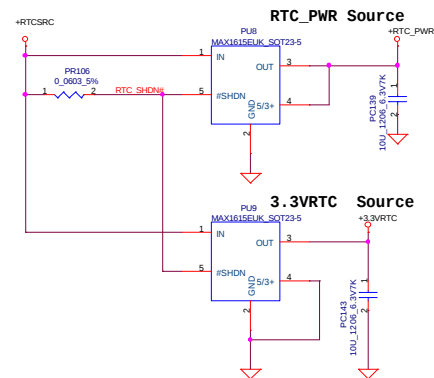

DELL CONFIDENTIAL/PROPRIETARY

COMPAL ELECTRONICS, INC

Title	SCHEM,PLN,MN,KAPALUA II +1.2V & +1.8V
-------	---------------------------------------

Size	Document Number	Rev
	DDQ12/11/01 with LA-1901	3.0

Date: Wednesday, January 07, 2004 Sheet 44 of 59

THIS SHEET OF ENGINEERING DRAWING IS THE PROPRIETARY PROPERTY OF COMPAL ELECTRONICS, INC. AND CONTAINS CONFIDENTIAL AND TRADE SECRET INFORMATION. THIS SHEET MAY NOT BE TRANSFERRED FROM THE CUSTODY OF THE COMPETENT DIVISION OF R&D DEPARTMENT EXCEPT AS AUTHORIZED BY COMPAL ELECTRONICS, INC. NEITHER THIS SHEET NOR THE INFORMATION IT CONTAINS MAY BE USED BY OR DISCLOSED TO ANY THIRD PARTY WITHOUT PRIOR WRITTEN CONSENT OF COMPAL ELECTRONICS, INC.

DA0JM2MBCA1

Dell-Compal Confidential

+1.5VSUS/+1.05V(+VCCP)

ISL6225B

10/23 By
Dell's
Request

DELL CONFIDENTIAL/PROPRIETARY

COMPAL ELECTRONICS, INC


Title SCHEM.PLN,MN,KAPALUA II +1.5V & +1.05V


Document Number DDQ12/11/01 with LA-1901

Date Wednesday, January 07, 2004 Sheet 45 of 59


THIS SHEET OF ENGINEERING DRAWING IS THE PROPRIETARY PROPERTY OF COMPAL ELECTRONICS, INC. AND CONTAINS CONFIDENTIAL AND TRADE SECRET INFORMATION. THIS SHEET MAY NOT BE TRANSFERRED FROM THE CUSTODY OF THE COMPETENT DIVISION OF R&D DEPARTMENT EXCEPT AS AUTHORIZED BY COMPAL ELECTRONICS, INC. NEITHER THIS SHEET NOR THE INFORMATION IT CONTAINS MAY BE USED BY OR DISCLOSED TO ANY THIRD PARTY WITHOUT PRIOR WRITTEN CONSENT OF COMPAL ELECTRONICS, INC.

ADD PR901, PR902 for SC1476 ISSUE_2003/06/13

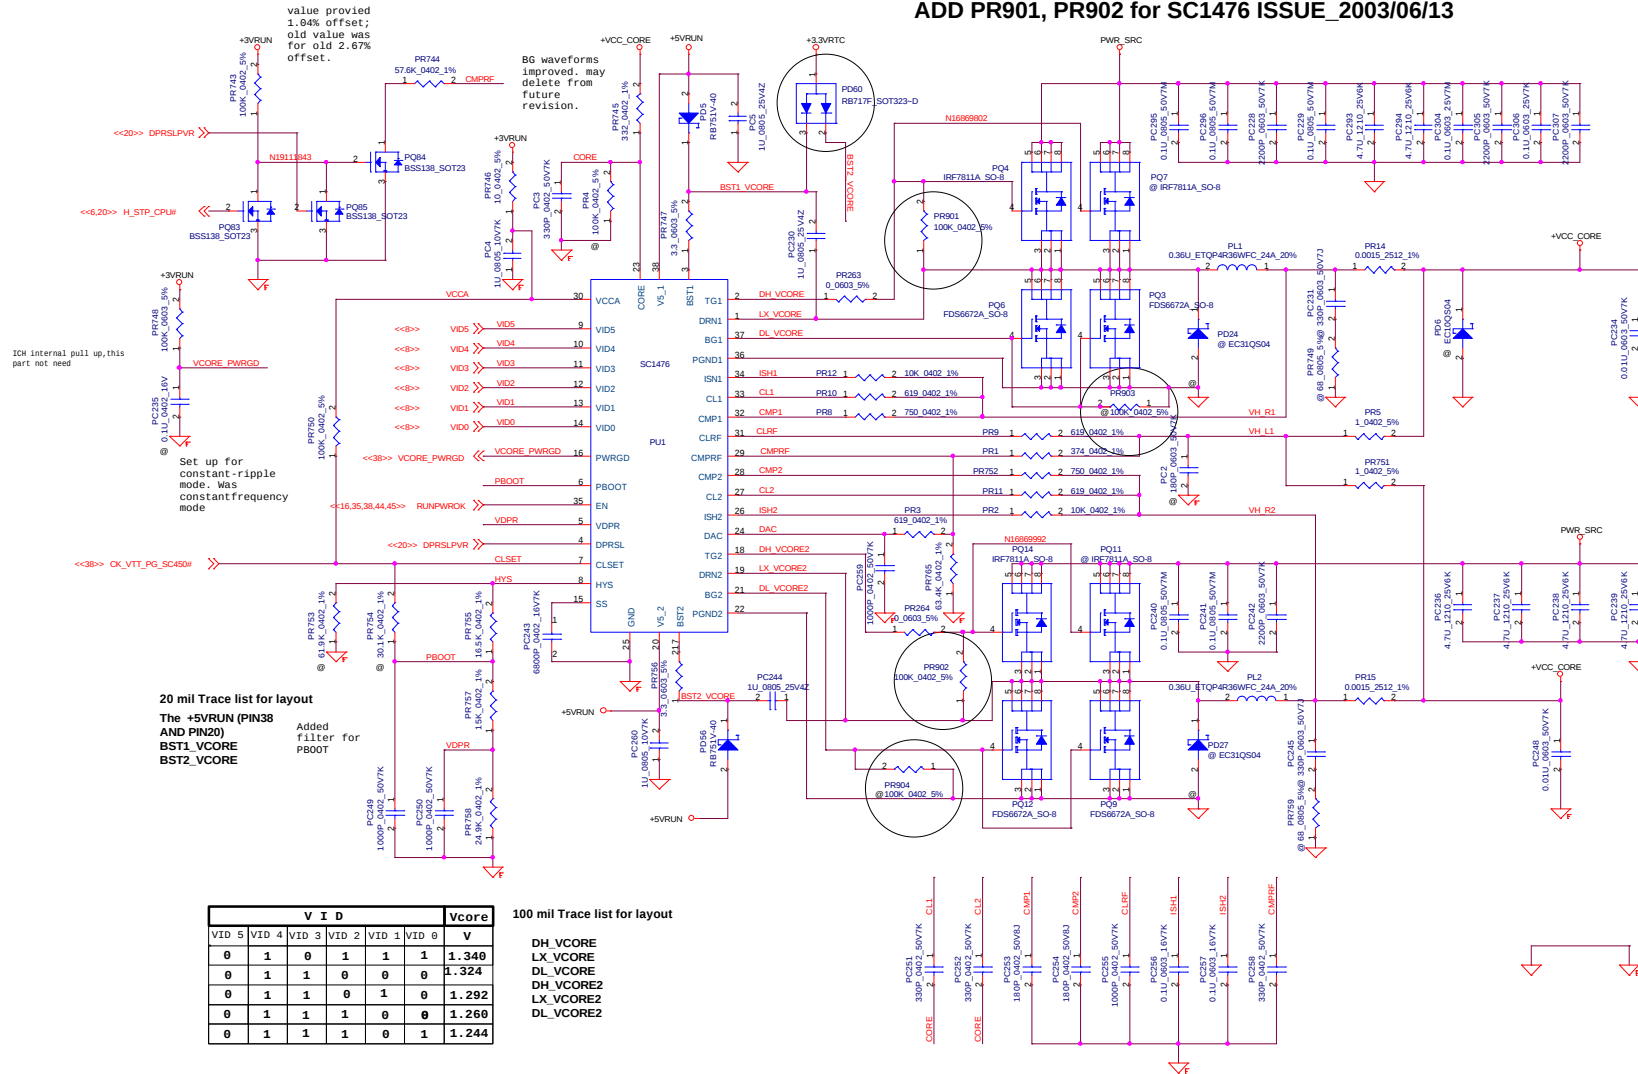



	65W (2.93A)	90W (4.0A)	130W (5.85A)
65W	H	L	L
AC_130W_90W	H	L	H

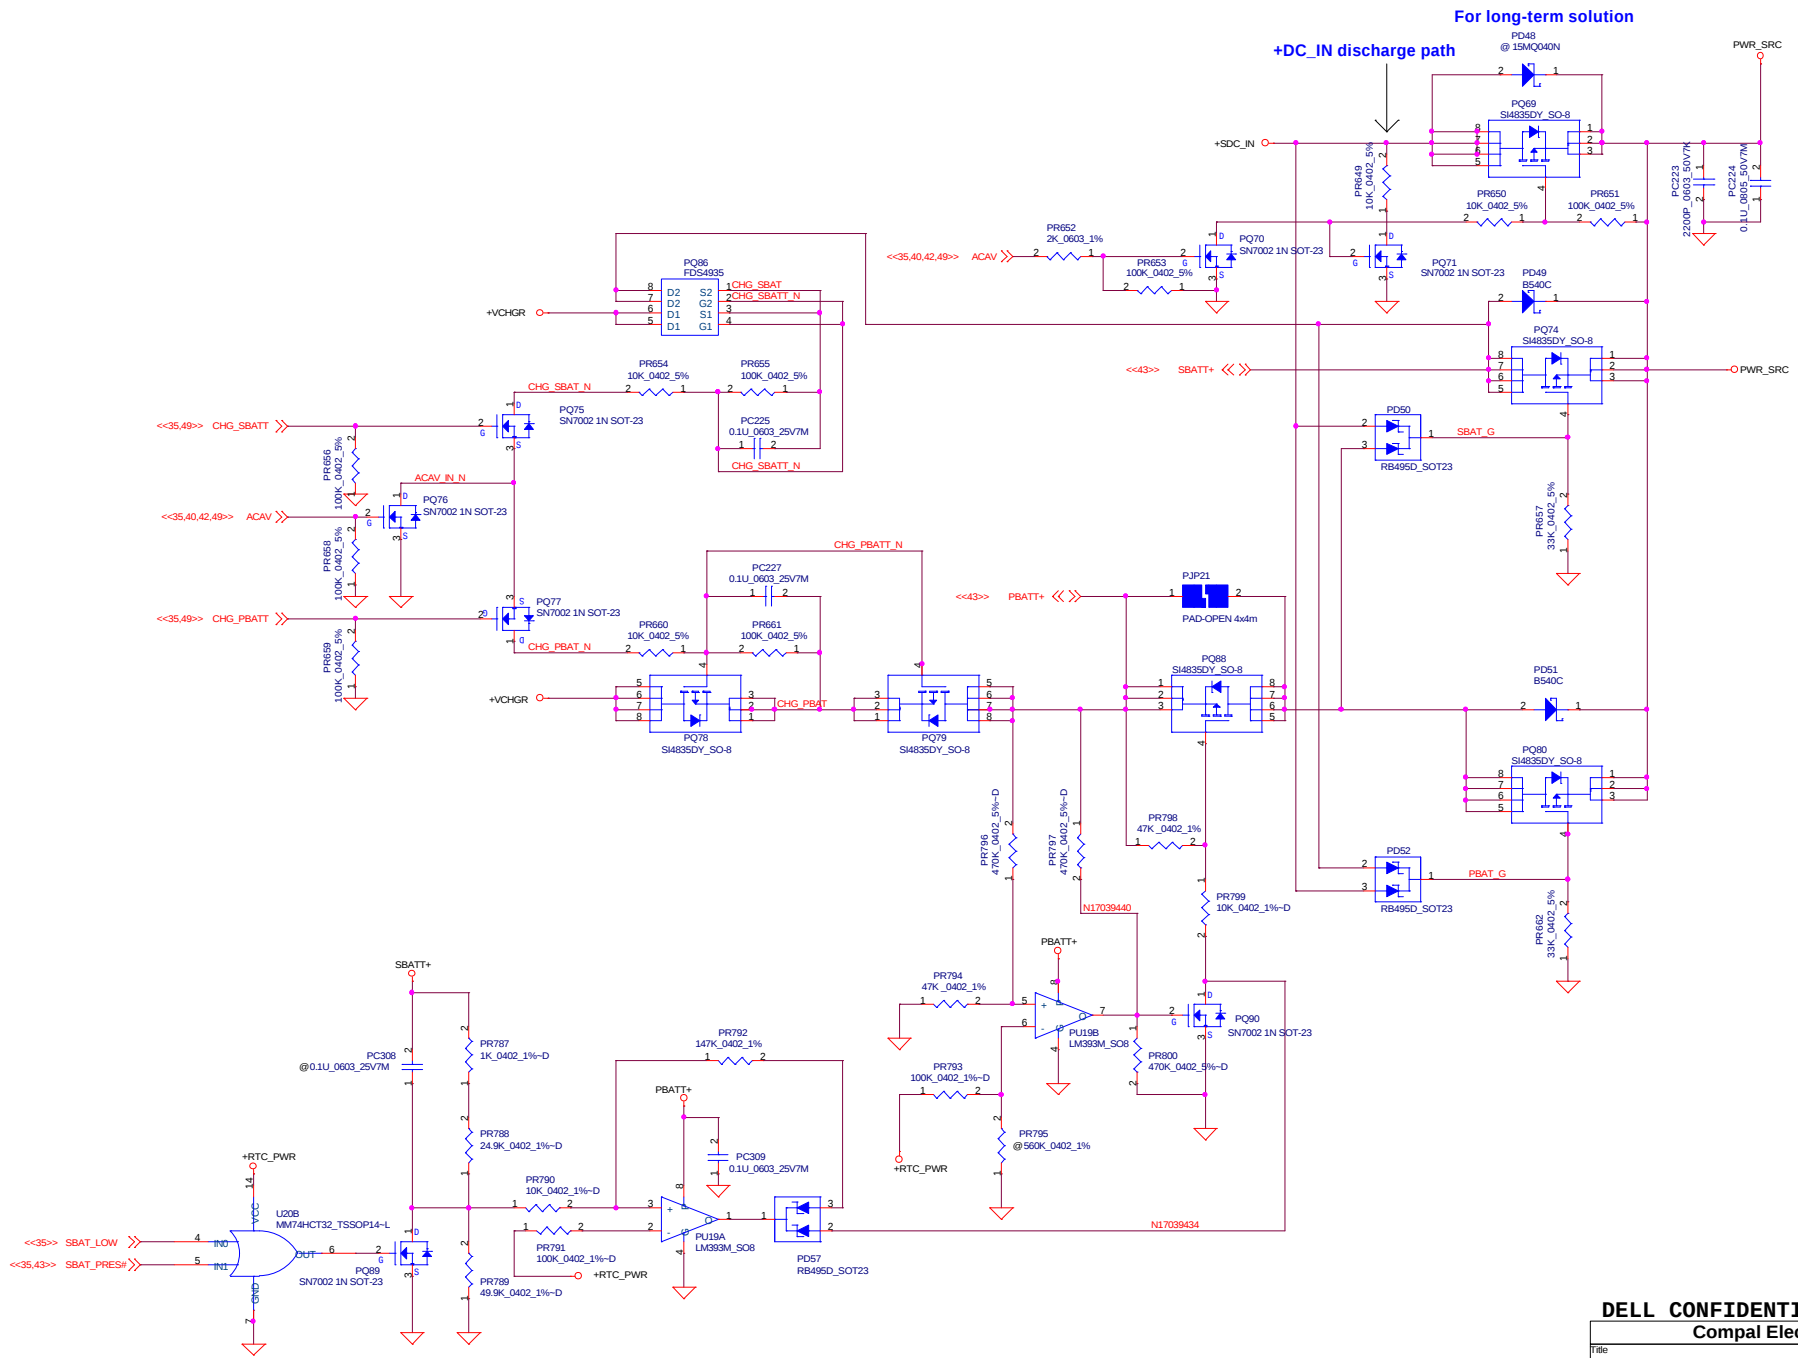

Version Change List (P. I. R. List)

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
1	27	Ethernet	8/18/2002	Dell	R318 use the same value as Lindbergh	R318 change the value from 12400 to 11400	X00
2	27	Ethernet	8/18/2002	Dell	Netname change for A-2 chip	Change netname from 4401_CLOCKRUN to 7705M_CLOCKRUN	X00
3	27	Ethernet	8/18/2002	Dell	Populate R549 for 5705m controller	5702 controller do not need to change	X00
4	27	Ethernet	8/18/2002	Dell	Delete "POP SMBUS ISOLATION FOR 5702" text	Delete text	X00
5	28	LAN Transformer	8/18/2002	Dell	No need for RN1 pins 1,2,3,4 to ground connection	Delete RN1 pins 1,2,3,4 to ground connection	X00
6	28	LAN Transformer	8/18/2002	Dell	Delete the net name LIN_1000# and rename net of Pin G12 of U1A, Page 27, to DOCK_LED_1000#	Delete the net name LIN_1000#, rename net of Pin G12 of U1A to DOCK_LED_1000#	X00
7	8	Banias Processor	8/20/2002	Dell	PJP11 & PJP16 text discribe error	Change PJP11 to Short, and PJP16 to Open.	X00
8	27	Ethernet	8/20/2002	Dell	So for now we can use 1150 Ohm 1% resistor for R318 and we will continue with the 5702 controller	R318 change the value from 11400 to 11500	X00
9	31	MINI PCI	8/20/2002	Dell	Change pin 17 of JPCI from PCI_PIRQB#to PCI_PIRQD#	Change pin 17 of JPCI connection to PCI_PIRQD#	X00
10	42	Power DC-IN	8/20/2002	Dell	Change PQ32, PR73, PR74, PR77 to NP	Updated PQ32, PR73, PR74, PR77 to NP	X00
11	1	Cover page	8/22/2002	Dell	On the title page place the name of the project Kapalua	Updated Schematic cover page text	X00
12	27	Ethernet	8/23/2002	Dell	Changed netname from 7705M_CLOCKRUN to 5705M_CLOCKRUN	Updated netname from 7705M_CLOCKRUN to 5705M_CLOCKRUN	X00
13	28	LAN Transformer	8/23/2002	Dell	Add 00 (0402 resistors) resistors to LAN_TX0-/LAN_TX0+, LAN_RX1-, LAN_RX1+, LAN_TX2-, LAN_TX2+, LAN_TX3-, LAN_TX3+	Add R776, R777, R778, R779, R780, R781, R782 and R783	X00
14	40	Power Control	8/29/2002	Dell	Using wrong Control signal of 1.8V rail drain on Q85.2	change the control signal of 1.8V rail drain from RUN_ON# to RUN_ON	X00
15	44	1.8V / 1.2V	8/29/2002	Compal	Change the control signal of 1.2VRUN from RUN_ON to RUNPWROK	Add PR766 connect to RUNPWROK, and reserved PR720 to NP	X00
16	47	Vcc_core	9/03/2002	Dell	Banias update PB00T voltage spec with 1.2V	change PR755 to 16.5K and PR757 to 15K	X00
17	40	Power Control	9/04/2002	Compal	System doesn't work in using battery only	change R606 value from 470K to 200K	X00
18	40	Power Control	9/04/2002	Compal	Reduce +3VSUS power rail up response time and solve unexpected step waveform	Depoplate C680	X00
19	16	VGA Board	9/04/2002	Compal	VGA no reference voltage detected	Poplate R124	X00
20	45	1.5V / 1.05V	9/05/2002	Compal	SUSPWROK_1P5V control signal detected glitch issue	Add PR767 and reserved PR742 to NP	X00
21	46	1.25V / 2.5V	9/05/2002	Compal	SUSPWROK_1P5V control signal detected glitch issue	Add PR768 and reserved PR605 to NP	X00
22	40	Power Control	9/26/2002	Dell	Fixes the 3VSRC to 3VRUN leakage problem	Change R603 to 220	X01
23	40	Power Control	9/26/2002	Dell	We need a Soft Start feature	Add C680 to 0.1uF	X01
24	20	ICH4-M	9/26/2002	Dell	Change Board Rev resistor to X01	Depopp R287, and Pop R286	X01
25	45	1.5V / 1.05V	9/26/2002	Dell	Add 0 ohm resistor at PU18 pin 15 and pin 16	Add PR769 and PR770 to 00	X01
26	46	1.25V / 2.5V	9/26/2002	Dell	Add a 0 Ohm resistor at PU11 pin 15	Add PR771 to 00	X01

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number	DDQ12/11/01 with LA-1901	Rev 3.0
Date: Wednesday, January 07, 2004 Sheet 51 of 59			

DELL CONFIDENTIAL/PROPRIETARY

Version Change List (P. I. R. List)

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
27	28	NIC high po issue	10/17/2002	DELL	Hi-pot test fail because RN1 pitch too close	change RN1 to R785~r788 to enlarge the pitch	X01
28	26	Add PD for BT	10/17/2002	DELL	leverage from LK	Add R789 10K PD to COEX1_BT_ACTIVE	X01
29	25	Dog h power rating	10/17/2002	Compal	The current rating of MOS and Bead is too small in Dog house	change Q1,F1,F2,L25 part to meet Doghouse power current requirement (F1&F2 create new symbol now)	X01
30	13	Fan soft start	10/17/2002	Compal	No soft start will cause +5VRUN droop low	change C127 and C110 pop(don't do it per Bo's command)	X01
31	22	cd audio pull down	10/18/2002	Compal	when we don't plug in CDrom, audio trace will floating	add R, R to tie the INT_CD_L/R ground	X01
32	22	reserve series ATA	10/18/2002	DELL	change some power/gnd to NC for reserve series ATA interface for module bay	change JMOD1pin8,10,14,16,9,11, to NC,conecct SATA_DET# to pin13	X01
33	20,22,34	add SATA detect	10/18/2002	DELL	Add series ATA detect in module bay	Add net sdat_det# from module bay to EC and remove original sio_lid_ec#	X01
34	31	change MINI PCI pin NC	10/18/2002	DELL	change MINI-PCI pin NC (No use)	Change JPCI pin109 and pin 123 to NC and remove R457,C576	X01
35	22	cr_ref return cap.	10/18/2002	DELL	add a pull down cap. for cd_ref near JMOD	Add C from CD_REF to gnd near JMOD and let it unpop	X01
36	29	Reserve PCMCIA suspend pin	10/18/2002	DELL	Reserve PCMCIA suspend pin not use	depop D11 and reserve it for TI_SUSPEND#	X01
37	40	Power Q-SW	10/18/2002	DELL	Lindberg change Q12,Q55,Q77 to big rating, we will wait the EA report and make a decision	TBD	X01
38	38	Add 1.8V PWRGD	10/18/2002	DELL	Add the 1.8V power good to power sequence	change the U12 pin 13 from RUN_ON to 1P8V_PWRGD	X01
40	25,34	change DH enable	10/22/2002	DELL	change dog house power enable pin independent	Add R and R seprate the control signal of DH	X01
41	10	change to normal part	10/22/2002	Compal	change to vender normal specification part	change C743 and C744 from 50V to 16V rating	X01
42	31	remove pin of MINI-PCI	10/24/2002	DELL	change pin def. of MINI-PCI	romove pin 118, 120 ground for JPCI	X01
43	42	remove some PS_ID	10/24/2002	DELL	remove some reserve PS_ID component	Remove PQ32, PR77, PR74, PR73	X01
44	26,31	duplicate pull down	10/24/2002	DELL	remove duplicate pull down	Remove R789 , only use R767	X01
45	29	remove not use part	10/24/2002	DELL	remove the reserve part for carrbus controller	Delete R185	X01
46	38	change the thermaltrip	10/24/2002	DELL	change the thermal shut down solution from MAX to discrete	del U6, R30, R24, add U2, C29, R28, R20~R23, C27, R53, C65	X01
47	28	ESD Safty issue	10/24/2002	Compal	JPH_RJ layout change connection from GND to NC.	JPH_RJ pin 6 change connection from GND to NC.	X01
48	40	+3VRUN, +3VSUS FET ISSUE	10/25/2002	DELL	+3VSUS AND +3VRUN POWER RAIL MOSFET PARTS CHANGED	Q12 AND Q77 CHANGE PARTS FROM SI3456 TO SI4810	X01
49	33	RGB Beads value changed	10/25/2002	DELL	Using 00 instead of beads	Change the value of L101, L102, L103, L14, L15, L16, L17, L18	X01
50	33	Rev. changed	10/25/2002	Compal	PI3L301A revision change to PI3L301BA	U30 Rev. changed	X01
51	25	Dog House	10/29/2002	DELL	Must Design as Lindberg	R25 changed value to 100K and R26 (10K) change to C940 (0.022u_0805)	X01
52	9,12,15	Bulk Cap.	10/29/2002	Compal	Height Restriction	Changed Height limit of C933,C934,C731,C779,C788,C789 to 1.9mm	X01
53	9	CPU Bypass	10/29/2002	DELL	Changed Voltage Limit of Bulk Cap. to 2V	C671~C675,C678 Changed Voltage Limit to 2V	X01

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number	DDQ12/11/01 with LA-1901	
		Rev	3.0
Date: Wednesday, January 07, 2004 Sheet 52 of 59			

DELL CONFIDENTIAL/PROPRIETARY

Version Change List (P. I. R. List)

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
54	41	PAD & ME Parts	10/30/2002	Compal	Need to BLOW OUT 2.5mm Radius from Vias used to transition Tip and Ring from InnerLayer 4 to Bottom layer	Deleted H43 to meet 2.5mm Radius gap	X01
55	28	Magnetic & RJ45	10/30/2002	DELL	LAN Analog Switch (PI3L301BA) serial Resistors change type to Inductors	R776-R783 changed value from 00 to 15nH Inductor (TDK MLK1005S15NJ)	X01
56	27	POP option to 5705	11/08/2002	Compal	change the POP option from 5702 to 5705	Depop L66, C344, C324 Pop R217, R549	X01
57	38	Thermal shut down to 6509	11/08/2002	DELL	change the thermal shut down solution from discrete to MAX	Add U6, R30, R24 Depop U2, C29, R28, R20-R23, C27, R53, C65	X01
58	27	LOM	11/27/2002	Compal	Depop dummy parts	Depop R388 (10K_0402) and C390 (0.01U_0402)	X02
59	41	PAD, ME, SPARE PARTS	11/27/2002	Compal	Add Cost-BOM parts	Add Z1(Switch-FPC), Z2(Touch_pad-FPC), Z3(MDC-Cable), Z4(Spk-mODULE), Z5(BT_Cable).	X02
60	9	Vcore Bypass CAP.	11/29/2002	Compal	Vcore by pass capacitors adjust for cost	Add C941-C944 (220UF_2V) Depop C671-C675, C678 (220UF_2V)	X02
61	40	Power Control	11/29/2002	Compal	package change for increase voltage tolerance	C680 changed package from 0402 to 0603	X02
62	20	ICH4	12/02/2002	Compal	Depop dummy part	Depop R529 (10K_0402)	X02
63	25	Dog House	12/04/2002	Compal	package change for component easy to buy	C940 changed package from 0805 to 0603	X02
64	30	Smart Card	12/11/2002	DELL	Need to implement 5 Smart Card changes.	Add R12, R26, C184 , C189 , Change C171 value from 390P to 470P	X02
65	27	BCM5705 By Pass	12/11/2002	DELL	Need to change package from 0805(4.7UF) to 1206(10UF) for cost	C339, C346, C352, C355, C393, C662, C368, C342	X02
66	All Pages	Page Symbol	12/13/2002	DELL	Put "DELL CONFIDENTIAL/PROPRIETARY" on Schematics	DELL CONFIDENTIAL/PROPRIETARY	X02
67	20	ICH4	12/13/2002	Compal	Delay Thermtrip to ICH4 so Intruder have time to get latch	Add C46 (0.1UF_0402)	X02
68	38	Thermtrip	12/17/2002	DELL	For Charger Selector Used (SIO_THERM_PWRDN net changed to SBAT_LOW)	Delete R206 & Q22	X02
69	27	BCM5705	12/17/2002	DELL	Delete 4401 Components	Delete U43, R388, C390, R367, R368	X02
70	28	LAN Transformer	12/17/2002	DELL	Delete 4401 Components	Delete R551 ~ R554	X02
71	28	LAN Transformer	12/18/2002	DELL	Changed Spec 2KV to 3KV	C1	X02
72	17	TV OUT	12/18/2002	DELL	Depop C14 for Cost	Depop C14	X02
73	33	DOCKING CONN.	12/18/2002	DELL	Remove RGB Bead	Delete L101, L102, L103, L14 ~ L18 & Trace	X02
74	23	AC,97 CODEC	12/18/2002	Compal	Added Resistors for TPS793475 LDO	Add R792, R793 (@)	X02
75	23	AC,97 CODEC	12/18/2002	DELL	Change the Value from 0 ohm to 1UF_0805	C636	X02
76	17	TV OUT	12/18/2002	DELL	Change RGB Bead Value & Package	Changed L5, L104, L105	X02
77	35	SIO	12/18/2002	Compal	ESD Cap is Needed on Reset to McCallen	Add D74 for ESD (@)	X02
78	30	Smart Card	12/19/2002	DELL	Added Cap (4.7uF_0805) for SCR_VCC_C to Depop	Add C945 for depop (@)	X02
79	17	TV OUT	12/19/2002	Compal	Depop C10, C11, C661 for RGB Signals	Depop C10, C11, C661(@)	X02

DELL CONFIDENTIAL/PROPRIETARY

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number	Rev	3.0
	DDQ12/11/01 with LA-1901		
Date:	Wednesday, January 07, 2004	Sheet	53 of 59

Version Change List (P. I. R. List)

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
80	40	Power Control	12/19/2002	Dell	Change ALW_ENABLE# control methos through OR gate	Added R794, R795, R796	X02
81	38	Thermtrip	12/19/2002	Dell	THERM_PWRDN add RC delay	Added R798, C946	X02
82	26	MDC, BT	12/19/2002	Dell	Pop JPT pin 7 resistor	Added R765	X02
83	35	SI0	12/19/2002	Dell	SBAT_LOW pull-up through 4.7K resistor	Added R797	X02
84	24	Phone JACK	12/20/2002	Dell	R252 to be connected to EXT_MIC_PLUG instead of EXTMIC_PLUG	R252	X02
85	24	Phone JACK	12/20/2002	Dell	add a 100PF cap to GND on Sheet 24 on the EXTMIC_PLUG so that signal is terminated as well for protection purposes	Added C947	X02
86	35	SI0	12/20/2002	Compal	To prevent ACAV from leaking Current for OTP event	Added R799, R800 & ACAV through AND gate	X02
87	20	ICH4M	12/20/2002	Dell	Board ID X02	Pop R278, R287 & Depop R279, R286	X02
88	35	SI0	12/20/2002	Dell	Add Battery Selector Circuit	U27.H13 netname changed to SBAT_LOW	X02
89	28	Magantic	12/21/2002	Dell	Change Magantic vendor to Transpower	L24 (GB1G04-T)	X02
90	19	ICH4	01/02/2003	Compal	Change RTC 32.768KHz Crystal to 10ppm	X5	X02
91	09, 12, 15	CPU, Odem, DDR bypass	01/03/2003	Dell	Reduce Component Hight from 3.1mm to 2.8mm	C78, C796, C910, C935, C936	X02
92	19	ICH4	01/07/2003	Compal	Change Cap Value from 15pF to 12pF to Improve Frequency Tolerance	C581, C586	X02
93	21	ICH4	01/07/2003	Dell	Change Cap Height Dimension for placing Height Restriction Area	C585	X02
94	20	ICH4	01/20/2003	Dell	Change Board ID to X03	Pop R286 Depop R287	X03
95	39	JLID	01/20/2003	Compal	Change for Switch-Board EMI solution	Depop R214	X03
96	35	SI0	01/22/2003	Compal	Change Footprint for ESD	D74 (@)	X03
97	27	LOM	01/30/2003	Dell	Change Resister Value for RDAC	R318 (1.18K)	X03
98	38	Thermtrip	01/30/2003	Dell	Change Trip Temperature Point to 86 C for OTP	R24 (22.6K)	X03
99	28	Magantic	01/30/2003	Compal	Added Pull Down Resister to prevent LOM LED from doing abnormal behavior.	Added R400, R401, R402	X03
100	17	TV-Out / CRT	02/06/2003	Dell	CRT H/V sync Need to NO-POP	Depop R6, R16	X03
101	25	USB 2.0	02/06/2003	Dell	Reduce Component Hight from 3.1mm to 2.8mm	C300, C304, C329	X03
102	27	LOM	01/30/2003	Dell	Back to The Original Resister Value for RDAC	R318 (1.15K)	X03
103	38	Thermtrip	02/12/2003	Dell	Change Trip Temperature Point to 84.5 Degree C for OTP	R24 (24K)	X03
104	20	ICH4M	02/17/2003	Dell	Changed Board ID to A00	Pop R279, R280, R287 & Depop R278, R281, R286	A00
105	28	Magantic	02/17/2003	Dell	Changed Reversion of LAN Analog Switch to Rev:D	U30	A00

DELL CONFIDENTIAL/PROPRIETARY

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number	Rev	
	DDQ12/11/01 with LA-1901	3.0	
Date:	Wednesday, January 07, 2004	Sheet	54 of 59

Version Change List (P. I. R. List)

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
106	27	LOM	02/11/2003	Dell	Added 4401 Optional Circuit	Added U43, R367, R368, R388, C390 (1@)	X00
107	25	USB 2.0	02/11/2003	Compal	DH_PWRSRC_OC Pull-Down for L2	Added R403 (1@)	X00
108	25	USB/DH	02/11/2003	Dell	Added TPS2042 to Replace TPS2043 for Lindbergh2	Added U70 (1@)	X00
109	34	SIO	02/12/2003	Compal	PR65 Has Wrong Naming Rule and Have to Rename to R405	Deleted PR65 Added R405	X00
110	27	LOM	02/18/2003	Dell	Need to Add Pin A7 with Bead for +3VRUN and +V_3P3_LAN	Added L109(1@), L110(2@)	X00
111	28	Magnetic	03/11/2003	Compal	LAN Analog Switch Pin 14 Changed to NC	U30	X00
112	25	USB/DH	03/18/2003	Dell	put the pads for zero ohms pop options for L21, L22 , L23, L28, L41, L13 common mode choke.	Added R348-R359 (@)	X00
113	27	LOM	03/18/2003	Dell	1K for 4401 and 4.7K for 5705M [Overlap with R317(2@)]	Added R317 (1@)	X00
114	20	ICH4M	03/18/2003	Compal	Board ID X00 (LBK-Adds)	Pop R267, R281, R279, R287 Depop R286, R278, R280, R266	X00
115	25	USB/DH	03/25/2003	Dell	ESD diodes for the DH_SMBus	Added D30 (@)	X00
116	34	SIO	04/01/2003	Dell	MiniVU Future Platform Requirements	Added Q100, R360, R361 (@)	X00
117	17	TV Out	04/04/2003	Compal	Put the Pads in to Reserve the Possibility of Removing the Transformer (L57) in the Future	Added L126 (@)	X00
118	06, 23	CLOCK Gen / CODEC	04/07/2003	Dell	Remove 24.576MHz Crystal for Codec	Added R551-R553, C560. Depop X7, C616 (@). C622 (22P to 0 ohm)	X00
119	25	USB/DH	04/23/2003	Dell	ESD diodes for the DH_SMBus (Pop Option Implement)	Pop D30 (2@)	X00
120	34	SIO	04/23/2003	Dell	MiniVU Future Platform Requirements	Pop Q100, R360, R361	X00
121	41	PAD	04/29/2003	Compal	EMI CLP21 have chance to short test point.	Depop CLP21	X00
122	32, 33	Docking	04/29/2003	Dell	DOCK PCI Components Removed for Lindbergh Series	U34, U35, u36,C40, C659, U3, R36, C31, U14, U17, U18 (All for 2@)	X00
123	20	ICH4M	05/29/2003	Compal	For the DPRSLPVR issue	Added R460 (100K)	X01
124	20	ICH4M	05/29/2003	Compal	Board ID X01 (LBK-Adds)	Pop R286 Depop R287	X01
125	27	LOM	06/05/2003	Dell	RDAC 1.18K for 4401 and 1.15K for 5705M	R318	X01
126	20	ICH4M	06/13/2003	Compal	Board ID A00 (LBK-Adds)	Pop R287, R278 and depop R286, R279	A00
127	25	USB 2.0	06/18/2003	Dell	Using 0 ohm resistor to substitute common choke	Pop R348-R359 and depop L21, L41, L22, L23, L28, L13	A00
128	13	ITP Debug CONN. & FAN	06/18/2003	Compal	Change pullup R42, R43 to 2.2K to fix SMBus issue	R42, R43	A00
129	6	Clock Gen.	06/18/2003	Compal	Change R98 and R551 to 10ohm to meet SMSc spec.	R98, R551	A00
130	23	AC97	06/18/2003	Dell	Change R284 to 49.9ohm for modem issue with BitCLK issue	R284	A00
131	28	LAN TRANSFORMER	06/18/2003	Dell	Add diode to LAN_ACTLED to prevent damage to the LAN chipset through backdrive	Add D75	A00

DELL CONFIDENTIAL/PROPRIETARY

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number		Rev
	DDQ12/11/01 with LA-1901		3.0
Date:	Wednesday, January 07, 2004	Sheet 55 of 59	

Version Change List (P. I. R. List)

[illegible]

Version Change List (P. I. R. List) for Power Circuit

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
1	42	Power DC-IN	8/20/2002	Dell	Change PQ32, PR73, PR74, PR77 to NP	R318 change the value from 12400 to 11400	X00
2	44	1.8V / 1.2V	8/29/2002	Compal	Change the control signal of 1.2V RUN from RUN_ON to RUNPWROK	Change netname from 4401_CLOCKRUN to 7705M_CLOCKRUN	X00
3	47	Vcc_core	9/03/2002	Dell	Banias update PB00T voltage spec with 1.2V	Change PR755 to 16.5K and PR757 to 15K	X00
4	45	1.5V / 1.05V	9/05/2002	Compal	SUSPWROK_1P5V control signal detected glitch issue	Add PR767 and reserved PR742 to NP	X00
5	46	1.25V / 2.5V	9/05/2002	Compal	SUSPWROK_1P5V control signal detected glitch issue	Add PR768 and reserved PR605 to NP	X00
6	45	1.5V / 1.05V	9/26/2002	Dell	Add 0 ohm resistor at PU18 pin 15 and pin 16	Add PR769 and PR770 to 00	X01
7	46	1.25V / 2.5V	9/26/2002	Dell	Add a 0 Ohm resistor at PU11 pin 15	Add PR771 to 00	X01
8	45	1.5V / 1.05V	10/17/2002	Compal	Turn off have glitch because +3VSUS issue, so pull high to +5VSUS can improved	Add PR780 to 10K0	X01
9	45	1.5V / 1.05V	10/17/2002	Compal	Intersil Issue can solved by Fairchild solution Change the control signal of 1.05VSUS from RUNPWROK to SUSPWROK_5V	Add PR772, PR773 and change PC282 to 0.01U_0805 size	X01
10	44	1.8V / 1.2V	10/17/2002	Dell	Change the 1.8V RUN Regulator from CM3718 to MAX1927	Change +1.8V Regulator	X01
11	45	1.5V / 1.05V	10/17/2002	Dell	+1.5VSUS POWER GOOD ISSUE	change PL124 to 5.0U_20%_3.0A to 4.7U_20%_3.9A	X01
12	44-48	All Regulators	10/17/2002	Dell	Add test point for DELL testing	Add PR778, PR783, PR784, PR781, PR782, PR785, PR786 to NP for Test point	X01
13	49	Battery charger	10/23/2002	Dell	Fast Charger for short time and Cost-Down	Add P303 and Change PC202, PC203, PC204, PC211, PC212, PC213 to 10U_1210 and Delete PU15's circuit Change PR636 to 43.2K ohms for 65W Adapter plug in	X01
14	45	1.5V / 1.05V	10/23/2002	Dell	Change OCSETt and SEN Resistor	change PR735, PR736 to 75K ohms, Change PR727 to 330 ohms, Change PR728 to 634 ohms	X01
15	47	Vcc_core	10/28/2002	Dell	Cost-Down and change deepsleep offset	Change PR744, PC243, PC251, PC252, PR765 For adjusts slope and sleep offset PQ7, PQ11, PD24, PD27 to NP for Cost-Down	X01
16	47	Vcc_core	10/28/2002	Dell	EMI Broad band ISSUE	Add PC304 PC306 to 0.1U, Add PC305 PC307 to 2200P change PR747 PR756 to 3.3 ohms	X01
17	50	PWR_Selector	11/14/2002	Compal	Charger selector ISSUE	Add PR649, Del PD48, Change PD49 PD51 to B540C and Change PR657 PR662 to 33K	X02
18	42	Power DC-IN	11/20/2002	Dell	AC-IN Detect Issue	Change PR70 to 4.7K	X02
19	49	Battery charger	11/26/2002	Dell	Charger Current to 5.3A	Change PR627 to 28m ohms	X02

Compal Electronics, Inc.			
Title			
Changed-List History			
Size	Document Number	DDQ12/11/01 with LA-1901	Rev 3.0
Date: Wednesday, January 07, 2004 Sheet 57 of 59			

DELL CONFIDENTIAL/PROPRIETARY

Version Change List (P. I. R. List) for Power Circuit

Item	Page#	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
20	47	Vcc_core	11/29/2002	Compal	Delete V-core Cap for Cost-Down	Delete PC232 PC233 PC246 PC247 for Cost-Down	X02
21	50	PWR_Selector	12/16/2002	Dell	New Battery selector switch design to support secondary battery discharge before primary	Delete PQ72, PQ73 Change PQ86 to Dual-Mosfet ,Add PQ88 Mosfet Add PU19, PC308, PC309, U20B, PQ89, PQ90, PD57 And PR787, PR788, PR789, PR790, PR791, PR792, PR793 PR794, PR795@, PR796, PR797, PR798, PR799, PR800	X02
22	42	Power DC-IN	12/17/2002	Dell	EFT Issue and Dell request	Add PQ91, PD58 PR762 to depop	X02
23	42	Power DC-IN	12/18/2002	Compal	EFT Issue	Add PR801 to depop	X02
24	42	Power DC-IN	12/19/2002	Dell	Added PS_ID Pull-up	Add PR802 (4.7K_0402)@	X02
25	42	Power DC-IN	12/19/2002	Dell	Added +DC_IN 10K_0805 Pull-down to GND to solve potential adapter insertion securncing issue	Add PR803 (10K_0805)	X02
26	49	Chaqrger	12/20/2002	Dell	Added m0 resistor in pallear with PR627 to support 6.0Amp maximun charging current	Add PR804 0.05m0_2512)	X02
27	49	Chaqrger	12/20/2002	Dell	Changed the Value of PR627 from 0.028 to 0.05	PR627 chande to 50m ohms	X02
28	44	1.8V / 1.2V	12/20/2002	Compal	Prevent 3.3ALW voltage droop during OTP & ThermTrip shutdown	Added PU20 (@)	X02
29	49	Chaqrger	12/20/2002	Dell	Changed the Value of PL120 from 6.0U to 5.6U	PL120 chande to 5.6UH_+-20%_8.8A	X02
30	42	Power DC-IN	12/20/2002	Dell	Prevent Bondi PS_ID Pin Issue	Add PR762 and PQ91@	X02
31	42	Power DC-IN	12/31/2002	Compal	Change SI4435 to SI4825 to Increase Design Margin	PQ1	X02
32	42	Power DC-IN	01/22/2003	Dell	Prevent Bondi PS_ID Pin Issue	Pop PQ91, PR802 Depop PR762	X03
33	42	Power DC-IN	01/22/2003	Compal	Change Footprint	PD58	X03
34	45	1.5V / 1.05V	01/30/2003	Dell	ISL6225B swing issue	Change PU11, PU18 to ISL6225CA & PC285 to 330uF_2.5V_15m0 Depop PR730, Pop PR734 to 00	X03
35	43	Battery Conn.	03/05/2003	Dell	To Use Common Part as Bondi (Change PN to DC04001440L)	JSBAT	A00
36	49	Chaqrger	03/05/2003	Compal	To Reduce RTC Bridge Battery Leakage Current (Changed Power Plane from +RTC_PWR to +5VALW)	PU13. PC216, PR637, PC217, Depop PR641	A01
37	42	Power DC-IN	04/07/2003	Dell	Reserve zero ohm bypass resistor for Rbatt fuse	Adding PR850(@)	X00
38	42	Power DC-IN	04/07/2003	Dell	Fuse PFS2 Removed and Diode PD3 Shorted. The RBAT Blow Up (200 deg F). POP the Fuse instead of the 0hom resister.	Pop PFS2 Depop PR850	X00
39	45	1.5V / 1.05V	04/23/2003	Dell	Increased OCP for S3 Issue. (3300 to 7320)	PR727	X00
40	47	Vcc_core	06/13/2003	Dell	CPU_core PWM SC1476 IC issue	Adding PR901, PR902 to 100K, PR903(@) PR904(@)	A00
41	47	Vcc_core	07/29/2003	Dell	PWM SC1476 Chip issue solution for First system on	Adding PD60	A01
42	47	Vcc_core	10/15/2003	Compal	SC1476 chip update to R6 Version for fixed First start-up issue	Change PU1 to R6 Version chip, and delete PD60 diode	A01

Compal Electronics, Inc.			
Title			
Changed-List History-2			
Size	Document Number	DDQ12/11/01 with LA-1901	Rev 3.0
Date: Wednesday, January 07, 2004	Sheet	58	of 59

DELL CONFIDENTIAL/PROPRIETARY

Version Change List (P. I. R. List) for Power Circuit

[illegible]

First start-up issue

Compal Electronics, Inc.				
Title				
Changed-List History-3				
Size	Document Number			Rev
	DDQ12/11/01 with LA-1901			3.0
Date:	Wednesday, January 07, 2004	Sheet	59	of 59